

ASS. REC. BY:

REF: AGZ/210115791KV f3

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s Thiam Heng Trust

Insured: SJC 5451P

Policy No. _____


Claims No. C10012434/CD

Sum Insured: _____ Excess: _____
(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

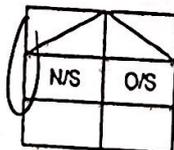

Bal. or Market Value: \$74K

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 11 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SGK 9828D Yr Regn: 10, 19

Type: M Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or _____

Make: Hyundai 41 Avenue S.c.c 1591

Colour: M. Blue A/C: Insured / Std / NI / NA

Sp. Reading: 122548 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KM11D841CMLU 010006

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or _____

Brake: In order / Jammed / Leaked / Burnt or _____

Mod: Nil / S/Rlm / STD / Rlm or _____

Tyre Size: Tourado 205/55R16

R: Kumho

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or _____

Front: _____ Rear: _____

R/Bal. 9 mm R/Bal. 6 mm

L/Bal. 9 mm L/Bal. 6 mm

D.O.A. 11/11/21 D.O.I. 15/11/2021

Survey held at _____

Des. of Damages: Nil / Rear / O/S / N/S / U/C / Rooftop or _____

nil body
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
28/12/21	Kenneth confirmed LS \$8300 (Red 11921.96, 58%)

Date/Time, File Pass to? : Prell. Report
 : Final Report

Date/Time, File Return to? 28/12/21-typist

Report Format : TP
Lump Sum / I.B.: (\$ 8300)

Days Of Repair: 11
Resurvey No. of Trip: 2

Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech Invs (\$)
 : Weekend (\$)

Survey Fee:	_____
Transportation:	_____
S - RS. SI	_____
Fuel	_____
Others	_____
TOTAL	_____

Thiam Heng Huat Pte Ltd


176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Mobile: 82636295 Email: thiamhenghuat@gmail.com

Make/Model: HYUNDAI AVANTE
 Engine/Chassis No.: KMHD841CMLU010006
 Date of accident:
 Damaged area: N/S

Not authorized
1 Day @
Payment After Repair
11 days

Date: 12/11/2021
 Claim Type: TP
 VRN: SGK9828D

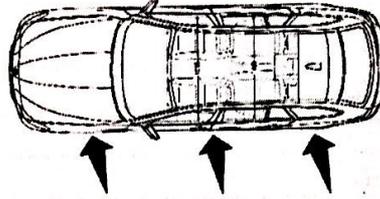

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front door n/s	1	\$ 925.00	\$ 925.00
2	Front door upper hinge n/s	1	\$ 62.00	\$ 62.00
3	Front door lower hinge n/s	1	\$ 62.00	\$ 62.00
4	Front door weatherstrip n/s	1	\$ 185.00	\$ 185.00
5	Front door inner lock n/s	1	\$ 346.00	\$ 346.00
6	Front door inner trim board n/s	1	\$ 572.00	\$ 572.00
7	Front door outer handle n/s	1	\$ 213.00	\$ 213.00
8	Front door lock switch n/s	1	\$ 134.00	\$ 134.00
9	Front door window channel n/s	1	\$ 104.00	\$ 104.00
10	Front door window chrome moulding n/s	1	\$ 65.00	\$ 65.00
11	Front door window regulator n/s	1	\$ 269.00	\$ 269.00
12	Front door window regulator motor n/s	1	\$ 383.00	\$ 383.00
13	Front door stopper n/s	4	\$ 7.90	\$ 31.60
14	Front door lock striker n/s	1	\$ 65.00	\$ 65.00
15	Front door checker n/s	1	\$ 59.00	\$ 59.00
16	Rear door n/s	1	\$ 828.00	\$ 828.00
17	Rear door upper hinge n/s	1	\$ 62.00	\$ 62.00
18	Rear door lower hinge n/s	1	\$ 62.00	\$ 62.00
19	Rear door weatherstrip n/s	1	\$ 185.00	\$ 185.00
20	Rear door inner lock n/s	1	\$ 316.00	\$ 316.00
21	Rear door inner trim board n/s	1	\$ 572.00	\$ 572.00
22	Rear door outer handle n/s	1	\$ 253.00	\$ 253.00
23	Rear door window channel n/s	1	\$ 104.00	\$ 104.00
24	Rear door window chrome moulding n/s	1	\$ 65.00	\$ 65.00
25	Rear door window regulator n/s	1	\$ 269.00	\$ 269.00
26	Rear door window regulator motor n/s	1	\$ 383.00	\$ 383.00
27	Rear door stopper n/s	4	\$ 7.90	\$ 31.60
28	Rear door lock striker n/s	1	\$ 43.00	\$ 43.00
29	Rear door checker n/s	1	\$ 59.00	\$ 59.00
30	Front fender n/s	1	\$ 702.00	\$ 702.00

Handwritten checkmarks and 'X' marks in the right margin of the table, indicating the status of each item.

Repair Estimate

31	Front fender cowling n/s	Per	1	\$ 185.00	\$ 185.00	X
32	Front fender splash guard n/s	Per	1	\$ 76.00	\$ 76.00	X
33	Front bumper	Per	1	\$ 676.00	\$ 676.00	X
34	Front bumper retainer	Per	2	\$ 85.00	\$ 170.00	X
35	Front lower arm n/s		1	\$ 421.00	\$ 421.00	?
36	Front shock absorber n/s		1	\$ 355.00	\$ 355.00	?
37	Front shock absorber top mount n/s		1	\$ 53.00	\$ 53.00	?
38	Front wheel knuckle n/s		1	\$ 365.00	\$ 365.00	?
39	Front wheel hub n/s		1	\$ 266.00	\$ 266.00	?
40	Front stabilizer end link n/s	Per	1	\$ 115.00	\$ 115.00	X
41	Rocker panel n/s	Per	1	\$ 623.00	\$ 623.00	✓
42	Rocker panel skirting n/s	NSP	1	\$ 515.00	\$ 515.00	X
43	Headlamp n/s	Per	1	\$ 951.00	\$ 951.00	X
44	Rear lower arm n/s		1	\$ 421.00	\$ 421.00	?
45	Rear shock absorber n/s		1	\$ 355.00	\$ 355.00	?
46	Rear shock absorber top mount n/s		1	\$ 53.00	\$ 53.00	?
47	Rear wheel knuckle n/s		1	\$ 365.00	\$ 365.00	?
48	Rear wheel hub n/s		1	\$ 266.00	\$ 266.00	?
49	Rear fender n/s	Per	1	\$ 857.00	\$ 857.00	✓
50	Rear fender cowling n/s	Per	1	\$ 185.00	\$ 185.00	X
51	Wing mirror assy n/s	GA/10M	1	\$ 413.00	\$ 413.00	✓
52	Rear bumper	Per	1	\$ 574.00	\$ 574.00	X
53	Rear bumper side retainer	Per	2	\$ 65.00	\$ 130.00	X
54	Rear bumper splash guard n/s	Per	1	\$ 66.00	\$ 66.00	X
55	B pillar n/s	Per	1	\$ 983.00	\$ 983.00	X
56	Rear windscreen moulding	Per	1	\$ 127.00	\$ 127.00	✓
Subtotal					\$ 16,976.20	
List discount					20.00%	
Total					\$ 13,580.96	

Special nett items						
No.	Parts description		QTY	UNIT PRICE	AMOUNT	
1	Front door inner trim board clips n/s	Per	8	\$ 5.50	\$ 44.00	✓
2	Rear door inner trim board clips n/s	Per	8	\$ 5.50	\$ 44.00	X
3	Rocker panel sealant n/s		1	\$ 100.00	\$ 100.00	301N
4	Front fender cowling clips n/s	Per	8	\$ 5.50	\$ 44.00	X
5	Front bumper clips	Per	10	\$ 5.50	\$ 55.00	X
6	Front alloy wheel n/s	Per	1	\$ 550.00	\$ 550.00	✓
7	Front tyre n/s	Per	1	\$ 280.00	\$ 280.00	X
8	Rear alloy wheel n/s	Per	1	\$ 550.00	\$ 550.00	✓
9	Rear tyre n/s	Per	1	\$ 280.00	\$ 280.00	X
10	Window visor set	Per	1	\$ 250.00	\$ 250.00	1001N
11	Rear windscreen sealant	Per	1	\$ 100.00	\$ 100.00	401N
12	Rear fender cowling clips n/s	Per	8	\$ 5.50	\$ 44.00	X
13	Sundries	Per	1	\$ 50.00	\$ 50.00	X
Total					\$ 2,391.00	

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew the accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	8	\$ 1,600.00
2	To disconnect both n/s doors wire harness and electrical component to facilitate repairs, reconnect and check functions of power windows.	0.5	\$ 100.00
3	To rust proof all affected portions after repair.	0.5	\$ 100.00
4	To remove and refit both n/s tyres & rims for replacement. To perform tyre balancing.	0.5	\$ 100.00
5	To remove and refit n/s front & rear undercarriage for replacement of parts.	1.5	\$ 300.00
6	To conduct computerized 4 wheel alignment.	0.5	\$ 100.00
7	Supply spray paint material and necessary items to respray affected area / panel.	8	\$ 1,600.00
8	To remove and refit interior upholstery to facilitate repair work.	1	\$ 200.00
9	To remove and refit rear windscreen for replacement.	0.75	\$ 150.00
Total labour			\$ 4,250.00

12001
✓
✓
801
7
801
14001
1001
1201

Estimate Grand Total	\$ 20,221.96
-----------------------------	---------------------

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed **and** is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 11/11/2021 17:38 (SGT)
Date of Accident 10/11/2021 19:20 (SGT)
Exact Location of Accident Marina Blvd, Singapore
Additional Location Information MARINA BOULEVARD
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number **SGK9828D**

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner LEONG YOKE KAY
NRIC No SXXXX690Z
Email Address LEONGYOKEKAY@SINGNET.COM.SG
Mobile Phone No (Phone) +65-97868263
Alternative Phone No (Home) +65-97868263

VEHICLE PARTICULARS

Manufacturer Hyundai
Model Avante
Variant -
Exact purpose for which vehicle was being used at time of accident Private hire
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private hire
Transmission Auto
CC 1591

INSURANCE COMPANY

Name of Insurance Company EQ Insurance Company Ltd
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMCTHQ21-000030
Cover Note Number 29/10/2021 TO 28/10/2022

DRIVER

Name of Driver LEONG YOKE KAY
NRIC No SXXXX690Z

Sheares Ave



- Ⓐ = SGK982PD
- Ⓑ = SJC5451P