

Repair Estimate


Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721
 Mobile: 82636295 Email: thiamhenghuat@gmail.com

Make/Model: HYUNDAI AVANTE
 Engine/Chassis No.: KMHD841CMLU010006
 Date of accident:
 Damaged area: N/S

Date: 12/11/2021
 Claim Type: TP
 VRN: SGK9828D

Not Authorized
11 Day @ 8300h
Return After Pain
11 days

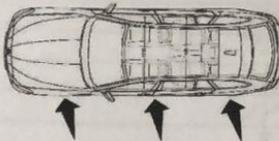

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front door n/s	Ry 1	\$ 925.00	\$ 925.00
2	Front door upper hinge n/s	R 1	\$ 62.00	\$ 62.00
3	Front door lower hinge n/s	Diy 1	\$ 62.00	\$ 62.00
4	Front door weatherstrip n/s	Sm 1	\$ 185.00	\$ 185.00
5	Front door inner lock n/s	Rd 1	\$ 346.00	\$ 346.00
6	Front door inner trim board n/s	My CM 1	\$ 572.00	\$ 572.00
7	Front door outer handle n/s	Sm 1	\$ 213.00	\$ 213.00
8	Front door lock switch n/s	Sm 1	\$ 134.00	\$ 134.00
9	Front door window channel n/s	Sm 1	\$ 104.00	\$ 104.00
10	Front door window chrome moulding n/s	Sm 1	\$ 65.00	\$ 65.00
11	Front door window regulator n/s	Ry 1	\$ 269.00	\$ 269.00
12	Front door window regulator motor n/s	Sm 1	\$ 383.00	\$ 383.00
13	Front door stopper n/s	Sm 4	\$ 7.90	\$ 31.60
14	Front door lock striker n/s	R 1	\$ 65.00	\$ 65.00
15	Front door checker n/s	Sm 1	\$ 59.00	\$ 59.00
16	Rear door n/s	Ry 1	\$ 828.00	\$ 828.00
17	Rear door upper hinge n/s	R 1	\$ 62.00	\$ 62.00
18	Rear door lower hinge n/s	R 1	\$ 62.00	\$ 62.00
19	Rear door weatherstrip n/s	Sm 1	\$ 185.00	\$ 185.00
20	Rear door inner lock n/s	R 1	\$ 316.00	\$ 316.00
21	Rear door inner trim board n/s	Sm 1	\$ 572.00	\$ 572.00
22	Rear door outer handle n/s	Sm 1	\$ 253.00	\$ 253.00
23	Rear door window channel n/s	Sm 1	\$ 104.00	\$ 104.00
24	Rear door window chrome moulding n/s	Sm 1	\$ 65.00	\$ 65.00
25	Rear door window regulator n/s	R 1	\$ 269.00	\$ 269.00
26	Rear door window regulator motor n/s	Sm 1	\$ 383.00	\$ 383.00
27	Rear door stopper n/s	Sm 4	\$ 7.90	\$ 31.60
28	Rear door lock striker n/s	R 1	\$ 43.00	\$ 43.00
29	Rear door checker n/s	Sm 1	\$ 59.00	\$ 59.00
30	Front fender n/s	Ry 1	\$ 702.00	\$ 702.00

Handwritten checkmarks and 'X' marks in the right margin of the table, indicating the status of each item.

Repair Estimate

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew the accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	8	\$ 1,600.00
2	To disconnect both n/s doors wire harness and electrical component to facilitate repairs, reconnect and check functions of power windows.	0.5	\$ 100.00
3	To rust proof all affected portions after repair.	0.5	\$ 100.00
4	To remove and refit both n/s tyres & rims for replacement. To perform tyre balancing.	0.5	\$ 100.00
5	To remove and refit n/s front & rear undercarriage for replacement of parts.	1.5	\$ 300.00
6	To conduct computerized 4 wheel alignment.	0.5	\$ 100.00
7	Supply spray paint material and necessary items to respray affected area / panel.	8	\$ 1,600.00
8	To remove and refit interior upholstery to facilitate repair work.	1	\$ 200.00
9	To remove and refit rear windscreen for replacement.	0.75	\$ 150.00
Total labour			\$ 4,250.00
Estimate Grand Total			\$ 20,221.96

12001
✓
✓
801
2801
801
14001
1001
1201

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: