

ASS. REC. BY: TCum

REF:

CCA/4RB21011869/Be53Asker

ASSIGNMENT

From: _____ Date: 22/11/2021

Estimated Cost: _____

OD / ☒ WS / TP RES / OD RES / EVA / INV / MVTo Inspect Vehicle No: SJR 4685Jat Workshop m/s Dean Auto proof 160 Stru Ming Dr #01-14

Insured: _____

Policy No. _____

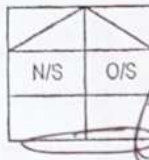
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of Inspection.Bal. or Market Value: 17000/r

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 9 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS WP

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SJR 4685J Yr Regn: 25/6/2009Type: ☒ Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or _____

Make: Kia Cerato c.c. 1591Colour: White A/C: ☐ Insured / ☐ Std / ☐ NI / ☐ NASp. Reading: 203985 T/Radio: ☐ Insured / ☐ Std / ☐ NI / ☐ NAEng/No: G4FC9H262894C/No: KNAFH221395085825Gen. Cond: Good / Fair / ☒ Poor / BurntSteering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt orBrake: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt or

Modi: Nil / S/Rim / STD A/Rim or _____

Tyre Size: F: 215/45/17R: 215/45/17BS / ☒ PUN / ☐ EXNOVA / ☐ GY / ☐ FS / ☐ LIZA / ☐ MIC / ☐ OHTSU / ☐ PIR / ☐ SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. 5 mm R/Bal. 5 mmL/Bal. 5 mm L/Bal. 5 mmD.O.A. 9/11/2021 D.O.I. 22/11/2021Survey held at Dean Auto proDes. of Damages: Frt / ☒ Rear / ☒ N/S / ☐ U/C / ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>Range 8,000/- - 9,000/-</u>
	<u>Recommended CER is LS \$8,050.00</u> <u>TCum Lin</u>
	<u>MV 17000/r</u>
	<u>PV 7,442/r</u>
	<u>NV 9,558/r</u> <u>TCum Lin</u>
	<u>27/12/2021</u>

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Report Format: _____

Lump Sum / L.S.I: _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$ 1)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS \$ _____

Photos

Others

TOTAL

Team AutoPro Pte Ltd 160 Sin Ming Dr, #02-12 Sin Ming AutoCity Singapore 575722

Tel: 8269-9999 Email: estimate.tap@gmail.com / teamautoprote@gmail.com

SJE :

Vehicle Nos : **SJR 4685 J**

Date of Survey :

Model : **KIA CERATO**

Date of ReSurvey:

After-Paint:

Year : **2009**

Contacts :

Chassis No : **KNAFH221395085825***** AGREED Cost Of Repair and Repair Day/s with SJE ***

Amount:

Working Day:

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$	
1	BOOTLID	1	\$ 854.00	\$ 854.00 615.00	DDV
2	BOOTLID LOGO	1	\$ 62.00	\$ 62.00 48.00	NECV
3	BOOTLID OUTER GARNISH	1	\$ 310.00	\$ 310.00 204.50	BRV
4	BOOTLID LAMP	2	\$ 582.00 405.00	\$ 1,164.00 810.00	BRV
5	BOOTLID LOCK	1	\$ 265.00	\$ 265.00 78.50	JMV
6	BOOTLID LOCK STRIKER	1	\$ 58.00	\$ 58.00	NDX
7	BOOTLID WEATHER STRIP	1	\$ 148.60	\$ 148.60 72.00	TNV
8	BOOTLID INNER TRIM BOARD	1	\$ 189.00	\$ 189.00 ✓ 189.00	BRV
9	BOOTLID ANTENNA SENSOR	1	\$ 258.60	\$ 258.60	NSX
10	BOOTLID HINGE	2	\$ 84.00	\$ 168.00	NDX
11	REAR BUMPER	1	\$ 988.00	\$ 988.00 576.40	BRV
12	REAR BUMPER SIDE RETAINER	2	\$ 88.60 28.00	\$ 177.20 56.00	NECV
13	REAR BUMPER REINFORCEMENT	1	\$ 458.00	\$ 458.00 354.00	BRV
14	REAR BUMPER REINFORCEMENT BRACKET	2	\$ 224.00 68.00	\$ 448.00 136.00	BTU
15	REAR BUMPER INNER SPONGE	1	\$ 187.00	\$ 187.00	NSX
16	REAR BUMPER REVERSE SENSOR	4	\$ 258.00	\$ 1,032.00 200.00	SCV
17	REAR END PANEL	1	\$ 589.60	\$ 589.60 349.00	DDV
18	REAR END PANEL TOP GARNISH	1	\$ 98.00	\$ 98.00 ✓ 98.00	BRV
19	REAR FENDER INNER TRIM	RH 1 2	\$ 236.00	\$ 472.00 211.30	TNV
20	SPARE TYRE PANEL	1	\$ 584.20	\$ 584.20 ✓ 584.20	DDV
21	SPARE TYRE PANEL TOP BOARD	1	\$ 320.00	\$ 320.00	NDX
22	REAR FENDER RH	1	\$ 942.60	\$ 942.60 720.20	DDV
23	REAR FENDER INNER TRIM BOARD	2	\$ 236.00	\$ 472.00	RPTX
24	REAR FENDER INNER COWLING RH	1	\$ 148.00	\$ 148.00	NDX
25	REAR FENDER AIR VENTS RH	1	\$ 67.00	\$ 67.00	NDX
26	REAR WINDSCREEN MOULDING	1	\$ 195.30	\$ 195.30 185.00	NECV
27	TAIL LAMP	2	\$ 652.30 243.50	\$ 1,304.60 487.00	BRV
28	TAIL LAMP LOWER BRACKET	2	\$ 92.00	\$ 184.00	NSX
29	TAIL LAMP BASE PANEL	2	\$ 246.30	\$ 492.60 ✓ 492.60	DDV

30	REAR EXHAUST PIPE	1	\$	782.60	\$	782.60
31	REAR EXHAUST PIPE HEAD SHIELD	1	\$	192.00	\$	192.00
32	REAR EXHAUST PIPE MOUNTING	2	\$	72.00	\$	144.00
				Parts Sub Total :	\$	6466.70 13,755.90
				DISC 10%	\$	746.67 1,375.59
				PARTS TOTAL :	\$	12,380.31

5820.03

NDX
} NDX

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$
1	SUNDRIES	1	\$ 80.00	\$ 80.00
2	BOOTLID SEALANT	1	\$ 100.00	\$ 30.00 100.00
3	BOOTLID OUTER GARNISH CLIPS	1	\$ 50.00	\$ 20.00 50.00
4	BOOTLID LAMP CLIPS	2	\$ 50.00	\$ 100.00
5	BOOTLID LAMP SEAL	2	\$ 50.00	\$ 60.00 100.00
6	BOOTLID INNER TRIM BOARD CLIPS	1	\$ 50.00	\$ 30.00 50.00
7	BOOTLID SPOILER	1	\$ 980.00	\$ 600.00 980.00
8	REAR BUMPER CLIPS	1	\$ 50.00	\$ 30.00 50.00
9	REAR BUMPER DIFFUSER	1	\$ 850.00	\$ 211.60 850.00
10	REAR BUMPER DIFFUSER CLIPS	1	\$ 50.00	\$ 20.00 50.00
11	REAR BUMPER REVERSE SENSOR SEAL	4	\$ 24.00 -62.00	\$ 96.00 248.00
12	REAR END PANEL SEALANT	1	\$ 100.00	\$ 30.00 100.00
13	REAR END PANEL TOP GARNISH CLIPS	1	\$ 50.00	\$ 30.00 50.00
14	SPARE TYRE PANEL SEALANT	1	\$ 100.00	\$ 30.00 100.00
15	REAR FENDER SEALANT	1	\$ 100.00	\$ 100.00
16	REAR FENDER INNER TRIM BOARD CLIPS	2	\$ 50.00	\$ 30.00 100.00
17	REAR FENDER INNER COWLING CLIPS	1	\$ 50.00	\$ 50.00
18	REAR WINDSCREEN SEALANT	1	\$ 100.00	\$ 60.00 100.00
19	REAR WINDSCREEN INNER SEAL	1	\$ 80.00	\$ 80.00
20	REAR WINDSCREEN PRIMER & CLEANER	1	\$ 60.00	\$ 60.00
21	TAIL LAMP CLIPS	2	\$ 50.00	\$ 20.00 100.00
22	TAIL LAMP SEAL	2	\$ 50.00	\$ 40.00 100.00
23	TAIL LAMP BASE PANEL SEALANT	2	\$ 100.00	\$ 40.00 200.00
24	REVERSE CAMERA	1	\$ 480.00	\$ 480.00
25	REAR NUMBER PLATE W/ COWLING	1	\$ 80.00	\$ 80.00
SPECIAL NETT TOTAL :				\$ 4,358.00

1377.60

NNX
NECV
NECV
NSX
NECV
NECV
DLV
NECV
BRV
NECV
NECV
NECV
NECV
NSX
NECV
NNX
NECV
NNX
NECV
NECV
NECV
NDX
BRV

Nos.	LABOUR	S\$	
1	R&R BOOTLID COMPONENT	\$ 80.00	250.00
2	R&R REAR BUMPER REVERSE SENSOR	\$ 60.00	100.00
3	R&R REAR WINDSCREEN	\$ 120.00	250.00
4	R&R EXHAUST PIPE	\$	150.00
5	UPHOLSTERY	\$	200.00
6	CHECK WIRING	\$ 30.00	100.00
7	DIAGNOSTIC RESET FAULT CODE	\$	300.00
8	PANEL BEATING	\$ 1400.00	1,800.00
9	RUST PROOFING	\$	200.00
10	SPRAY PAINTING	\$ 1200.00	1,800.00
LABOUR TOTAL :		\$	5,050.00

TGum Min Resurvey
 Survey 25/11/2021
 22/11/2021 15 12hrs
 1415hrs TGum Min

2890.00
 PARTS TOTAL : \$ 12,380.31
 SPECIAL NETT TOTAL : \$ 4,358.00
 LABOUR TOTAL : \$ 5,050.00
 GRAND TOTAL : \$ 21,788.31

Lump sum repair
 Repair Days 9

Parts 5,820.03
 SN 1,377.60
 Labour 2,890.00
 10,087.63
 @20% 2,017.53
 8070.10

LS 8,050/2

TGum Min
 27/12/2021

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date: