



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2301645
3 ANSON ROAD #16-00	INV Date	17/03/2023
SPRINGLEAF TOWER	Reference	CC6/CTI21012118/Upa3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	GBD 1326J
Insured Veh.	YP 2886S
Claim No.	SNM21D206859/C02
Policy No.	DMCVSNW00069892103
Accident Date	24/11/2021
Inspection Date	30/11/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI21012118/Upa3q2 Date: 17/03/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	YP 2886S	Veh. Inspected	GBD 1326J
Policy No.	DMCVSNW00069892103	Coverage (\$)	0.00
Claim No.	SNM21D206859/C02	Excess (\$)	0.00
Assign From		Assign Date	30/11/2021
2. Vehicle Particulars & Condition			
Make & Model	NISSAN CABSTAR (M)	c.c	2953
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	JN1SC2F24Z0855859	Colour	SILVER
Odometer	128904 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/70 R15	MICHELIN	6 mm
L/H Front Tyre	195/70 R15	MICHELIN	6 mm
R/H Rear Tyre	165 R13 (D)	YOKOHAMA	6/6 mm
L/H Rear Tyre	165 R13 (D)	YOKOHAMA	6/6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	24/11/2021	Inspection Date	30/11/2021
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBD 1326J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT WINDSCREEN MOULDING	NECESSARY	128.20	128.20
1	FRONT PANEL	BADLY DENTED	1,915.20	1,412.70
1	FRONT PANEL 'CABSTAR' EMBLEM	NECESSARY	45.80	45.80
1	FRONT GRILLE	CRACKED	578.60	578.60
1	FRONT GRILLE LOGO	NOT NECESSARY	68.00	-
2	HEADLAMPS @\$850.00	O/S CRACKED / N/S NOT NECESSARY	1,700.00	518.50
1	FRONT BUMPER	NOT NECESSARY	945.00	-
1	FRONT BUMPER BEAM	NOT NECESSARY	605.00	-
2	FRONT CORNER PANELS @\$389.90	NOT NECESSARY	779.80	-
1	AIR CON BLOWER	CRACKED	1,665.00	1,433.10
1	HEATER UNIT	CRACKED	2,820.00	1,666.20
1	FRONT WINDSCREEN SEALANT	NECESSARY	45.00	45.00
1	FRONT PANEL SEALANT	NECESSARY	50.00	50.00
	LESS 10% DISCOUNT		-	-587.81
			11,345.60	5,290.29
<u>LABOUR</u>				
	TO CHECK WIRING .		50.00	20.00
	TO SPRAY RUST PROOFING.		60.00	40.00
	TO DISMANTLE & REFIX FRONT WINDSCREEN.		150.00	80.00
	TO DISMANTLE & REFIX FRONT DASHBOARD .		380.00	250.00
	TO DISMANTLE & REPLACED AIR CON BLOWER.}		180.00	100.00
	TO REFIX AIR CON GAS.}		150.00	-
	LABOUR FOR PANEL BEATING & REPLACED PARTS.		1,180.00	600.00
	TO PUTTY & SPRAY PAINTING.		1,100.00	500.00
			3,250.00	1,590.00
GRAND TOTAL			14,595.60	6,880.29



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,500.00
---	--	--	-----------------

Report Ref No. CC6/CTI21012118/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 1326J

INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

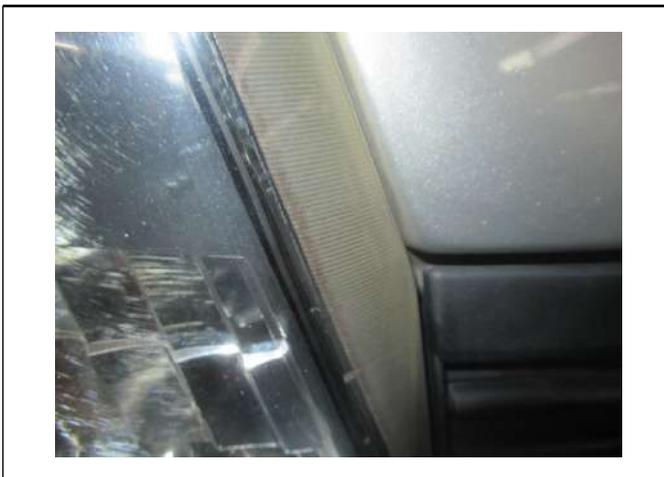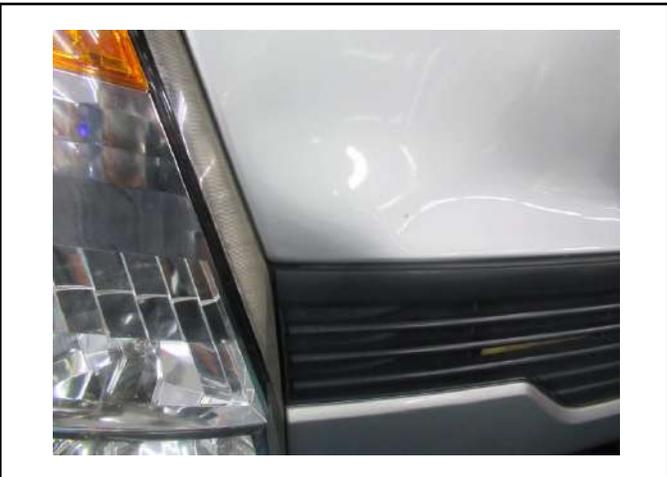



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

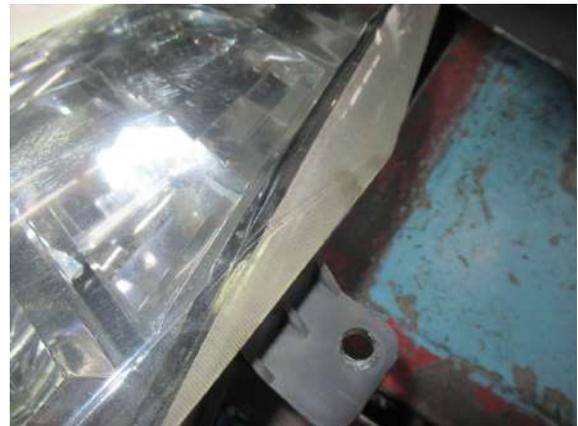




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

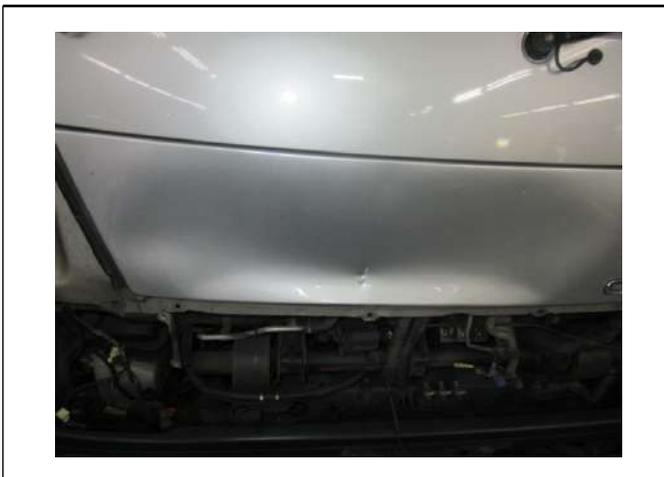



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 1326J

RE-INSPECTION

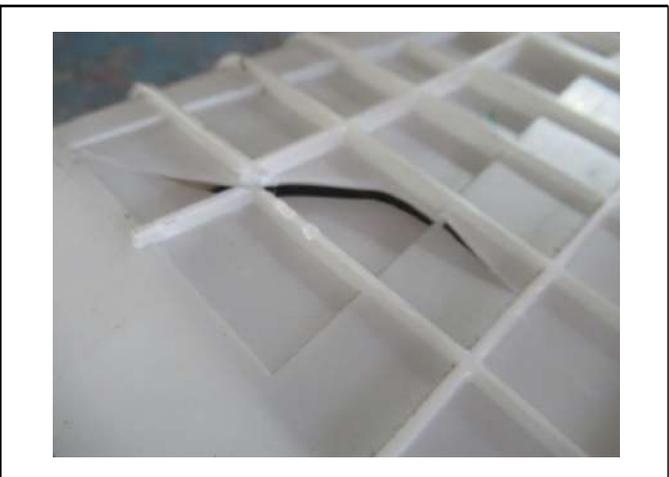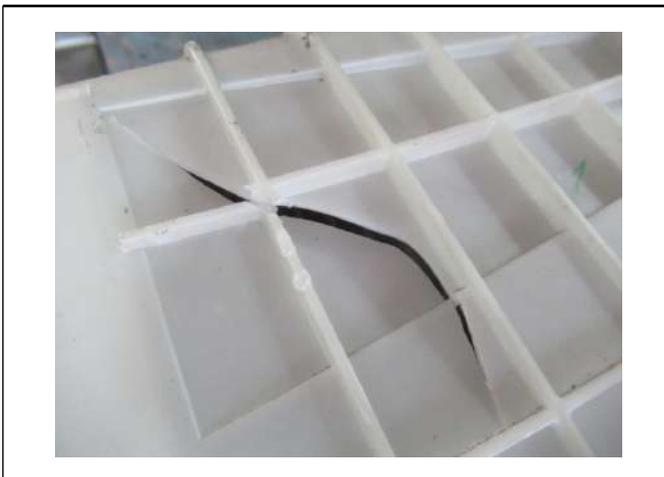



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBD 1326J

RE-INSPECTION

