

**Main Office:**  
 Mova Building  
 No. 22, Jalan Kilang,  
 Singapore 159419  
 Tel: (65) 6476 3333  
 Fax: (65) 6271 5891  
 www.mova.com.sg

**Workshop Dept:**  
 Block 100B,  
 Bukit Merah Lane 3,  
 #01-04/06/08/94  
 Singapore 159722

Tel: (65) 6272 3892  
 Fax: (65) 6270 8314

Co. Reg. 198904033G  
 GST Reg. M2-0088864-2

# Estimate

29/11/2021

**MS FIRST CAPITAL INSURANCE LIMITED**  
 36 Robinson Road  
 #16-01 City House  
 Singapore 068877.

Attention :- XA026

Page # :- 1  
 Veh # :- SGT2620J  
 Veh Model :- HYUNDAI AVANTE  
 Estimate# :- CK422579  
 Claim # :-  
 ACC. Date :- 26/11/21  
 Terms :- C.O.D Days  
 Remarks :-

No.	Description	Qty	U.Price	Amounts S\$
<b>LIST ITEMS :</b>				
1.	REAR BOOT / <i>OD</i>	1	PC	1,782.00 / 1,782.00 ✓
2.	REAR BOOT LOGO - <i>nec</i>	1	PC	58.00 / 58.00 ✓
3.	REAR BOOT EMBLEM "ELANTRA" - <i>nec</i>	1	PC	59.00 / 59.00 ✓
4.	REAR BOOT EMBLEM "ELITE" - <i>nec</i>	1	PC	59.00 / 59.00 ✓
5.	REAR BOOT LOCK - <i>BT</i>	1	PC	146.00 / 146.00 ✓
6.	REAR BOOT CATCH - <i>BT</i>	1	PC	39.00 / 39.00 ✓
7.	REAR BOOT RUBBER - <i>BT</i>	1	PC	159.00 / 159.00 X
8.	REAR BOOT HINGE L+R - <i>BT</i>	1	PC	39.00 / 39.00 X
9.	REAR BOOT NUMBER PLATE LAMP - <i>BT</i>	2	PC	105.00 / 210.00 X
10.	REAR BOOT PUSH BUTTOM - <i>BT</i>	2	PC	30.00 / 60.00 X
11.	REAR BOOT LAMP L+R - <i>BT</i>	1	PC	99.00 / 99.00 X
12.	REAR LAMP L+R - <i>BT</i>	2	PC	664.00 / 1,328.00 X
13.	REAR LAMP CLIPS L+R - <i>BT</i>	2	PC	876.00 / 1,752.00 ✓
14.	REAR LAMP PANEL L+R - <i>BT</i>	2	PC	5.00 / 10.00 X
15.	REAR WINDSCREEN MOULDING - <i>BT</i>	2	PC	193.00 / 386.00 X
16.	REAR FENDER LH - <i>BT</i>	1	PC	175.00 / 175.00 X
17.	REAR FENDER INNER TRIM LH - <i>BT</i>	1	PC	1,892.00 / 1,892.00 X
18.	REAR END PANEL - <i>BT</i>	1	PC	280.00 / 280.00 X
19.	REAR END PANEL TRIM - <i>BT</i>	1	PC	549.00 / 549.00 X
20.	REAR FLOOR PANEL - <i>BT</i>	1	PC	95.00 / 95.00 ✓
21.	REAR FLOOR PANEL BOARD - <i>BT</i>	1	PC	699.00 / 699.00 ✓
22.	REAR SPARE TYRE SCREW - <i>BT</i>	1	PC	276.00 / 276.00 X
23.	REAR BUMPER - <i>BT</i>	1	PC	29.00 / 29.00 X
24.	REAR BUMPER SPONGE - <i>BT</i>	1	PC	549.00 / 549.00 ✓
25.	REAR BUMPER REINFORCEMENT - <i>BT</i>	1	PC	40.00 / 40.00 X
26.	REAR BUMPER LOWER - <i>BT</i>	1	PC	295.00 / 295.00 ✓
27.	REAR BUMPER LOWER BRACKET - <i>BT</i>	1	PC	215.00 / 215.00 ✓
28.	REAR BUMPER SIDE BRACKET L+R - <i>BT</i>	3	PC	20.00 / 60.00 ✓
29.	REAR BUMPER RETAINER L+R - <i>BT</i>	2	PC	45.00 / 90.00 ✓
30.	REAR BUMPER REFLECTOR L+R - <i>BT</i>	2	PC	48.00 / 96.00 X
31.	REAR BUMPER CLIPS - <i>BT</i>	2	PC	85.00 / 170.00 X
32.	REAR BUMPER SIDE SHIELD L+R - <i>BT</i>	10	PC	3.90 / 39.00 ✓
33.	REAR BUMPER UNDER COVER LH - <i>BT</i>	1	PC	65.00 / 65.00 X
34.	REAR KEYLESS SENSOR - <i>BT</i>	1	PC	480.00 / 480.00 X
35.	BONNET - <i>BT</i>	1	PC	1,970.00 / 1,970.00 ✓
36.	BONNET RUBBER - <i>BT</i>	1	PC	39.00 / 39.00 X
37.	BONNET LOCK - <i>BT</i>	1	PC	129.00 / 129.00 X
38.	BONNET HINGE L+R - <i>BT</i>	2	PC	49.00 / 98.00 X
39.	FRONT GRILLE - <i>BT</i>	1	PC	1,214.00 / 1,214.00 ✓
40.	FRONT GRILLE LOGO - <i>BT</i>	1	PC	35.00 / 35.00 ✓
41.	FRONT GRILLE TOP COVER - <i>BT</i>	1	PC	95.00 / 95.00 ✓
42.	FRONT GRILLE CLIPS - <i>BT</i>	10	PC	3.50 / 35.00 ✓
43.	HEADLAMP L+R - <i>BT</i>	2	PC	1,756.00 / 3,512.00 ✓
44.	HEADLAMP BRACKET - <i>BT</i>	2	PC	44.00 / 88.00 ✓
45.	HEADLAMP CLIPS L+R - <i>BT</i>	2	PC	5.00 / 10.00 X
46.	SUPPORT PANEL - <i>BT</i>	1	PC	949.00 / 949.00 ✓
47.	SUPPORT PANEL SIDE GARNISH L+R - <i>BT</i>	2	PC	58.00 / 116.00 ✓
48.	SUPPORT PANEL SIDE GARNISH CLIPS - <i>BT</i>	8	PC	3.50 / 28.00 ✓
49.	FRONT BUMPER - <i>BT</i>	1	PC	547.00 / 547.00 ✓
50.	FRONT BUMPER FOG LIGHT LH - <i>BT</i>	1	PC	265.00 / 265.00 X
51.	FRONT BUMPER FOG LIGHT COVER LH - <i>BT</i>	1	PC	115.00 / 115.00 X

# Estimate

29/11/2021

**MS FIRST CAPITAL INSURANCE LIMITED**  
36 Robinson Road  
#16-01 City House  
Singapore 068877.

Attention :- XA026

Page # :- 1 142980

Veh # :- SGT2620J

Veh Model :- HYUNDAI AVANTE

Estimate# :- CK422579

Claim # :-

ACC. Date :- 26/11/21

Terms :- C.O.D Days

Remarks :-

**Main Office:**  
Mova Building  
No. 22, Jalan Kilang,  
Singapore 159419  
Tel: (65) 6476 3333  
Fax: (65) 6271 5891  
www.mova.com.sg

**Workshop Dept:**  
Block 1008,  
Bukit Merah Lane 3,  
#01-04/08/08/94  
Singapore 159722  
Tel: (65) 6272 3892  
Fax: (65) 6270 8314  
Co. Reg. 198904033G  
GST Reg. M2-0088264-2

No.	Description	Qty	U.Price	Amounts S\$
52.	FRONT BUMPER DAY RUNNING LIGHT ? x nn	1 PC	174.00	174.00 X
53.	FRONT BUMPER SPONGE - BR	1 PC	140.00	140.00
54.	FRONT BUMPER REINFORCEMENT - DO	1 PC	695.00	395.00
55.	FRONT BUMPER INNER BRACKET L+R - BR RR	2 PC	38.00	76.00
56.	FRONT BUMPER INNER BRACKET RIVET - RR	8 PC	3.50	28.00
57.	FRONT BUMPER RETAINER L+R - BR	2 PC	38.00	76.00
58.	FRONT BUMPER CLIPS - RR	10 PC	3.50	35.00
59.	FRONT BUMPR NUMBER PLATE GARNISH - BR	1 PC	50.00	50.00
60.	A/C CONDENSER ? - OT	1 PC	1,132.00	1,132.00
61.	RADIATOR ? - OT	1 PC	570.00	570.00
62.	AIR DUCT ? x nn	1 PC	96.00	96.00
63.	AIR RESONATOR ? x nn	1 PC	98.00	98.00
64.	FRONT FENDER L+R - REPAIR x R	2 PC		
65.	FRONT FENDER RH - REPAIR x R	1 PC		
66.	REAR CHASSIS MEMBER L+R - REPAIR x R	2 PC		

18,483  
- 20%  
14,786.40

LIST TOTAL S\$ 24,916.00  
20% DISCOUNT S\$ -4,983.20  
19,932.80

**SPECIAL NET ITEMS :**

1.	REAR BOOT TOP GARNISH (SPOILER) - CRN	1 PC	600.00	400 / 600.00
2.	REAR WINDSCREEN SEALANT x nn	1 PC	80.00	80.00 X
3.	REAR BUMPER LOWER SPOILER - BR Repeated item 26	1 PC	850.00	850.00 X
4.	REAR BUMPR SENSOR - BR	1 PC	250.00	200 / 250.00
5.	FRONT BUMPER LOWER SPOILER - BR	1 PC	850.00	500 / 850.00
6.	FRONT NUMBER PLATE - BT	1 PC	40.00	30 / 40.00

SPECIAL NET TOTAL S\$ 2,670.00

**LABOUR :**

TOWING CHARGE

TO CUT & WELD REAR FLOOR PANEL, REAR FENDER LH, REAR END PANEL. TO REPAIR FRONT FENDER L+R, REAR FENDER RH, REAR CHASSIS MEMBER L+R TO REMOVE & REFIX DAMAGED PARTS, STRAIGHTEN & REALIGN AFFECTED AREAS

1700 1,800.00

TO SPRAY AFFECTED AREAS

1700 1,800.00

TO REMOVE & REFIX W/S GLASS

X 180.00

TO REMOVE & REFIX LAGGAGE COMPARTMENT SIDE GARNISH, SIDE TRIM BOARD, CARPET & OTHER ATTACHMENT PARTS

80 100.00

TO REMOVE & REFIX FUEL TANK & OTHER ATTACHMENT PARTS

X 60.00

# Estimate

29/11/2021

**MS FIRST CAPITAL INSURANCE LIMITED**  
36 Robinson Road  
#16-01 City House  
Singapore 068877.

Attention :- XA026

Page # :- 1 142980  
Veh # :- SGT2620J  
Veh Model :- HYUNDAI AVANTE  
Estimate# :- CK422579  
Claim # :-  
ACC. Date :- 26/11/21  
Terms :- C.O.D Days  
Remarks :-


**Main Office:**  
Mova Building  
No. 22, Jalan Kilang,  
Singapore 159419  
Tel: (65) 6476 3333  
Fax: (65) 6271 5891  
www.mova.com.sg

**Workshop Dept:**  
Block 1008,  
Bukit Merah Lane 3,  
#01-04/06/08/94  
Singapore 159722  
Tel: (65) 6272 3892  
Fax: (65) 6270 8314  
Co. Reg. 198904033G  
GST Reg. M2-0088864-2

No.	Description	Qty	U.Price	Amounts S\$
	TO REMOVE & REFIX EXHAUST BOX, EXHAUST PIPE			40.00 ✓
	TO REMOVE & REFIX A/C CONDENSER ELECTRIC FAN VACUUM & REFILLING GAS			120 150.00
	TO CHECK WIRING & FOCUS HEAD LIGHT FOR FUNCTION			30 80.00
	TO CHECK BODY STRUCTURE & CHASSIS ALIGNMENT			7X 350.00
	TO INSTALL REVERSE SENSOR & CHECK WATER SEEPAGE			30 60.00
	TO RUST PROOF AFFECTED AREAS			\$49 180.00
	LABOUR TOTAL S\$			4,800.00

3740  
= 19,656.40  
L/S - 15,725.12  
= 15,750.00

E. & O.E

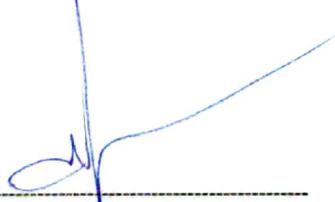

NON-TAX AMOUNT S	
AMOUNT S\$	27,402.80
GST @ 7 %	1,918.20
AMOUNT DUE S\$	29,321.00

Customer's Signature/Co. Stamp **MOVA AUTOMOTIVE PTE LTD**

Steve CLKK  
30/11/21, 4.00pm

Nil R  
L/S  
by AL sy  
18 dys

- LKK Auto Consultants hence notify the Repairer of the following:
- To resurvey before/alter spray painting
  - To display damaged part(s) during resurvey
  - Parts prices are subject to confirmation
  - Third party survey is on a "Without Prejudice" basis
  - No illegal modification(s) is allowed
  - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date: