

FormTeam Consultancy Pte Ltd

No.33, Ubi Ave 3
#02-15, Vertex
Singapore 408868

Tel : (65) 6509 1788
Fax : (65) 6509 6221

Email: mutorsurvey@fta.com.sg

Co.Reg No: 200819280D

GST Reg No: 200819280D

Our Reference : RRN17-084574/PRS/CY/ADJ/CY/lp

Your Reference: MT/0955398-002 ✓

Date : 28-Sep-2017

Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Attention : Ms Rajsewary

Dear Sir/Mdm,

SURVEY OF VEHICLE NO. SKS 7309J ✓

Pursuant to your instruction on **18-September-2017**.

We recommend a repair cost of **\$9,300.00** (see report) based on lump sum repair and the estimated duration of repairs would take **05 days**.

We also enclosed our note of charges for your consideration.

Thank you for this assignment.

Your faithfully

FormTeam Consultancy Pte Ltd
Adjusters & Surveyors (Licensed Appraiser)



Ong Chung Yang
Automobile Appraiser

(Email : yang@fta.com.sg)

Encl. Survey Report



FormTeam Consultancy Pte Ltd

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference : RRN17-084574/PRS/CY/ADJ/CY/lp

Your Reference: MT/0955398-002

Date : 28-Sep-17

Attention : Ms Rajsewary

TO : Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Assessment of Vehicle No : **SKS 7309J**
Date of Accident : **28-July-2017**
Date of Inspection : **02-August-2017**
Address of Inspection : **1 Kaki Bukit Avenue 6 #02-22 Autobay S'417883**

We have carried out a physical assessment of **SKS 7309J** at **M/S Aldrin Automotive** according to your instructions on **01-August-2017**, dismantled items on **03-August-2017**, post repair survey on **07-August-2017** and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No. : SKS 7309J
Make & Model : Nissan GTR
Year of Registration : 2010
Engine Capacity : 3799cc
Chassis No. : R35004341
Engine No. : VR38006051A
Colour : Yellow
Mileage (km) : 98712

2. VEHICLE CONDITION

Body Paint : Fair
Steering : Serviceable
Foot Brake : Serviceable
Parking Brake : Serviceable

3. TYRE PARTICULARS & CONDITION

Front

RH Make/Size : Bridgestone 255/40ZRF20 - 60%
LH Make/Size : Bridgestone 255/40ZRF20 - 60%

Rear

RH Make/Size : Bridgestone 285/35ZRF20 - 70%
LH Make/Size : Bridgestone 285/35ZRF20 - 70%

Note : % denotes the remaining percentage of the tyre


FormTeam Consultancy Pte Ltd

Our Reference : RRN17-084574/PRS/CY/ADJ/CY/lp
Your Reference : MT/0955398-002
Vehicle Number : SKS 7309J

Page No. 2

4. DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **Front Lh** portion. Please see attached scheduled for details.

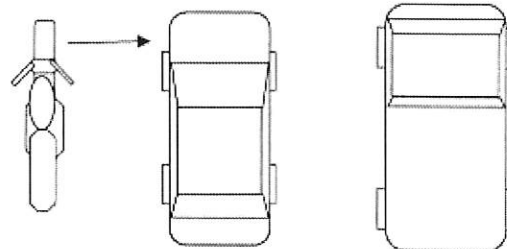

5. REMARKS

Market Value : -
Salvage Value : -
Repair Limit (Nett Loss) : -
Repairer's estimate : **Not Provided**
Nett Saving : -
Excess : -
Sum Insured : -
Our adjusted amount : \$ 9,300.00
Estimated Repair Days : 05 days

Additional photographs will be submitted upon request by our principal.

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by

FormTeam Consultancy Pte Ltd for any reliance on this report by any third party, unless with the permission of the addressee.

FormTeam Consultancy Pte Ltd

Our Reference : RRN17-084574/PRS/CY/ADJ/CY/lp
 Your Reference : MT/0955398-002
 Vehicle Number : SKS 7309J

Page No. 3

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
	SPECIAL NETT ITEMS			
1	Front Bumper Side Retainer	Necessary		237.00
1	Front Bumper Signal Lamp	Cut		210.20
1	Front N/S Fender	Buckled		2,699.30
1	Front N/S Fender Inner Shield Clip (Set)	Necessary		35.00
1	Front N/S Wheel Hub With Bearing	Necessary		1,356.20
1	Front N/S Knuckle Arm	Bent		2,860.00
1	Front N/S Top Arm	Bent		1,123.40
1	Front N/S Door Side Mirror	Broken		1,500.70
	Special Nett Total :		-	10,021.80
	Parts Total :		-	10,021.80

FormTeam Consultancy Pte Ltd

Our Reference : RRN17-084574/PRS/CY/ADJ/CY/lp
 Your Reference : MT/0955398-002
 Vehicle Number : SKS 7309J

Page No. 4

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
	LABOUR		
1	To tow vehicle to workshop.		80.00
2	To rewire front portion and refocus headlamp beam.		30.00
3	To remove, refix front undercarriage.		200.00
4	To remove damage portion, panel beating, align and renew replaced parts.		600.00
5	To putty and respray painting on affected areas.		600.00
6	To apply undersealing.		30.00
7	To conduct computerise wheel alignment test.		100.00
	Labour Total :	-	1,640.00
	TOTAL (PARTS & LABOUR) :	-	11,661.80

The final adjusted Lump Sum contract amount is **\$9,300.00**
(SINGAPORE DOLLARS NINE THOUSAND THREE HUNDRED ONLY)



Frankie Pang
 AMSAE(AUST), AMIRTE, AMSOE,
 MASPACI, MSAAA
 Licensed Appraiser



Ong Chung Yang
 Automobile Appraiser

FormTeam Consultancy Pte Ltd

Vehicle No: SKS 7309J

Workshop: Aldrin Automotive

Accident Date: 28 July 2017

No. 33 Ubi Ave 3
#02-15 Vertex
Singapore 408868

Tel: (65) 6509 1788
Fax: (65) 6509 6221

Email: motorsurvey@fta.com.sg
www.fta.com.sg

Co. Reg No: 200819280D

GST Reg. No: 200819280D



