

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg




Supplementary Estimate-1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/0965/2021/ 10-Dec-21 CHANG 1 of 1 SLK 7680 R AUDI A4 1.4 TFSU
Quantity	Description	Unit Price	Amount
Parts			
1	REFRIGERANT PIPE <i>Best</i>	\$ 523.00	✓
2	FRONT WHEEL SPOILER - RH <i>Not Rec</i>	\$ 73.00	X
GRAND TOTAL		\$ 596.00	

For Premium Automobiles Pte Ltd

*Add 3 days for
damages to lock carver.
H.S.*

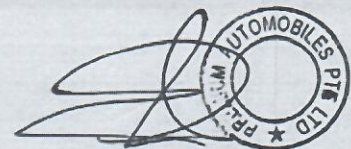

Authorised Signature

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 7323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLK 7680 R

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNES FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	S/N \$	360.00	X.
2	TO REMOVE AND TRANSFER LHS HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$	350.00 250	
3	TO RENEW LHS FRONT WHEEL SUSPENSION ASSY WITH SUBFRAME	S/N \$	2,400.00	?
4	TO REMOVE AND REINSTALL AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	S/N \$	1,700.00	?
5	TO RENEW LHS FRONT FENDER INNER AIRCON CONDENSER COOLANT PIPE	S/N \$	280.00	?
SUB TOTAL LABOUR CHARGES		:	\$	<u>5,090.00</u>



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLK 7680 R

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
6	TO REMOVE AND REINSTALL LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY TO FACILITATE RESPRAY LHF FRONT DOOR	S/N \$ 280.00 ✓	
7	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, LHS FRONT FENDER AND LHS HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. TO CUT OUT AND WELD LHS FRONT FENDER TOP SUPPORT. TO REPAIR LHS UPPER A-PILLAR. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS.	\$ 6,650.00 1500 + 1250	lock carrier. H.G.
8	TO RESPRAY FRONT BUMPER, LHS FRONT FENDER, LHS FRONT FENDER TOP SUPPORT, BONNET, LHS UPPER A-PILLAR AND LHS FRONT DOOR	\$ 4,850.00 2200	
9	TO RENEW LHS FRONT RIM AND CARRY OUT PRE/POST WHEEL ALIGNMENT	S/N \$ 520.00 ✓	
10	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK	S/N \$ 384.00 182	
11	TO RE-APPLY PAINT COATING FOR DAMAGE AREA.	TBC ?	
TOTAL LABOUR CHARGES		: \$ 17,774.00	

+ 3 days.
H.G.

Car-in

7/12/21.

wip: 55683

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NOPA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

Kiam/Hong



AIG - Hobs

- 9 days

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLK 7680 R

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES		REMARKS
			S/NETT		
1	FRONT BUMPER Distorted	1	\$	2,111.00	✓
2	FRONT BUMPER ATTACHMENT PART New	1		TBC	+
3	FRONT BUMPER SECURING STRIP New Damaged	2	\$	71.00	✓
4	FRONT BUMPER GRILLE New	1	\$	196.00	✓
5	FRONT BUMPER CLOSING ELEMENT New torn	1	\$	210.00	✓
6	FRONT BUMPER AIR GUIDE - LH New cracked	1	\$	63.00	✓
7	RADIATOR GRILLE New New cracked.	1	\$	1,152.00	✓
8	FRONT BUMPER AIR GUIDE GRILLE - LH Lit	1	\$	135.00	✓
9	FRONT BUMPER FOAM FILLER PIRECE ?	1	\$	124.00	?
10	FRONT REINFORCEMENT BAR ?	1	\$	845.00	?
11	FRONT BUMPER GUIDE SECTION - LH New	1	\$	36.00	✓
12	FRONT BUMPER TOP COVER New	1	\$	127.00	+
13	CAUTION STICKER New	1	\$	14.00	+
14	AIR CONDITIONER STICKER New	1	\$	8.00	+
15	FRONT REINFORCEMENT BAR BRACKET ?	1	\$	137.00	?
16	FRONT BUMPER SUPPORT - LH/ RH New	2	\$	58.00	+
17	HORN - LH ?	1	\$	126.00	?
18	HORN BRACKET - LH ?	1	\$	29.00	?
19	BONNET Dented	1	\$	3,246.00	✓
20	BONNET ATTACHMENT PART New	1	\$	412.00	+
SUB TOTAL SPARE PARTS		:	\$	9,100.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLK 7680 R

					DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS		
21	BONNET IMPACT PROTECTION - CENTER / LH / RH <i>new</i>	3	S	84.00	✓	
22	BONNET STRIKER <i>new</i>	1	S	50.00	✓	
23	BONNET LOCK	1	S	214.00	+	
24	FRONT FENDER - LH <i>Distorted</i>	1	S	767.00	✓	
25	FRONT FENDER ATTACHMENT PART <i>new</i>	1	S	202.00	+	
26	FRONT FENDER CLOSING ELEMENT - LH <i>Distorted</i>	1	S	72.00	✓	
27	FRONT FENDER BRACKET - LH <i>Distorted</i>	1	S	35.00	✓	
28	FRONT FENDER BRACKET - CENTER	1	S	49.00	✓	
29	FRONT FENDER BRACKET - BACK	1	S	32.00	✓	
30	FRONT FENDER BRACE <i>Bent</i>	1	S	118.00	✓	
31	FRONT WHEEL HOUSING LINER - LH <i>Distorted</i>	1	S	240.00	✓	
32	FRONT WHEEL HOUSING LINER ATTACHMENT PART <i>new</i>	1	TBC		+	
33	FRONT WHEEL SPOILER <i>Distorted</i>	1	S	73.00	✓	
34	FRONT WHEEL SPOILER - LH <i>Distorted</i>	1	S	35.00	✓	
35	FRONT FENDER STONE GUARD <i>new</i>	1	S	51.00	+	
36	FRONT FENDER LEDGE COVER <i>Distorted</i>	1	S	31.00	✓	
37	FRONT FENDER LEDGE COVER - UPPER <i>Distorted new</i>	1	S	23.00	✓	
38	FRONT FENDER CONNECTING PLATE - LH <i>new</i>	2	S	467.00	+	
39	HEADLIGHT - LH <i>Cracked</i>	1	S	7,693.00	✓	
40	HEADLIGHT POWER MODULE <i>new</i>	1	S	761.00	✓	
SUB TOTAL SPARE PARTS		:	\$	10,997.00		

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLK 7680 R

S/N	PARTS DESCRIPTION	DAMAGED PARTS & PRICES			REMARKS
		QTY	S/NETT		
41	HEADLIGHT CONTROL UNIT <i>new</i>	1	\$	751.00	<i>✓</i>
42	HEADLIGHT HOSE - LH <i>new</i>	1	\$	36.00	<i>✓</i>
43	COMPENSATING PIECE ?	3	\$	122.00	<i>?</i>
44	HEADLIGHT LIFT CYLINDER - LH <i>Dmgd</i>	1	\$	210.00	<i>✓</i>
45	CORRUGATED PIPE ?	1	\$	93.00	<i>?</i>
46	LOCK CARRIER <i>Brnd d.</i>	1	\$	1,016.00	<i>✓</i>
47	LOCK CARRIER BRACKET ?	1	\$	19.00	<i>?</i>
48	COOLANT ?	6	\$	266.00	<i>?</i>
49	FRONT RADIATOR AIR GUIDE - LH	1	\$	28.00	<i>✓</i>
50	FRONT RADIATOR INNER AIR GUIDE - LH <i>new</i>	1	\$	12.00	<i>✓</i>
51	FRONT RADIATOR AIR GUIDE - UPPER	1	\$	16.00	<i>✓</i>
52	REFRIGERANT LINE ?	1	\$	1,278.00	<i>?</i>
53	FRONT WINDOW CHROME TRIM STRIP - LH <i>new</i>	1	\$	307.00	<i>✓</i>
54	FRONT WINDOW TRIM - LH <i>new</i>	1	\$	257.00	<i>✓</i>
55	FRONT ALUMINIUM RIM - LH <i>let</i>	1	\$	1,297.00	<i>✓</i>
56	FRONT SUB FRAME ?	1	\$	1,891.00	<i>?</i>
57	FRONT WISHBONE ?	1	\$	539.00	<i>?</i>
58	FRONT SUSPENSION GUIDE - LH ?	1	\$	943.00	<i>?</i>
59	FRONT SUSPENSION ARM - UPPER ?	2	\$	1,024.00	<i>?</i>
60	WHEEL BEARING HOUSING - LH ?	1	\$	968.00	<i>?</i>
TOTAL SPARE PARTS		:	\$	11,073.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLK 7680 R

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
			S/NETT	REMARKS
61	SWIVEL JOINT ?	1 \$	193.00 ?	
62	WHEEL HUB ?	1 \$	479.00 ?	
63	DOUBLE BALL BEARING ?	1 \$	246.00 ?	
64	SUSPENSION FORKS - LH ?	1 \$	264.00 ?	
65	COUPLING ROD ?	2 \$	240.00 ?	
66	ANTI ROLL BAR <i>new</i>	1 \$	433.00 +	
67	SHOCK ABSORBER ?	1 \$	301.00 ?	
68	DRIVE SHAFT <i>new</i>	1 \$	2,650.00 +	
69	STEERING GEAR ?	1 \$	6,787.00 ?	
70	TIE ROD END ?	1 \$	197.00 ?	
71	TRACK ROD ?	1 \$	99.00 ?	
72	ACRYLIC SEALER <i>new</i>	S/N \$	180.00 +	
73	CAVITY WAX <i>new</i>	S/N \$	140.00 +	
74	STONE CHIP <i>new</i>	S/N \$	180.00 +	
75	METAL FILLER POWDER <i>new</i>	S/N \$	280.00 +	
76	FRONT NUMBER PLATE <i>new</i>	S/N \$	60.00 +	
77	SUNDRIES ?	\$	500.00 ?	
TOTAL SPARE PARTS		:	\$ 44,399.00	
TOTAL LABOUR CHARGES		:	\$ 17,774.00	
GRAND TOTAL		:	\$ 62,173.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.