



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10056/5038/TP/11.21

Date : 24 November 2021

Vehicle no : SLJ 5038P

To: Kang Yong Shi
c/o 68 Kaki Bukit Ave 6
#01-09, Ark @ Kaki Bukit,
Singapore 417896

INVOICE

PARTICULARS

AMOUNT

Registration No. : SLJ 5038P
Date of accident : 02 November 2021
Make / Model : Volvo S60 T2 A/T
Invoice No. : 10056

Being work done and services rendered as follows:

- ✓ Inspection of Vehicle
- ✓ Re-Inspection
- ✓ Appraisal Report
- ✓ 38 Colored Photographs
- ✓ Transport Charges

SGD 518.00

TOTAL SGD 518.00

Dollars: Five Hundred and Eighteen Only

(Cheque should be crossed and make payable to "TY5 CONSULTANCY")

TY5 CONSULTANCY



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10056/5038/TP/11.21

Date : 24 November 2021

Vehicle no : SLJ 5038P

To: Kang Yong Shi
c/o 68 Kaki Bukit Ave 6
#01-09, Ark @ Kaki Bukit,
Singapore 417896

VEHICLE INSPECTION REPORT

Name of Workshop : Elites Performance
Place of inspection : 68 Kaki Bukit Ave 6 #01-09, Ark @ Kaki Bukit, Singapore 417896
Date of Accident : 02 November 2021
Date of Inspection : 05 November 2021

VEHICLE PARTICULAR

Registration No.	: SLJ 5038P	Chassis Frame No.	: YV1FS28C0H2429258
Make / Model	: Volvo S60 T2 A/T	Engine No.	: B4154T51809281
Year of Registration	: 2016	Odometer Reading	: 61,421 KM
Class / Type	: Saloon	Colour	: Black

VEHICLE CONDITION

General Condition	: Very Good	Steering	: Serviceable
Paintwork	: Very Good	Foot/ Parking Brake	: Serviceable

TYRE CONDITION

	<u>Size</u>	<u>Thread Balance</u>
Front L/H :	GOODYEAR 235 / 40 R18	7mm
Front R/H :	GOODYEAR 235 / 40 R18	7mm
Rear L/H :	GOODYEAR 235 / 40 R18	7mm
Rear R/H :	GOODYEAR 235 / 40 R18	7mm

* The above is an estimate of the remaining life of the tyre thread in percentages

COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 5,096.60	\$ 4,128.91
Labour	\$ 2,780.00	\$ 2,270.00
	<u>\$ 7,876.60</u>	<u>\$ 6,398.91</u>

TY5 Recommendation

Lump Sum Repair :
\$ 5,100.00

Estimated Repair Duration :

5

working days (excluding Sat, Sun & Public Holidays)

NOTE : The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10056/5038/TP/11.21
Date : 24 November 2021
Vehicle no : SLJ 5038P

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>	
<u>LIST ITEMS:-</u>						
1	1 pc	rear bumper	deformed	\$ 1,376.60	\$ 1,376.60	
2	1 pc	rear bumper l/h side retainer	necessary	\$ 112.40	\$ 112.40	
3	1 pc	l/h side skirt	deformed	\$ 769.70	\$ 769.70	
4	1 pc	l/h rear fender	dented	repair	repair XR	
5	1 pc	l/h rear door	buckled	\$ 1,251.20	\$ 1,251.20	XR
6	1 pc	l/h rear door inner lock	buckled	\$ 426.70	realign XNN	
				\$ 3,936.60	\$ 3,509.90	
Less 10%					\$ 350.99	2258.70
				\$ 3,936.60	\$ 3,158.91	2032.83

SPECIAL NETT ITEMS:-

7	1 pc	l/h rear sports rim		\$ 780.00	\$ 780.00	cut
8	1 pc	l/h rear tyre @50% depreciation		\$ 380.00	\$ 190.00	XNN
				\$ 1,160.00	\$ 970.00	780

Total	\$ 5,096.60	\$ 4,128.91
-------	-------------	-------------



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10056/5038/TP/11.21
Date : 24 November 2021
Vehicle no : SLJ 5038P

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>	
		B/F		\$ 5,096.60	\$ 4,128.91	
9		To panel beat and renewal of all necessary damaged body parts		\$ 1,200.00	\$ 1,000.00	700
10		To check wiring and rewire		\$ 60.00	\$ 50.00	30
11		To remove and reinstall rear door components		\$ 80.00	\$ 60.00	XNN
12		To remove and reinstall rear undercarriage		\$ 240.00	\$ 200.00	100
13		To perform 4 wheel alignment		\$ 120.00	\$ 100.00	80
14		To apply anti-rust		\$ 80.00	\$ 60.00	30
15		To putty and spray-paint of affected areas		\$ 1,000.00	\$ 800.00	
				\$ 2,780.00	\$ 2,270.00	1740

			4552.83
			L/\$3600
Total	\$ 7,876.60	\$ 6,398.91	5 DAYS



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation


Reference : TY5/TA/10056/5038/TP/11.21

Date : 24 November 2021

Vehicle no : SLJ 5038P

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact of the collision was delivered Diagonally to the LH Side from rear to front; left to right; portion of the vehicle.

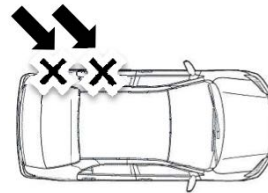

(Please refer to the list and survey photographs as attached for more information)

ASSESSMENT RECOMMENDATIONS

COST OF REPAIR

	RePAIRER S\$	ADJUSTER S\$
Parts	\$ 5,096.60	\$ 4,128.91
Labour	\$ 2,780.00	\$ 2,270.00
	<u>\$ 7,876.60</u>	<u>\$ 6,398.91</u>

TY5 Recommendation

Contract Lump Sum of \$ 5,100.00

Estimated Repair Duration : 5 working days
(excluding Sat, Sun & Public Holidays)

Enclosed No. Of Photograph : 38
(at the time of static inspection)

Our attached assessment schedule has been checked thoroughly by us against the actual damages sustained on the vehicle, and we recommend the replacement of parts and repair accordingly. We have adjusted the cost and the repairer has agreed to undertake the repair at the recommended sum to a acceptable quality and standards. We have not given authorization and instruction to the repairer to proceed with the repairs.

The survey was done on a **Without Prejudice Basis** and we are reverting the matter to you for a decision.

We thank you for engaging our services and we enclosed herewith our invoice no. 10056

TY5 CONSULTANCY

TERRENCE HONG
AUTOMOTIVE SURVEYOR

NOTE : This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company via email only and follow up with a phone call, within Fourteen (14) days from the date hereof. Otherwise this revised amount shall be treated as valid.







