

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s Ding Ave

of _____

Insured: 803k

Policy No. DMCVSNW00028492100

Claims No. SNM21D207237/C01/CHNGPW

Sum Insured: _____ Excess: 2k

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

Bal. or Market Value: 822k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 07 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: GBD 68482 Yr Regn: 03, 15

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Kia Roblo c.c. 1598

Colour: White A/C: Insured / Std / NI / NA

Sp. Reading: 246392 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: FFA2630000 6185125

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/60R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Nexen

Front _____ Rear _____

R/Bal. 4 mm R/Bal. 7 mm

L/Bal. 4 mm L/Bal. 7 mm

D.O.A. 11/12/21 D.O.I. 20/12/2021

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or N/S/R

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
/	Bonnet jammed
11/3	LIP @ 12,000.00 <u>Condit</u> (red 19,296.55, 61%)

Date/Time, File Pass to? : Prell. Report : Final Report

1) _____
2) 18/3/22-typist

Report Format : Merimen
Lump Sum I.H.B.: (\$ 12,000)

Days Of Repair: 7

Resurvey No. of Trip: 1

Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech Invs (\$)
 : Weekend (\$)

Survey Fee:	
Transportation:	
\$ + RS. SI	
Fixt's	
Others	
TOTAL	

Estimate Repair

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10,#01-20
575645



Insurer Reference:
Repairer Reference: 045136
Date calculated: 16/12/2021 3:02 PM

Full Report
Registration: GBD6848L
Printed: 16/12/2021 3:03 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	11/12/21
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:	21	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer: FIAT
Model: DOBLO VAN
Sub Model: BASE MODEL
Model Sheet Number: 08 AG 01
Registration: GBD6848L
VIN number:
Odometer: 246392

Model Specs

FROM 01.2015 AIR CONDITIONING LUGGAGE COMP COVER 1.6 LTR 77 KW
GRILLE PLATFORM PART GLAZED BOX VAN

Not Authorized
L1Pp &
EX @ 2000.

Today

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a 'without Prejudice' basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Resurvey After Paint

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All
Underbody

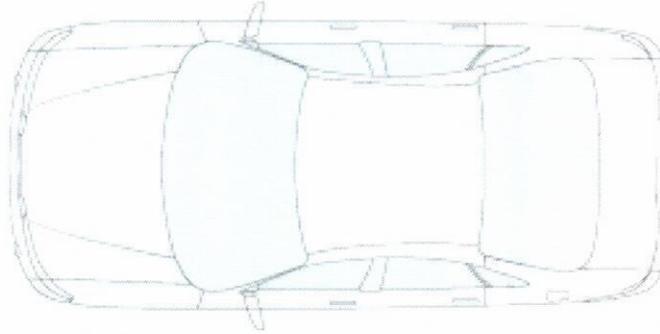

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
7604A02	VEHICLE PREPARATION TIME		2.0	8.40
7210E18	R + R LEFT FRONT WING INCLUDES: L/F WHEEL, L/F WHEELHOUSE, FRONT BUMPER AND L/F HEADLAMP REMOVE + REFIT NOT INCLUDED: ADJUST HEADLAMPS.		7.0	29.40
7210E18)	R + R RIGHT FRONT WING (BUMPER REMOVED) INCLUDES: R/HEADLAMP, R/F WHEEL, R/WHEELHOUSE REMOVE + REFIT. NOT INCLUDED: ADJUST HEADLAMPS.		2.0	8.40
7210A15	R + R FRONT PANEL		12.5	52.50
7620C27	R + R FRONT CROSSMEMBER		2.0	8.40
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT		1.0	4.20
NO NUMBER	R + R L/HEADLAMP BRACKET		2.0	8.40
NO NUMBER	R + R R/HEADLAMP BRACKET		2.0	8.40
7205E10	RENEW FRONT BUMPER (REMOVED)		5.0	21.00
7620A60	RENEW BONNET (REMOVED)		2.0	8.40

Code	Description	WU	Price SGD
7620C60	R + R BONNET	4.5	18.90
7620C62	R + R L/BONNET HINGE	1.0	4.20
7620C62	R + R BONNET HINGE	1.0	4.20
7025A58	R + R BONNET STAY	2.0	8.40
5540B38	CHECK AND ADJUST HEADLAMPS	2.0	8.40
NO NUMBER	R + R L/DOOR WINDOW TRIM FRAME	1.0	4.20
NO NUMBER	R + R R/WINDOW FRAME MOULDING	1.0	4.20
7210A36	RENEW LEFT FRONT SIDE MEMBER CLOSING	9.5	39.90
7210A36	RENEW RIGHT FRONT SIDE MEMBER CLOSING	9.5	39.90
7640C05	R + R L/F DOOR	4.0	16.80
7640A05	RENEW L/F DOOR (DOOR REMOVED)	3.5	14.70
7640C80	R + R L/F DOOR ATTACHED PARTS	13.0	54.60
7640C05	R + R R/F DOOR	4.0	16.80
7640A05	RENEW R/F DOOR (DOOR REMOVED)	3.5	14.70
7640C80	R + R R/F DOOR ATTACHED PARTS	13.0	54.60
0010T84	AIR CONDITION DRAIN + REFILL	2.5	10.50
5040A40)	R + R CONDENSER (BUMPER REMOVED)	1.0	4.20
5050A10)	R + R WINDSCREEN WASHER TANK	3.5	14.70
5530B52	R + R BATTERY BRACKET	2.5	10.50
	INCLUDES: R + R BATTERY		
1088B20)	R + R RADIATOR	6.0	25.20
	INCLUDES: R + R FAN AND FAN SHROUD, DRAIN + REFILL COOLING SYSTEM		
1048B50)	R + R CHARGE AIR COOLER	4.5	18.90
1016A10	R + R UPPER ENGINE COVER	1.0	4.20
1008C32)	R + R ENGINE STRUT	2.5	10.50
1088B10)	OVERFLOW TANK FOR COOLANT	1.0	4.20
4130A10)	R + R STEERING GEAR (FRT AXLE BODY REM)	0.5	2.10
4130B58)	R + R COLD WATER PIPE	3.0	12.60
4450C10)	R + R LEFT FRONT STEERING KNUCKLE (WHEEL REMOVED)	6.5	27.30
	INCLUDES: R + R BRAKE DISC AND BRAKE DISC PROTECTION PLATE		
4450C10)	R + R RIGHT FRONT STEERING KNUCKLE (WHEEL REMOVED)	6.5	27.30
	INCLUDES: R + R BRAKE DISC AND BRAKE DISC PROTECTION PLATE		
4450C14)	R + R FRONT STEERING KNUCKLE ASS WORK	1.0	4.20
4450C34)	R + R LEFT FRONT WHEEL BEARING	2.5	10.50
4450C34)	R + R RIGHT FRONT WHEEL BEARING	2.5	10.50
4410B40)	R + R L/F CONTROL ARM (WHEEL REMOVED)	4.5	18.90
4410B40)	R + R R/F CONTROL ARM (WHEEL REMOVED)	4.5	18.90
4410A18)	R + R FRONT SUSPENSION STRUT	2.0	8.40
4410A12)	R + R LEFT FRONT SHOCK ABSORBER/SPRING (SUSPENSION STRUT REMOVED)	4.0	16.80
4410A12)	R + R RIGHT FRONT SHOCK ABSORBER/SPRING (SUSPENSION STRUT REMOVED)	4.0	16.80
4410C10)	R + R FRONT STABILIZER	7.0	29.40
4450C38)	R + R FRONT WHEEL HUB BEARING ADD	1.5	6.30
4410D15)	R + R FRONT AXLE CARRIER	9.0	37.80
4410D17)	R + R FRONT CROSSMEMBER	0.5	2.10

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	19.40	194.0	814.80
Total of Labour			814.80

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h	
Code	Description		WU	Price SGD
	BONNET NEW PART PAINTING		19.0	
	L/F WING NEW PART PAINTING		11.0	
	R/F WING NEW PART PAINTING		11.0	
	FRONT PANEL SURFACE PAINT		4.0	
	L/F HEADLAMP BRACKET SURFACE PAINT		4.0	
	R/F HEADLAMP BRACKET SURFACE PAINT		4.0	
	L/R LAMP BRACKET SURFACE PAINT		4.0	
	R/R LAMP BRACKET SURFACE PAINT		4.0	
	L/S-MEMB CLOSING PNL SURFACE PAINT		4.0	
	R/S-MEMB CLOSING PNL SURFACE PAINT		4.0	
	LEFT FRONT DOOR NEW PART PAINTING		18.0	
	RIGHT FRONT DOOR NEW PART PAINTING		18.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	50.38
0741	L/F WING NEW PART PAINTING	18.94
0742	R/F WING NEW PART PAINTING	18.94
0920	FRONT PANEL SURFACE PAINT	2.82
0925	L/F HEADLAMP BRACKET SURFACE PAINT	0.35
0926	R/F HEADLAMP BRACKET SURFACE PAINT	0.35
0927	L/R LAMP BRACKET SURFACE PAINT	0.35
0928	R/R LAMP BRACKET SURFACE PAINT	0.35
0953	L/S-MEMB CLOSING PNL SURFACE PAINT	0.70
0954	R/S-MEMB CLOSING PNL SURFACE PAINT	1.41
1481	LEFT FRONT DOOR NEW PART PAINTING	44.73
1482	RIGHT FRONT DOOR NEW PART PAINTING	44.73

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor			42.00 SGD/h
Time Paint		105.0	
Preparation Main Work Metal	0.80	8.0	33.60
Total	10 WU/h	113.0	474.60

Material Cost - Paint

	Price SGD
New Part Painting	177.72
Surface-/Blend Paint	6.33
Material-constant Metal	18.10
Total	202.15

Spare Parts

prices as at 2001-01-01

Code	Description	Part Number	Part Source	Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	Mit 30.00 ✓
0258	FRT NO PLATE REINF	0000735615598	Original	Sm 30.00 X
0283	FRONT BUMPER	0000735615285	Original	Ry 670.00 ✓
0285	FRT BUMPER REINF	0000052180630	Original	Ry 485.00 ✓
0293	L/F BUMPER AIR GUIDE	0000735615291	Original	CM 120.00 ✓
0294	R/F BUMPER AIR GUIDE	0000735615290	Original	CM 120.00 ✓
0295	L/F BUMPER PANEL	0000735615288	Original	NSP 185.00 X
0296	R/F BUMPER PANEL	0000735615287	Original	NSP 185.00 X
0301	FRT BUMPER WIND DEFL	0000051828678	Original	NSP 90.00 ✓
0340	FRONT CROSSMEMBER	0000051984389	Original	Bt 485.00 ✓
0345	FRT BUMPER ABSORBER	0000051974242	Original	Sm GMA 180.00 ✓
0346	R/F BUMPER COVER	0000735615289	Original	Mit 35.00 ✓
0411	GRILLE	0000735618636	Original	CM 245.00 ✓
0431	GRILLE BADGE	0000735578621	Original	NS 90.00 ✓
0471	BONNET	0000052101773	Original	BU 650.00 ✓
0475	L/BONNET HINGE	0000052035197	Original	Ry 70.00 ✓
0476	R/BONNET HINGE	0000052035196	Original	Ry 70.00 ✓
0485	BONNET INSULATION	0000051890148	Original	Reform 185.00 ✓
0493	BONNET LOCK	0000052046011	Original	Tm 105.00 ✓
0495	BONNET STAY	0000052027740	Original	R 55.00 X
0497	L/F BUMP CORNER BRKT	0000051973269	Original	CM 70.00 ✓
0498	R/F BUMP CORNER BRKT	0000051973268	Original	CM 70.00 ✓
0528	FRONT BONNET SEAL	0000051987095	Original	Sm 120.00 X
0531	LEFT BONNET STOP	0000046456562	Original	NS 25.00 X
0532	RIGHT BONNET STOP	0000046456562	Original	NS 25.00 X
0561	LEFT HEADLAMP ASSY	0000052109260	Original	NS 375.00 ✓
0562	RIGHT HEADLAMP ASSY	0000052109257	Original	NS AV 375.00 ✓
0741	L/F WING	0000051973882	Original	Ry 430.00 ✓
0742	R/F WING	0000051973881	Original	BU 430.00 ✓
0745	L/F WING BRACKET	0000051810995	Original	Di 75.00 ✓
0746	R/F WING BRACKET	0000051811090	Original	Di 75.00 ✓
0841	L/F WHEELHOUSE COVER	0000052128357	Original	CM 145.00 ✓
0842	R/F WHEELHOUSE COVER	0000052128361	Original	Sm 145.00 X
0920	FRONT PANEL	0000052122658	Original	Ry 320.00 ✓
0925	L/F HEADLAMP BRACKET	0000051974123	Original	Ry 160.00 ✓
0926	R/F HEADLAMP BRACKET	0000051974118	Original	Ry 160.00 ✓
0927	L/R LAMP BRACKET	0000051974099	Original	Di 35.00 ✓
0928	R/R LAMP BRACKET	0000051973089	Original	Di 35.00 ✓
0953	L/S-MEMB CLOSING PNL	0000052007755	Original	Ry 90.00 ✓
0954	R/S-MEMB CLOSING PNL	0000052007753	Original	BT 90.00 ✓
1385	L/COWL MOULDING	0000735498423	Original	Di 55.00 ✓
1386	R/COWL MOULDING	0000735498422	Original	Di 55.00 ✓
1393	COWL PANEL GRILLE	0000735498287	Original	CM 180.00 ✓
1395	REAR BONNET SEAL	0000052018491	Original	Sm 150.00 X
1435	WASHER RESERVOIR	0000052046691	Original	NS 120.00 ✓
1481	LEFT FRONT DOOR	0000052155068	Original	R 1,250.00 X
1482	RIGHT FRONT DOOR	0000052155064	Original	R 1,250.00 X
1525	L/F DOOR REP KIT	SEE GUIDE NO. 1537		
1526	R/F DOOR REP KIT	SEE GUIDE NO. 1538		
1537	L/SCREW	0000018754324		0.00
1538	R/SCREW	0000018754324		0.00

Code	Description	Part Number	Part Source	Price SGD
4465	AIR CON CONDENSER	0000051937924	Original	850 815.00
7011	FRONT AXLE BEAM	0000052078744	Original	X2,150.00
7025	LWR AXLE MEMB REINF	0000051974659	Original	X 245.00
7053	L/F TRACK CONT ARM	0000051932035	Original	170.00
7054	R/F TRACK CONT ARM	0000051932036	Original	170.00
7077	L/FR SHOCK ABSORBER	0000052093954	Original	170.00
7078	R/FR SHOCK ABSORBER	0000052093961	Original	170.00
7081	L/F STEERING KNUCKLE	0000052043100	Original	645.00
7082	R/F STEERING KNUCKLE	0000052043098	Original	645.00
7099	L/F S-ABS BRKT	0000052208017	Original	70.00
7100	R/F S-ABS BRKT	0000052208016	Original	70.00
7117	L/F WHEEL BEARING	0000046836196	Original	275.00
7118	R/F WHEEL BEARING	0000046836196	Original	275.00
7131	L/F WHEEL HUB	0000052017379	Original	230.00
7132	R/F WHEEL HUB	0000052017379	Original	230.00
7261	FRONT STABILISER	0000051886184	Original	415.00
7277	L/F STABI LINKAGE	0000052042281	Original	75.00
7278	R/F STABI LINKAGE	0000052042281	Original	75.00
7300	STEERING GEAR ASSY	USE SINGLE PARTS	Original	4,150.00
7311	L/OUTER TIE ROD BALL	0000077365223	Original	110.00
7312	R/OUTER TIE ROD BALL	0000077365224	Original	110.00
7480	POWER STEERING PIPE	0000051952538	Original	180.00
7761	RADIATOR	0000051897080	Original	565.00
7763	INTERCOOLER	0000051833975	Original	1,250.00
7765	RADIATOR AIR GUIDE	0000051974448	Original	235.00
7767	UPPER AIR GUIDE	0000051974446	Original	120.00
7787	EXPANSION TANK	0000051824339	Original	145.00
7790	FAN/FAN SHROUD CPL	0000051833973	Original	185.00
8780	LOWER ENGINE PROTECT	0000051844337	Original	670.00
8782	R/ENGINE COVER	0000051832930	Original	85.00
9646	HIGH TONE HORN	0000052090834	Original	120.00
1000	AIR CLEANER BOX	AIR CLEANER BOX	Original	710.00
1001	AIR INTAKE DUCT	AIR INTAKE DUCT	Original	160.00
1002	RADIATOR FAN ASSY	RADIATOR FAN	Original	495.00
1003	BUMPER SPONGE FOAM	BUMPER FOAM	Original	135.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	26,715.00
Total	26,715.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	26,715.00	26,715.00
Labour Time Base 10 WU/h		
Total 194.0 WU X 42.00 SGD/h	814.80	814.80
Total of Labour	384.30	814.80
Paint Work Time Base 10 WU/h		
Labour Cost 113.0 WU X 42.00 SGD/h	474.60	323.40
Material Cost	202.15	112.69
Total Paint Including Material		676.75
Repair Cost Excludes GST		28,206.55
GST (+7.0%)		1,974.46
Repair Cost Included GST		30,181.01

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10,#01-20
575645



Insurer Reference:
Repairer Reference: 045136
Date calculated: 08/03/2022 2:25 PM

Full Report
Registration: GBD6848L
Printed: 08/03/2022 2:25 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	11/12/21
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:	21	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	FIAT
Model:	DOBLO VAN
Sub Model:	BASE MODEL
Model Sheet Number:	08 AG 01
Registration:	GBD6848L
VIN number:	
Odometer:	246392

Model Specs

FROM 01.2015	AIR CONDITIONING	LUGGAGE COMP COVER	1.6 LTR 77 KW
GRILLE PLATFORM	PART GLAZED BOX VAN		


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All
Underbody

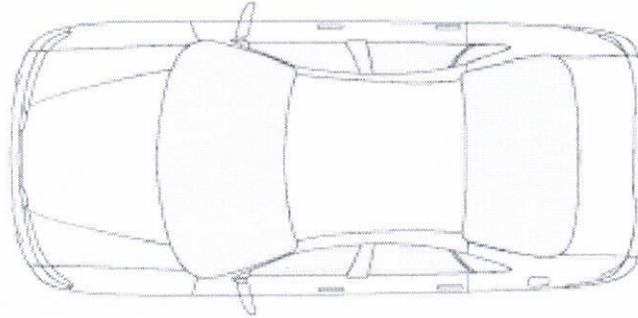

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
Spare Tyre Brand	Tread (Spare), mm						

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
7604A02	VEHICLE PREPARATION TIME		2.0	8.40
7210E18	R + R LEFT FRONT WING INCLUDES: L/F WHEEL, L/F WHEELHOUSE, FRONT BUMPER AND L/F HEADLAMP REMOVE + REFIT NOT INCLUDED: ADJUST HEADLAMPS.		7.0	29.40
7210E18)	R + R RIGHT FRONT WING (BUMPER REMOVED) INCLUDES: R/HEADLAMP, R/F WHEEL, R/WHEELHOUSE REMOVE + REFIT. NOT INCLUDED: ADJUST HEADLAMPS.		2.0	8.40
7210A15	R + R FRONT PANEL		12.5	52.50
7620C27	R + R FRONT CROSSMEMBER		2.0	8.40
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT		1.0	4.20
NO NUMBER	R + R L/HEADLAMP BRACKET		2.0	8.40
NO NUMBER	R + R R/HEADLAMP BRACKET		2.0	8.40
7205E10	RENEW FRONT BUMPER (REMOVED)		5.0	21.00
7620A60	RENEW BONNET (REMOVED)		2.0	8.40

Code	Description	WU	Price SGD
7620C60	R + R BONNET	4.5	18.90
7620C62	R + R L/BONNET HINGE	1.0	4.20
7620C62	R + R BONNET HINGE	1.0	4.20
5540B38	CHECK AND ADJUST HEADLAMPS	2.0	8.40
NO NUMBER	R + R L/DOOR WINDOW TRIM FRAME	1.0	4.20
NO NUMBER	R + R R/WINDOW FRAME MOULDING	1.0	4.20
7210A36	RENEW LEFT FRONT SIDE MEMBER CLOSING	9.5	39.90
7210A36	RENEW RIGHT FRONT SIDE MEMBER CLOSING	9.5	39.90
7055B54	R + R LOWER ENGINE PROTECTION	3.0	12.60
7055B56	R + R R/LOWER ENGINE PROTECTION	3.0	12.60
5050A10)	R + R WINDSCREEN WASHER TANK	3.5	14.70
5530B52	R + R BATTERY BRACKET	2.5	10.50
	INCLUDES: R + R BATTERY		
1088B20)	R + R RADIATOR	6.0	25.20
	INCLUDES: R + R FAN AND FAN SHROUD, DRAIN + REFILL COOLING SYSTEM		
1048B50)	R + R CHARGE AIR COOLER	4.5	18.90
1016A10	R + R UPPER ENGINE COVER	1.0	4.20
1088B10)	OVERFLOW TANK FOR COOLANT	1.0	4.20
Labour Cost		Hrs	WU
Panel / Mechanical Labour		9.20	91.5
Total of Labour			384.30

Paint

Code	Description	WU	Price SGD
Paint Work		SYSTEM AZT	
		Time Basis 10 WU/h	
	BONNET NEW PART PAINTING	19.0	
	L/F WING NEW PART PAINTING	11.0	
	R/F WING NEW PART PAINTING	11.0	
	FRONT PANEL SURFACE PAINT	4.0	
	L/F HEADLAMP BRACKET SURFACE PAINT	4.0	
	R/F HEADLAMP BRACKET SURFACE PAINT	4.0	
	L/R LAMP BRACKET SURFACE PAINT	4.0	
	R/R LAMP BRACKET SURFACE PAINT	4.0	
	L/S-MEMB CLOSING PNL SURFACE PAINT	4.0	
	R/S-MEMB CLOSING PNL SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	50.38
0741	L/F WING NEW PART PAINTING	18.94
0742	R/F WING NEW PART PAINTING	18.94
0920	FRONT PANEL SURFACE PAINT	2.82
0925	L/F HEADLAMP BRACKET SURFACE PAINT	0.35
0926	R/F HEADLAMP BRACKET SURFACE PAINT	0.35
0927	L/R LAMP BRACKET SURFACE PAINT	0.35
0928	R/R LAMP BRACKET SURFACE PAINT	0.35
0953	L/S-MEMB CLOSING PNL SURFACE PAINT	0.70
0954	R/S-MEMB CLOSING PNL SURFACE PAINT	1.41

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			69.0	
Preparation Main Work Metal		0.80	8.0	33.60
Total	10 WU/h	7.70	77.0	323.40

Material Cost - Paint	Price SGD
New Part Painting	88.26
Surface-/Blend Paint	6.33
Material-constant Metal	18.10
Total	112.69

Spare Parts

				prices as at 2001-01-01
Code	Description	Part Number	Part Source	Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	30.00
0283	FRONT BUMPER	0000735615285	Original	670.00
0285	FRT BUMPER REINF	0000052180630	Original	485.00
0293	L/F BUMPER AIR GUIDE	0000735615291	Original	120.00
0294	R/F BUMPER AIR GUIDE	0000735615290	Original	120.00
0301	FRT BUMPER WIND DEFL	0000051828678	Original	90.00
0340	FRONT CROSSMEMBER	0000051984389	Original	485.00
0346	R/F BUMPER COVER	0000735615289	Original	35.00
0411	GRILLE	0000735618636	Original	245.00
0431	GRILLE BADGE	0000735578621	Original	90.00
0471	BONNET	0000052101773	Original	650.00
0475	L/BONNET HINGE	0000052035197	Original	70.00
0476	R/BONNET HINGE	0000052035196	Original	70.00
0485	BONNET INSULATION	0000051890148	Original	185.00
0493	BONNET LOCK	0000052046011	Original	105.00
0497	L/F BUMP CORNER BRKT	0000051973269	Original	70.00
0498	R/F BUMP CORNER BRKT	0000051973268	Original	70.00
0561	LEFT HEADLAMP ASSY	0000052109260	Original	375.00
0562	RIGHT HEADLAMP ASSY	0000052109257	Original	375.00
0741	L/F WING	0000051973882	Original	430.00
0742	R/F WING	0000051973881	Original	430.00
0745	L/F WING BRACKET	0000051810995	Original	75.00
0746	R/F WING BRACKET	0000051811090	Original	75.00
0841	L/F WHEELHOUSE COVER	0000052128357	Original	145.00
0920	FRONT PANEL	0000052122658	Original	320.00
0925	L/F HEADLAMP BRACKET	0000051974123	Original	160.00
0926	R/F HEADLAMP BRACKET	0000051974118	Original	160.00
0927	L/R LAMP BRACKET	0000051974099	Original	35.00
0928	R/R LAMP BRACKET	0000051973089	Original	35.00
0953	L/S-MEMB CLOSING PNL	0000052007755	Original	90.00
0954	R/S-MEMB CLOSING PNL	0000052007753	Original	90.00
1385	L/COWL MOULDING	0000735498423	Original	55.00
1386	R/COWL MOULDING	0000735498422	Original	55.00
1393	COWL PANEL GRILLE	0000735498287	Original	180.00
1435	WASHER RESERVOIR	0000052046691	Original	120.00
7761	RADIATOR	0000051897080	Original	565.00
7763	INTERCOOLER	0000051833975	Original	1,250.00
7765	RADIATOR AIR GUIDE	0000051974448	Original	235.00

Code	Description	Part Number	Part Source	Price SGD
7767	UPPER AIR GUIDE	0000051974446	Original	120.00
7787	EXPANSION TANK	0000051824339	Original	145.00
7790	FAN/FAN SHROUD CPL	0000051833973	Original	185.00
8780	LOWER ENGINE PROTECT	0000051844337	Original	670.00
8782	R/ENGINE COVER	0000051832930	Original	85.00
1000	AIR CLEANER BOX	AIR CLEANER BOX	Original	710.00
1001	AIR INTAKE DUCT	AIR INTAKE DUCT	Original	160.00
1002	RADIATOR FAN ASSY	RADIATOR FAN	Original	495.00
1003	DRIVE SHAFT OUTER RH	DRIVE SHAFT	Supplementary	R ₂ 870.00 ✓
1004	ENGINE MTG RH	ENGINE MTG	Supplementary	CM 195.00 ✓
1005	ENGINE MTG LH	ENGINE MTG	Supplementary	CM 110.00 ✓
1006	ENGINE LOWER MTG	ENGINE MTG	Supplementary	CM 95.00 ✓
1007	INTERCOOLER HOSE LH	INTERCOOLER	Supplementary	Per 235.00 ✓
1008	TURBO HSG HOSE	TURBO HOSE	Supplementary	WT 145.00 ✓
1009	ENGINE TIMING COVER	TIMING COVER	Supplementary	CM 235.00 ✓
1010	RADIATOR TOP HOSE	RADIATOR HOSE	Supplementary	Per 70.00 ✓
1011	CONDENSOR ASSY CPL	CONDENSOR ASSY	Supplementary	repeated 850.00 ✓
1012	TURBO VACCUM VALVE	TURBO VALVE	Supplementary	CM 285.00 ✓
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			14,505.00
u: Used parts	Total			14,505.00

Final Calculation


	SGD	SGD
Parts	14,505.00	
Total Parts		14,505.00
Labour Time Base 10 WU/h		
Total 91.5 WU X 42.00 SGD/h	384.30	
Total of Labour		384.30
Paint Work Time Base 10 WU/h		
Labour Cost 77.0 WU X 42.00 SGD/h	323.40	
Material Cost	112.69	
Total Paint Including Material		436.09
Repair Cost Excludes GST		15,325.39
GST (+7.0%)		1,072.78
Repair Cost Included GST		16,398.17

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.



Ding Auto Pte Ltd

Parts Supplementary & Quotation Form

Attention: Kenneth Kong @ LK
 Vehicle Number: GBD 6848 L
 Make & Model: Fiat Doblo (Auto)

Works Order Number:
 Our Reference Number:

NO	PART NUMBER	PARTS DESCRIPTION	QTY	UNIT PRICE	SURVEYOR REMARK	W/S REMARK
1		Drive shaft outer RH	1	\$ 870.00		✓
2		Engine mounting RH	1	\$ 195.00	check consistency	✓
3		Engine mounting LH	1	\$ 110.00		✓
		Engine lower mounting	1	\$ 95.00		✓
		Intercooler hose LH	1	\$ 235.00		✓
		Turbo housing HOSE	1	\$ 145.00		✓
		Engine Timing cover	1	\$ 235.00		✓
		Radiator top hose	1	\$ 70.00		✓
		Condenser Assy	1	\$ 850.00		✓
		Turbo Vacuum Valve	1	\$ 285.00		✓



ATOR: Henry Lee

SURVEYOR: Kenneth Kong