

ASS. REC. BY:

REF:

CC6/CTI 21012911/D29³

COB Aug 2024

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

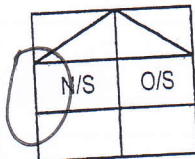

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

8

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SHD 3519K

Yr Regn

Aug 2016

Type: M.Car / M.Cycle / Bus / Van / Lorry / ☒ Taxi / Prime Mover /

Truck / Trailer or

Make:

Hyundai I40

c.c 1683

Colour

Blue

A/C: Insured / Std / NI / NA

Sp. Reading

474297

T/Radio: Insured / Std / NI / NA

Eng/No:

D4FD GU669077

C/No:

KMH1LB41UM GU093414

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/60 R16

R:

— 11 —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Westlake

Front

Rear

R/Bal.

S

mm

R/Bal.

S

mm

L/Bal.

S

mm

L/Bal.

S

mm

D.O.A.

19/12/2021

D.O.I.

22/12/2021

Survey held at

S. J. Prost S. M. M. M.

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S P. M. M.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Chama Taping GY 353S

Vehicle balance 32 months at time of accident

Value of taxi about 10,600/- Calculations behind

02/08/2022

Judgment 1/3 12,000/- with 8 days of work

Date/Time, File Pass to?

☐

Preli. Report

1)

Date/Time, File Return to?

☐

Final Report

2)

Report Format:

Lump Sum / I.B.I.: (\$)

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

Site Insp (\$)

☐

Interview (\$)

☐

Tech. Invs (\$)

☐

Weekend (\$)

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 20-Dec-21

INSURANCE: China Teiping

MODEL: HYUNDAI I40

VEHICLE NO.: SHD 3519K

DESCRIPTION	QTY	LIST PRICE	AMOUNT
REAR BUMPER <i>St 1 Dent</i>	1	\$ 1,106.00	\$1,106.00
REAR BUMPER BRACKET <i>H</i>	1	\$ 35.60	\$35.60
REAR FENDER (LH) <i>Dent</i>	1	\$ 2,171.40	\$2,171.40
REAR WINDSCREEN MOULDING <i>H</i>	1	\$ 51.80	\$51.80
REAR DOOR (LH) <i>Dent</i>	1	\$ 2,201.10	\$2,201.10
REAR DOOR RUBBER (LH) <i>H</i>	1	\$ 280.50	\$280.50
REAR DOOR REGULATOR (LH) <i>H</i>	1	\$ 660.90	\$660.90
REAR DOOR POWER WINDOW MOTOR <i>H</i>	1	\$ 386.20	\$386.20
REAR DOOR LOCK ASSY <i>H</i>	1	\$ 468.20	\$468.20
REAR DOOR TRIM BOARD (LH) <i>H</i>	1	\$ 808.70	\$808.70
REAR DOOR OUTER HANDLE (LH) <i>H</i>	1	\$ 134.50	\$134.50
ROCKER PANEL OUTER GARNISH (LH) <i>H</i>	1	\$ 732.80	\$732.80
ROCKER PANEL OUTER GARNISH CLIP (LH) <i>H</i>	1	\$ 65.00	\$65.00
REAR TYRE RIM (LH) <i>2 distance</i>	1	\$ 650.60	\$650.60
REAR TYRE WHEEL CAP <i>1st</i>	1	\$ 214.20	\$214.20
REAR WHEEL BEARING ING & HUB <i>2 Dent</i>	1	\$ 724.00	\$724.00
REAR TRAILING ARM (LH) <i>2 distance</i>	1	\$ 384.00	\$384.00
REAR ASSIST (LH) <i>2 distance</i>	1	\$ 219.40	\$219.40
REAR SHOCK ABSORBER (LH) <i>2 distance</i>	1	\$ 683.70	\$683.70
REAR SHOCK ABSORBER MOUNTING (LH) <i>H</i>	1	\$ 162.60	\$162.60
REAR CROSS MEMBER <i>H Dent</i>	1	\$ 2,021.50	\$2,021.50
STABILIZER BAR <i>H</i>	1	\$ 199.60	\$199.60
STABILIZER LINK <i>H</i>	1	\$ 85.90	\$85.90
REAR UPPER ARM (LH) <i>2 distance</i>	1	\$ 335.75	\$335.75
REAR LOWER ARM (LH) <i>2 1st</i>	1	\$ 353.80	\$353.80
REAR KNUCKLE ARM (LH) <i>2 distance</i>	1	\$ 545.60	\$545.60
FRONT FENDER (LH) <i>Dent</i>	1	\$ 663.00	\$663.00
FRONT FENDER SHIELD (LH) <i>H</i>	1	\$ 174.90	\$174.90
FRONT DOOR MIRROR SIDE GARNISH <i>H</i>	1	\$ 225.00	\$225.00
FRONT DOOR MIRROR ASSY (LH) <i>H</i>	1	\$ 893.50	\$893.50
FRONT DOOR (LH) <i>Dent</i>	1	\$ 2,256.40	\$2,256.40
FRONT DOOR RUBBER <i>H</i>	1	\$ 290.50	\$290.50
FRONT DOOR GEAR/REGULATOR (LH) <i>2 H</i>	1	\$ 776.80	\$776.80
FRONT DOOR POWER MOTOR (RH) <i>2 H</i>	1	\$ 296.40	\$296.40
FRONT DOOR TRIM BOARD (LH) <i>H</i>	1	\$ 997.40	\$997.40
FRONT DOOR INNER LOCK (LH) <i>H</i>	1	\$ 490.80	\$490.80
FRONT DOOR OUTER HANDLE (LH) <i>H</i>	1	\$ 132.30	\$132.30
FRONT WHEEL RIM (LH) <i>H</i>	1	\$ 650.60	\$650.60
FRONT WHEEL HUB CAP (LH) <i>H</i>	1	\$ 214.20	\$214.20
KNUCKLE ARM (LH) <i>H</i>	1	\$ 1,104.00	\$1,104.00
FRONT WHEEL BEARING AND HUB (LH) <i>H</i>	1	\$ 863.80	\$863.80
FRONT SUSPENSION LOWER ARM (LH) <i>H</i>	1	\$ 595.90	\$595.90

✓ 553.00

X

✓

✓

✓

✓

X

X

X

X

X

X

X

X

✓

✓

✓

✓

✓

✓

X

✓

X

X

✓

✓

✓

✓

✓

X

X

✓

✓

✓

X

X

X

X

X

X

X

X

X

X

X

X

✓ 325.30

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

✓

✓

✓

✓

✓

✓

X

✓

X

X

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

✓ 107.10

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

✓

✓

✓

✓

✓

✓

X

✓

X

X

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

✓ 362.00

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

✓

✓

✓

✓

✓

✓

X

✓

X

X

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

✓ 192.00

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

✓

✓

✓

✓

✓

✓

X

✓

X

X

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

X

✓ 145.70

✓

✓

✓

✓

✓

X

X

X

X

X

X

X

X

✓

✓

✓

✓

✓

✓

X

✓

X

X

✓

✓

✓

✓

SUB TOTAL				\$26,308.85
LESS 20%				\$5,261.77
DISCOUNTED TOTAL				\$21,047.08
REAR WINDSCREEN SEALANT H/c	SN	1	\$ 46.00	\$46.00
REAR DOOR TEL NO. STICKER (LH) H/c	SN	1	\$ 10.00	\$10.00
Rear Door Comfortdelgro & Apps Sticker(LH) H/c	SN	1	\$ 80.00	\$ 80.00
REAR TYRE (LH) H/c	SN	1	\$ 216.00	\$216.00
FRONT DOOR COMFORT LOGO (LH) H/c	SN	1	\$ 75.00	\$75.00
FRONT TYRE (LH) H/c	SN	1	\$ 216.00	\$216.00
SUB TOTAL				\$643.00
Labour Charge				
Panel Beating	1	\$ 1,800.00	\$1,800.00	1000/-
Spray Painting Charge	1	\$ 1,800.00	\$1,800.00	1000/-
Wiring Charge	1	\$ 100.00	\$100.00	H/c
Tuff Kote	1	\$ 100.00	\$100.00	40/-
Towing Charge	1	\$ 80.00	\$80.00	H/c
Remove/Refix Cushion & Upholstery Rear	1	\$ 150.00	\$150.00	80/-
Remove/Refix Rear Windscreen Glass	1	\$ 120.00	\$120.00	80/-
Remove/Refix Reverse Sensor	1	\$ 120.00	\$120.00	40/-
Remove/Refix Undercarriage (RR)	1	\$ 400.00	\$400.00	150/-
Re-set Rear ABS System	1	\$ 400.00	\$400.00	H/c
Remove/Refix Fuel Tank	1	\$ 150.00	\$150.00	H/c
Remove/Refix Exhaust Pipe	1	\$ 150.00	\$150.00	H/c
Transfer of Door Mechanism FRONT	1	\$ 80.00	\$80.00	60/-
Re-set Frt Power Window System	1	\$ 200.00	\$200.00	H/c 2520.00
Transfer of Door Mechanism REAR	1	\$ 80.00	\$80.00	60/-
Re-set Rear Power Window System	1	\$ 200.00	\$200.00	H/c
Four Wheel Alignment	1	\$ 120.00	\$120.00	60/-
Diagnostic & Resetting To Erase Fault Code	1	\$ 550.00	\$550.00	150/-
TOTAL LABOUR				\$6,600.00
ESTIMATE TOTAL				\$ 28,290.08
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance				

13198.65

10558.92

✓

✓

✓

X

✓

X

800/-

1000/-

1000/-

H/c

40/-

H/c

80/-

80/-

40/-

150/-

H/c

H/c

H/c

60/-

H/c

60/-

H/c

60/-

150/-

22/12/2021 @ 0945hr

H/c Antenna

2/sum 8 dgs

Ryan

LKK Auto

Check PTA prices

Check BV

13,289.92

Supp 2022.24

15,312.16

4/5 12,000/-

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 22-Dec-21

INSURANCE: China Tipping

MODEL: HYUNDAI I40

VEHICLE NO.: SHD 3519K

DESCRIPTION	QTY	LIST PRICE	AMOUNT
DOOR CENTRE PILLAR OUTER (LH) <i>Denur</i>	1	\$ 2,527.80	\$2,527.80
SUB TOTAL			\$2,527.80
LESS 20%			\$505.56
DISCOUNTED TOTAL			\$2,022.24
ESTIMATE TOTAL			\$2,022.24

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance

nyan
2kk Auto
8