

Repair Estimate

Thiam Heng Huat Pte Ltd


176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Mobile: 82636295 Email: thiamhenghuat@gmail.com

Not withair
1/1000 @ 2050h
Recovery After Pain
3days

Make/Model: KIA CERATO K3
Engine/Chassis No.: KNAFJ411MJ5747344
Date of accident:
Damaged area: Rear

Date: 23/12/2021
Claim Type: TP
VRN: SLU4763C

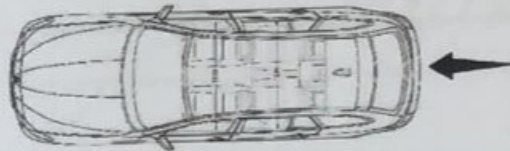

List items					
S/N	Parts description	QTY	UNIT PRICE	AMOUNT	
1	Bootlid	R 1	\$ 1,297.00	\$ 1,297.00	X
2	Bootlid lock	R 1	\$ 288.90	\$ 288.90	X
3	Bootlid lock catch	R 1	\$ 62.50	\$ 62.50	X
4	Bootlid insulator	Sn 1	\$ 289.30	\$ 289.30	X
5	Bootlid hinge	R 2	\$ 99.30	\$ 198.60	X
6	Bootlid absorber	Sn 2	\$ 139.00	\$ 278.00	X
7	Bootlid "CERATO" emblem	NAC 1	\$ 35.00	\$ 35.00	X
8	Bootlid "K3" emblem	NAC 1	\$ 42.50	\$ 42.50	X
9	Bootlid "KIA" logo	NAC 1	\$ 55.00	\$ 55.00	X
10	Bootlid weatherstrip	Sn 1	\$ 167.00	\$ 167.00	X
11	Bootlid stopper	Sn 2	\$ 24.00	\$ 48.00	X
12	Bootlid lamp	Sn 2	\$ 467.00	\$ 934.00	X
13	Taillamp	Sn 2	\$ 788.00	\$ 1,576.00	X
14	Rear bumper top bracket	Sn 2	\$ 114.00	\$ 228.00	X
15	Rear bumper lower 258	Bril/nd 1	\$ 347.00	\$ 347.00	X
16	Rear bumper 688	Nd/nd 1	\$ 688.00	\$ 688.00	X
17	Rear bumper reinforcement	CMF 1	\$ 318.00	\$ 318.00	X
18	Rear bumper absorber	Sn 1	\$ 187.00	\$ 187.00	X
19	Rear bumper retainer	Sn 2	\$ 55.00	\$ 110.00	X
20	Rear bumper reflector	Sn 2	\$ 71.30	\$ 142.60	X
21	End panel	R 1	\$ 580.30	\$ 580.30	X
22	End panel top garnish	Sn 1	\$ 350.70	\$ 350.70	X
23	Rear bumper reinforcement bracket @68	CM 2	\$ 120.00	\$ 240.00	X
Subtotal				\$ 8,463.40	
List discount				10.00%	
Total				\$ 7,617.06	

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Repair Estimate

Special nett items

No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	Rear bumper parking sensor <i>Shen</i>	1	\$ 280.00	\$ 280.00
2	Bootlid insulator clips <i>nn</i>	8	\$ 4.50	\$ 36.00
3	Rear bumper clips <i>nn</i>	10	\$ 4.50	\$ 45.00
4	End panel sealant <i>nn</i>	1	\$ 100.00	\$ 100.00
5	End panel top garnish clips <i>nn</i>	6	\$ 4.50	\$ 27.00
6	Sundries <i>nn</i>	1	\$ 50.00	\$ 50.00
Total				\$ 538.00

2003n
X
X
X
X

Labour

No.	Description	Work unit	Amount
1	To dismantle / renew the accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	6	\$ 1,200.00
2	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions including taillamp lightings.	0.25	\$ 50.00
3	To remove, refit bootlid components and replace bootlid, check and re-adjust close gap, alignment and water seepage.	0.5	\$ <i>nn</i> 100.00
4	Supply spray paint material and necessary items to respray affected area / panel.	6	\$ 1,200.00
5	To rust proof all affected portions after repair.	0.5	\$ 100.00
Total labour			\$ 2,650.00

4300
150
X
600
X

Estimate Grand Total \$ 10,805.06