

ASS. REC. BY:

REF:

072/ 21013063/k₂y₃

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

SNM21D207446/C01

Sum Insured:

Excess:

0


(Client's Record)

Make of Veh:

100am

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

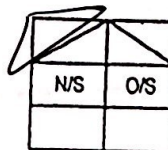

Bal. or Market Value:

\$102K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

1.31 %

3 Val.: Yes or No

CA / REV

REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

PNB 872714

Yr Regn: 09, 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Yaris Cross c.c. 1496

Colour

M Red

A/C: Insured / Std / NI / NA

Sp. Reading

3621

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

M7P310-2010218

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD / RIM or

Tyre Size:

F:

205/55R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

23/12/21

D.O.I.

28/12/2021

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

No Stock in local market

30/12/21 @ 1.31pm revert to Pauline Tham via Merimen.

31/12/21 @ 11.04am Pauline Tham informed C/A via Merimen.

31/12/21 @ 1.36pm Informed Henry C/A & ex:\$0/- by email.

We will be advising our Principal a cost of repair of final figure \$4,884.56 before excess \$0/- & GST with 4 days of repair, subject to their approval.

(Red \$3446.30, 41%)

Date/Time, File Pass to?

☐

: Prell. Report

1) 23/05 Typist

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: 4

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

\$ - RS. \$

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format: MER-OD

Lump Sum I.B.I: (\$ 4884.56)

Estimate Repair

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10,#01-20
575645



Insurer Reference:
Repairer Reference: 045238
Date calculated: 22/12/2021 4:13 PM

Full Report
Registration: SNB8727H
Printed: 22/12/2021 4:13 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	18/12/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	YARIS
Sub Model:	BASE MODEL
Model Sheet Number:	70 CP 01
Registration:	SNB8727H
VIN number:	
Odometer:	3311
Model Specs	
5-DOOR	

Not authorized
Repairer B'gain
Ex @ 500h
4 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

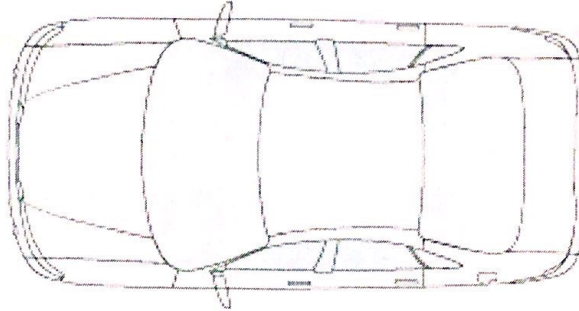

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
P020	REPLACE FRONT BUMPER BAR INCLUDES: FRONT BUMPER ,RADIATOR GRILLE AND REQUIRED ATTACHED PARTS R + R. NOT INCLUDED: PARKING HELP SENSOR REMOVE AND REFIT.		16.0	67.20
B040)	R + R LEFT HEADLAMP (BUMPER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMP		1.0	4.20
B020)	RENEW FRONT BUMPER REINFORCEMENT		5.0	21.00
531041)	R + R LEFT FRONT WHEELHOUSE SHELL		3.0	12.60
NO NUMBER	R + R L/F BUMPER MOUNTING		1.0	4.20
NO NUMBER	R + R R/F BUMPER MOUNTING		1.0	4.20
420018)	R + R FRONT WHEEL (WHEELS)		1.0	4.20
420018)	R + R WHEEL/S (ADD/WORK)		1.0	4.20
B040)	ADJUST HEADLAMPS		2.0	8.40

Labour Cost
Panel / Mechanical Labour

Total of Labour

Hrs 3.10 WU 31.0 130.20
130.20

Time Basis 10 WU/h
WU Price SGD

Paint

Paint Work

Code	Description	Price SGD
	FRONT BUMPER NEW PART PAINT K1R	11.0
Paint Material Per Part		48.86
Code	Description	
0281	FRONT BUMPER NEW PART PAINT K1R	

Labour Cost - Paint

Factor 42.00 SGD/h
Time Paint
Preparation Comp. Work Plastic
Total

42.00 SGD/h

10 WU/h

Hrs WU Price SGD
0.70 11.0 29.40
1.80 7.0 75.60
18.0

Material Cost - Paint

New Part Painting - Plastic K1R
Material-constant Plastic
Total

Price SGD
48.86
16.20
65.06

Spare Parts

prices as at 2015-06-01/01
Price SGD

Code	Description	Part Number	Part Source	Price SGD
0253	LWR RADIATOR GRILLE	53112 K0010	Original	195.00
0281	FRONT BUMPER	52119 0U946	Original	1,350.00
0317	L/F BUMPER BRACKET	52536 K0010	Original	90.00
0318	R/F BUMPER BRACKET	52535 K0010	Original	90.00
0333	FRT BUMPER ABSORBER	52611 K0010	Original	45.00
0340	FRT BUMPER REINF	52131 K0020	Original	170.00
0410	GRILLE	53101 K0050	Original	240.00
0419	CTR GRILLE MOULDING	53155 K0030	Original	115.00
0431	MANUFACTURER BADGE	75431 0D050	Original	155.00
0561	LEFT HEADLAMP ASSY	81170 K0050	Original	3,225.00
0841	L/F WHEELHOUSE COVER	53876 K0020	Original	175.00
1000	BUMPER FOAM PROTECT	BUMPER FOAM	Original	45.00
1001	FENDER ARCH PANEL	FENDER ARCH	Original	215.00
1002	HEADLAMP PANEL LH	HAEDLAMP PANEL	Original	460.00
1003	INDICATOR LAMP LH	INDICATOR LAMP	Original	450.00
1005	BUMPER UPPER SEAL	BUMPER SEAL	Original	105.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal

0.00
7,125.00

Total**7,125.00****Extras**

Code	Description	Price SGD
1004	PARKING SENSOR LH PARKING SENSOR	185.00*
Total Extras		185.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	7,125.00	7,125.00
Labour Time Base 10 WU/h		
Total 31.0 WU X 42.00 SGD/h	130.20	
Total of Labour		130.20
Total Of Extras		185.00
Paint Work Time Base 10 WU/h		
Labour Cost 18.0 WU X 42.00 SGD/h	75.60	
Material Cost	65.06	
Total Paint Including Material		140.66
Repair Cost Excludes GST		7,580.86
GST (+7.0%)		530.66
Repair Cost Included GST		8,111.52

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

118J

Vehicle Details

Vehicle No.:

SNB8727H

Vehicle to be Exported:

Yes

Intended Deregistration Date:

23 Dec 2021

Vehicle Make:

TOYOTA

Vehicle Model:

YARIS CROSS 1.5G CVT

Primary Colour:

Red

Manufacturing Year:

2021

Engine No.:

M15AY181561

Chassis No.:

MXPB102010218

Maximum Power Output:

88.0 kW (118 bhp)

Open Market Value:

\$22,319.00

Original Registration Date:

17 Sep 2021

First Registration Date:

17 Sep 2021

Transfer Count:

0

Actual ARF Paid:

\$8,247.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

16 Sep 2031

PARF Rebate Amount:

\$6,185.00

Intended COE Rebate Details

COE Expiry Date:

16 Sep 2031

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$47,000.00

COE Rebate Amount:

\$37,600.00

Total Rebate Amount:

\$43,785.00

The information contained herein is correct as at 18 Dec 2021

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	18/12/2021 16:44 (SGT)
Date of Accident	18/12/2021 08:30 (SGT)
Exact Location of Accident	Kim Tian Rd, Singapore
Additional Location Information	ALONG KIM TIAN ROAD MSCP
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SNB8727H
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	ONG KAY SOON LIGHTZ
NRIC No	SXXXX118J
Email Address	lightz82@gmail.com
Mobile Phone No	(Phone) +65-93220911
Alternative Phone No	(Office) +65-93220911

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Yaris
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1496

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMPCSNW00190802100
Cover Note Number	-

DRIVER

Name of Driver	ONG KAY SOON LIGHTZ
NRIC No	SXXXX118J