

Kennerh

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/IV

To Inspect Vehicle No: _____

at Workshop m/s Ding

of _____

Insured: _____

Policy No. _____

Claims No. SNM21D207427/C01

Sum Insured: _____ Excess: 2000

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

Bal. or Market Value: 850k

IDAC Accident Rport: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 10 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SL E 77863 Yr Regn: 08 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or Wagon

Make: Toy Pientp c.c. 1496

Colour: M. Black A/C: Insured / Std / NI / NA

Sp. Reading: 129149 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: NSP170. 7017885

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modf: Nil / S/Rim / STD A/Rim or

Tyre Size: F: Yoko

R: Pirene 185/60R15

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. 3 mm R/Bal. 2 mm

L/Bal. 2 mm L/Bal. 2 mm

D.O.A. 18/12/21 D.O.I. 24/12/2021

Survey held at _____

Des. of Damages: Fnt / Rear / O/S / N/S / UIC / Rooftop or

Rt N/S & Rt O/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
<u>24/12</u>	<u>Tyres photos taken, in order.</u>
<u>03/01/22@3.32pm</u>	<u>revert to Adeline Chng via Merimen.</u>
<u>05/01/22@4.33pm</u>	<u>Pauline Tham informed C/A via Merimen</u>
<u>06/01/22@9.22am</u>	<u>Informed Henry C/A & ex:\$2000 by email.</u>
<u>17/03/22@2.32pm</u>	<u>finalised with Henry LS \$6950, 10 days. (Red \$7835.34, 53%)</u>

Date/Time, File Pass to? : Prell. Report

1) 17/03 Typist : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 10

Resurvey No. of Trip: 2

Survey Fee:	
Transportation:	
S + RS:	
Fuel:	
Others:	
TOTAL	

- Add Fee:
- : Site Insp (\$ _____)
 - : Interview (\$ _____)
 - : Tech Invs (\$ _____)
 - : Weekend (\$ _____)

Report Format: MER-OD

Lump Sum H.B.: (\$ 6950)



Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645

Insurer Reference:
Repairer Reference: 045231
Date calculated: 22/12/2021 1:28 PM

Full Report
Registration: SLE7786B
Printed: 22/12/2021 1:28 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	18/12/21
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:	21	Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	TOYOTA		
Model:	SIENTA		
Sub Model:	ELEGANCE		
Model Sheet Number:	70 T2 17		
Registration:	SLE7786B		
VIN number:			
Odometer:	129143		
Model Specs			
AIR CONDITIONING	1.5 LTR 79 KW	CVT AUTOMATIC	FRONT DRIVE

*Not authorized
L/Ring &*

10 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company


Acknowledged by Repairer
Signature:
Date:

Vehicle Condition

Vehicle Status
 Pre-Accident Damage:
 Date of Inspection:

Damage Areas

All
 Underbody

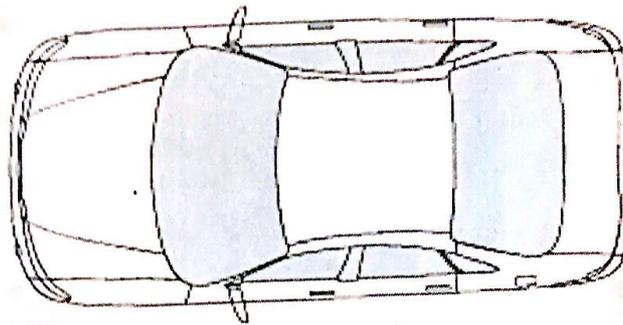

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	

Spare Tyre Brand Tread (Spare), mm

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B040	ADJUST HEADLAMPS		2.0	8.40
B040	RENEW LOWER FRONT PANEL		7.0	29.40
B110	RENEW L/F WING (BUMPER AND HEADLAMP REMOVED) INCLUDES: R + R WING, CONVERT ATTACHED PARTS		5.0	21.00
B110	RENEW R/F WING (BUMPER AND HEADLAMP REMOVED) INCLUDES: R + R WING, CONVERT ATTACHED PARTS		5.0	21.00
NO NUMBER	R + R BONNET LOCK BRKT		2.0	8.40
B010	R + R FRONT BUMPER		5.0	21.00
B020)	RENEW FRONT BUMPER (REMOVED) INCLUDES: REQUIRED ATTACHED PARTS REMOVE AND REFIT		4.0	16.80
B010)	R + R FRONT BUMPER REINFORCEMENT		3.0	12.60
B040)	R + R LEFT HEADLAMP		1.0	4.20
B040)	R + R RIGHT HEADLAMP		1.0	4.20

Code	Description	WU	Price SGD
B040)	RENEW HEADLAMP (REMOVED)	1.0	4.20
530051	RENEW BONNET	3.0	12.60
	INCLUDES: R + R BONNET,		
	ATTACH PARTS ASSEMBLE AND IF NEC RENEW		
B080	RENEW BONNET HINGE/S	1.0	4.20
851091)	R + R WASHER RESERVOIR	1.0	4.20
B125	RENEW FRONT LOCK CARRIER	5.0	21.00
B085)	R + R WIRE LINKAGE	1.0	4.20
G010	R + R WINDSCREEN	17.0	71.40
	INCLUDES: R + R WIPER ARMS, COWL GRILLE,		
	A-PILLAR TRIMS, INSIDE MIRROR AND ALL		
	NECESSARY ATTACHED PARTS		
B085)	RENEW AIR GRILLE (REMOVED)	2.0	8.40
M010)	RENEW AIR CON CONDENSER	2.0	8.40
M010	DRAIN AIR CONDITIONING	3.0	12.60
NO NUMBER	RENEW CONDENSER-/COMPRESSOR HOSE	4.0	16.80
NO NUMBER	R + R COMPRESSOR-/EVAPORATOR HOSE	4.0	16.80
002889	REFILL AIR CONDITIONING	7.0	29.40
NO NUMBER	R + R WIRING HARNESS PAN	3.0	12.60
20	R + R RADIATOR	5.0	21.00
	INCLUDES: BLEED COOLING SYSTEM		
160101)	R + R UPPER RADIATOR HOSE	2.0	8.40
160111)	R + R LOWER RADIATOR HOSE	2.0	8.40
M020)	RENEW RADIATOR (REMOVED)	2.0	8.40
171021	R + R AIR FILTER CPL	3.0	12.60
111261)	DETACH AND REFIT R/F ENGINE MOUNT	2.0	8.40
111261)	R + R RIGHT FRONT ENGINE MOUNT	3.0	12.60
NO NUMBER	DISS/ASS GEARBOX MOUNTING	2.0	8.40
NO NUMBER	R + R FRONT CENTRE GEARBOX SUSPENSION	3.0	12.60
450251 ZAX	R + R L/SUPPORTING JOINT	1.0	4.20
450251 ZAX	R + R R/SUPPORTING JOINT	1.0	4.20
420018)	R + R LEFT FRONT WHEEL	1.0	4.20
420018)	R + R RIGHT FRONT WHEEL	1.0	4.20
420018)	R + R FRONT WHEEL(S), ASSOCIATED WORK	1.0	4.20
473101)	DETACH + REFIT FRONT BRAKE CALIPER	2.0	8.40
431011)	R + R L/F AND R/F AXLE LINK	5.0	21.00
431151)	DISS/ASS L/F UPPER SUSPENSION STRUT	1.0	4.20
431151)	DISS/ASS R/F UPPER SUSPENSION STRUT	1.0	4.20
431151)	DISS/ASS FRONT LOWER SUSPENSION STRUT	1.0	4.20
431151)	R + R L/F SHOCK ABSORBER	5.0	21.00
431151)	R + R R/F SHOCK ABSORBER	5.0	21.00
431101)	RENEW L/F COIL SPRING	6.0	25.20
431101)	RENEW R/F COIL SPRING	6.0	25.20
431611A	DETACH + REFIT LEFT FRONT STABILIZER	1.0	4.20
431611A	DETACH + REFIT RIGHT FRONT STABILIZER	1.0	4.20
431011)	RENEW L/F LOWER AXLE LINK (REMOVED)	2.0	8.40
431011)	RENEW R/F LOWER AXLE LINK (REMOVED)	2.0	8.40
431611)	R + R STABILIZER BRACKET	3.0	12.60
NO NUMBER	R + R REAR ENINGE MOUNTING	4.0	16.80
NO NUMBER	DIS-/ASS ENGINE SUPPORTS	5.0	21.00
NO NUMBER	RENEW R/ENGINE CARRIER FLANGE	3.0	12.60
434211)	R + R L/F STEERING KNUCKLE	3.0	12.60
434211)	R + R R/F STEERING KNUCKLE	3.0	12.60
434211)	RENEW L/F STEERING KNUCKLE (REMOVED)	5.0	21.00
434211)	RENEW R/F STEERING KNUCKLE (REMOVED)	5.0	21.00

Code	Description	WU	Price SGD
NO NUMBER	ADD/WORK R + R FRONT STEERING KNUCKLE/S	5.0	21.00
Labour Cost			
	Panel / Mechanical Labour	Hrs 19.20	WU 192.0
	Total of Labour		806.40
			806.40

Paint

Paint Work		SYSTEM AZT		Time Basis 10 WU/h	
Code	Description	WU	Price SGD		
	BONNET NEW PART PAINTING	11.0			
	L/F WING NEW PART PAINTING	9.0			
	R/F WING NEW PART PAINTING	9.0			
	FRONT PANEL CPL SURFACE PAINT	6.0			
	FRONT BUMPER NEW PART PAINT K1R	11.0			

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	22.57
0741	L/F WING NEW PART PAINTING	13.30
0742	R/F WING NEW PART PAINTING	13.30
1009	FRONT PANEL CPL SURFACE PAINT	8.80
0281	FRONT BUMPER NEW PART PAINT K1R	44.67

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			46.0	
Preparation Main Work Metal		0.70	7.0	29.40
Preparation Comp. Work Plastic		0.30	3.0	12.60
Total	10 WU/h	5.60	56.0	235.20

Material Cost - Paint

Description	Price SGD
New Part Painting	49.17
New Part Painting - Plastic K1R	44.67
Surface-/Blend Paint	8.80
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	129.74

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
0255	L/F LOWER BUMPER LID	81482 0D290	Original		90.00 ?
0256	R/F LOWER BUMPER LID	81481 0D280	Original		90.00 ?
0257	FRONT NUMBER PLATE	KNPL3	Original		30.00 ?
0258	FRT NO PLATE REINF	KNPL0	Original		30.00 ?
0281	FRONT BUMPER	52119 0U928	Original		180.00 ?

Bidit

Code	Description	Part Number	Part Source	Price SGD	
0317	L/F BUMPER BRACKET	52144 0D120	Original	48.00	✓
0318	R/F BUMPER BRACKET	52143 0D120	Original	48.00	✓
0340	FRT BUMPER REINF	52021 0D140	Original	135.00	✓
0341	FRT CTR UPP BRACKET	52521 0D020	Original	145.00	?
0393	LOWER FRONT SPOILER	76851 0D190	Original	115.00	X
0410	GRILLE	53101 0D700	Original	385.00	✓
0431	MANUFACTURER BADGE	75301 0D160	Original	36.00	✓
0471	BONNET	53301 0D260	Original	300.00	✓
0474	FRONT BONNET SEAL	53395 0D040	Original	55.00	✓
0475	L/BONNET HINGE	53420 0D640	Original	36.00	✓
0476	R/BONNET HINGE	53410 0D640	Original	36.00	✓
0493	BONNET LOCK	53510 0D640	Original	60.00	✓
0494	BONNET LOCK BRACKET	53208 0D140	Original	45.00	✓
0495	BONNET STAY	53440 0D190	Original	48.00	X
0503	L/WINDSCREEN MLDG	76004 0D010	Original	120.00	X
0561	LEFT HEADLAMP ASSY	81150 0DB50	Original	1,020.00	✓
0562	RIGHT HEADLAMP ASSY	81110 0DB50	Original	1,020.00	✓
0741	L/F WING	53812 0D220	Original	215.00	✓
0742	R/F WING	53811 0D220	Original	215.00	✓
0841	L/F WHEELHOUSE COVER	53876 0D410	Original	85.00	✓
0842	R/F WHEELHOUSE COVER	53875 0D410	Original	85.00	✓
0993	L/UPP RADIATOR BRKT	53203 0D090	Original	45.00	✓
0994	R/UPP RADIATOR BRKT	53202 0D080	Original	40.00	✓
1009	FRONT PANEL CPL	53201 0D200	Original	435.00	✓
1015	UPP RADIATOR COVER	53289 0D140	Original	110.00	✓
1191	L/F AIR DUCT	53286 0D310	Original	40.00	✓
1192	R/F AIR DUCT	53285 0D310	Original	40.00	?
1393	FRT AIR GRILLE	55708 0D390	Original	145.00	✓
1411	LWR WINDSCREEN SEAL	56118 0D060	Original	75.00	X
1436	WASHER CONTAINER	85315 0D300	Original	90.00	?
1441	REAR WASH/WIPE PUMP	85330 0D200	Original	155.00	?
4448	CONDENSER FIX FRAME	88891 0D370	Original	45.00	?
4465	CONDENSER	88460 0D390	Original	660.00	✓
4479	COMPR/CONDENSER TUBE	88711 0D510	Original	196.00	?
4481	HIGH PRESSURE PIPE	88704 0D090	Original	288.00	?
7053	L/LWR AXLE STEERING	48069 09270	Original	215.00	?
7054	R/LWR AXLE STEERING	48068 09260	Original	215.00	?
7077	L/FR SHOCK ABSORBER	48520 0D370	Original	195.00	?
7078	R/FR SHOCK ABSORBER	48510 0DB20	Original	195.00	?
7081	L/F STEERING KNUCKLE	43212 0D290	Original	240.00	?
7082	R/F STEERING KNUCKLE	43211 0D290	Original	240.00	?
7091	L/UPP SUPP MOUNTING	48609 0D150	Original	55.00	?
7092	R/UPP SUPP MOUNTING	48609 0D150	Original	55.00	?
7131	L/F WHEEL HUB	43560 0D040	Original	120.00	?
7132	R/F WHEEL HUB	43550 0D140	Original	120.00	?
7271	L/F STABI LINKAGE	48820 0D040	Original	65.00	X
7272	R/F STABI LINKAGE	48820 0D040	Original	65.00	X
7311	L/TIE ROD BALL JOINT	45047 09390	Original	60.00	?
7312	R/TIE ROD BALL JOINT	45046 09760	Original	60.00	?
7761	RADIATOR CPL	16400 0Y130	Original	600.00	✓
7767	RADIATOR SHROUD	16711 0T190	Original	120.00	?
7773	UPPER RADIATOR HOSE	16268 0Y040	Original	55.00	?
7774	FRT UPP RAD HOSE	16571 0Y101	Original	150.00	?

Code	Description	Part Number	Part Source	Price SGD	
7776	LWR RADIATOR HOSE	16572 OY120	Original	150.00	?
7777	THERMOSTAT ELBOW	16031 OY010	Original	85.00	?
7790	FAN MOTOR	16363 OY050	Original	185.00	?
7793	COOLING FAN	16361 OM060	Original	90.00	?
8391	AIR FILTER ASSY	17700 OY140	Original	360.00	?
8403	FILTER INLET HOSE	17751 OY140	Original	185.00	?
8405	INLET HOSE	17881 OY090	Original	145.00	?
8632	RIGHT ENGINE SUPPORT	12315 47040	Original	120.00	?
8642	R/RUBBER BUSH	12305 OY060	Original	120.00	?
8781	L/LOWER ENGINE COVER	51442 OD230	Original	145.00	?
8782	R/LOWER ENGINE COVER	51441 OD350	Original	40.00	?
8931	FRT CTR G-BOX SUPP	12325 OY180	Original	285.00	?
8933	ENGINE SUPPORT	12372 OY060	Original	115.00	?
8941	FRT RUBBER BUSH	12364 OY010	Original	90.00	?
8943	ENGINE RUBBER BRG	12363 OY120	Original	95.00	?
9629	BATTERY	28800 OY161	Original	280.00	?
9631	BATTERY TRAY	28899 OY010	Original	90.00	?
9646	LOW TONE HORN	86520 OK010	Original	65.00	?
9653	L/FUSE BOX COVER	82662 OD350	Original	85.00	?
9665	L/FUSE BOX COVER	NO NUMBER	Original	125.00	?
9667	L/FUSE BOX	NO NUMBER	Original	320.00	?
1000	FOG LAMP ASSY RH	FOG LAMP RH	Original	120.00	?
1001	FOG LAMP ASSY LH	FOG LAMP LH	Original	120.00	?
1002	FOG LAMP BRACKET RH	FOG LAMP	Original	60.00	?
1003	FOG LAMP BRACKET LH	FOG LAMP	Original	60.00	?
1004	BONNET INSULATION	BONNET	Original	168.00	?
1005	FRT BUMPER SPONGE	BUMPER SPONGE	Original	50.00	?

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	13,614.00
Total	13,614.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	13,614.00	13,614.00
Labour Time Base 10 WU/h		
Total 192.0 WU X 42.00 SGD/h	806.40	
Total of Labour		806.40
Paint Work Time Base 10 WU/h		
Labour Cost 56.0 WU X 42.00 SGD/h	235.20	
Material Cost	129.74	
Total Paint Including Material		364.94
Repair Cost Excludes GST		14,785.34
GST (+7.0%)		1,034.97
Repair Cost Included GST		15,820.31