# **LKK Auto Consultants** #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

**Insurer Reference: SJM2728J** 

**Full Report** Repairer Reference: M3792 / SJM2728J Registration: SJM2728J Date calculated: 06/06/2022 1:32 PM Printed: 06/06/2022 1:33 PM

## **Summary Information**

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

KK LAU Printed by: Claim Reference: SJM2728J

5 Estimated Repair Time: Actual Repair Days:

Currency: SGD Date of Incident: 15/12/21 Hire Car Start:

Hire Car End:

#### **Vehicle Details**

Vehicle

**MITSUBISHI** Manufacturer: Model: COLT (Z30) Sub Model: **VERSION-R** Model Sheet Number: 32 62 32 Registration: SJM2728J

VIN number: JMYXTZ27A8Z000153

Odometer: 212073

**Model Specs** 

6-SPEED GEARBOX 5-DOOR


### **Vehicle Condition**

### **Vehicle Status**

Pre-Accident Damage: Date of Inspection:

## **Damage Areas**

All	
Underbody	

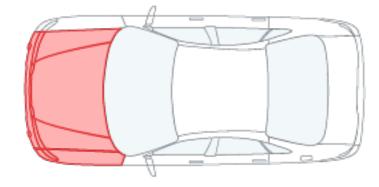

## **Tyres Condition**

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand

Tread (Spare), mm

### Labour

	Time Base 10 WU/h	Price = 42.	.00 SGD/h
Code	Description	WU	Price SGD
NO NUMBER	PREPARATION TIME	2.0	8.40
NO NUMBER	ADJUST HEADLAMPS	2.0	8.40
514110 10	R + R FRONT BUMPER	8.0	33.60
514121 10)	R + R FRONT BUMPER ATTACHED PARTS	2.0	8.40
422022 10)	R + R L/F WING INCLUDES: R + R HEADLAMP AND WHEELARCH TRIM	12.0	50.40
NO NUMBER	ALIGN + ADJUST FRONT	10.0	42.00
	Labour Cost Panel / Mechanical Labour Alignment	Hrs WU 2.60 26.0	109.20
	Measuring Work	1.00 10.0	42.00
	Total of Labour		151.20

## **Paint**

Paint Work	SYSTEM AZT Time Basis 10 WU/	
Code	Description	WU Price SGD
	L/F WING NEW PART PAINTING	10.0
	FRONT BUMPER COVER NEW PART PAINT K1R	7.0
	LEFT DOOR REPAIR PAINTING >50%	23.0
	L/FR WHEEL SURFACE PAINT	4.0

### **Paint Material Per Part**

Code	Description	Price SGD
0741	L/F WING NEW PART PAINTING	16.52
0283	FRONT BUMPER COVER NEW PART PAINT K1R	21.29
1481	LEFT DOOR REPAIR PAINTING >50%	26.96
7201	L/FR WHEEL SURFACE PAINT	1.41

Labour Cost - Paint		Hrs	WU	<b>Price SGD</b>
Factor	42.00 SGD/h			
Time Paint			44.0	
Preparation Main Work Metal		1.70	17.0	71.40
Preparation Comp. Work Plastic		0.30	3.0	12.60
Total	10 WU/h	6.40	64.0	268.80

Material Cost - Paint	Price SGD
New Part Painting	16.52
New Part Painting - Plastic K1R	21.29
Repair Painting	26.96
Surface-/Blend Paint	1.41
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	93.28

## **Spare Parts**

u: Used parts

Spare Parts				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
1004	FDR WHEEL GARNISH LI	HFRONT	Supplementary	90.00
1005	FOG LAMP LH	FRONT	Supplementary	275.00
0283	FRONT BUMPER COVER	6400G592	Original	250.00
0391	FRT LWR BUMPER COVER	6400C106	Original	250.00
0841	L/F MUDFLAP	MN186249	Original	80.00
0317	L/F UPP BUMPER BRKT	6400C107	Original	30.00
0741	L/F WING	5220D221	Original	300.00
0351	L/LWR TRIM INSERT	6402A165	Supplementary	44.00
0352	R/LWR TRIM INSERT	6402A166	Supplementary	44.00
f: OEM Parts n: Non-OEM Parts	Savings Subtotal			0.00 1,363.00

Total 1,363.00

### **Extras**

Code	Description	Price SGD
1000	BUMPER CLIPS FRONT	30.00*
1001	FDR INR SHIELD CLIPS FRONT	20.00*
1002	WHEEL TYRE LH FRONT	161.00*
	Total Extras	211.00

## **Final Calculation**

	SGD	SGD
Parts	1,363.00	
Total Parts	·	1,363.00
Labour Time Base 10 WU/h		
Total 26.0 WU X 42.00 SGD/h	109.20	
Alignment Measuring Work	42.00	
Total of Labour		151.20
Total Of Extras		211.00
Paint Work Time Base 10 WU/h		
Labour Cost 64.0 WU X 42.00 SGD/h Material Cost	268.80 93.28	
Total Paint Including Material	93.20	362.08
Repair Cost Excludes GST		2,087.28
GST (+7.00%)		146.11
Repair Cost Included GST		2,233.39
Deductions (Excludes GST)		
Repair Cost Discount (+20.00%)	-417.46	447.46
Total Of Deductions (Excludes GST)		-417.46
Grand Total Excludes GST		1,669.82
GST (+7.00%)		116.89
Grand Total Included GST		1,786.71

#### Comments

\* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

### **Assessment Note**

No assessment notes entered.