

ASS. REC. BY:

REF: 0121

CS/CT121013286/Kqy3

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No. SNM21D207613/C0

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

10 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

30/12/21@4.29pm revert to Cecilia Lee via Merimen. (PENDING COR FROM REPAIRER)

04/01/22@2.34pm 2nd revert to Cecilia Lee via Merimen. (REPAIRER WILLING TO UNDERTAKE THE REPAIR COST AT \$18,000.00 ON LUMP SUM BASIS.)

13/01/22@9.33am Pauline Tham informed G/A at \$12800 via Merimen.

13/01/22@11.56am Informed Henry C/A not more than \$12800 on LS basis & ex: \$1250 by email.

Kenneth confirmed LS \$12800, 10 days (Red \$14700.47, 53%)

Date/Time, File Pass to?

07/03 Typist

Date/Time, File Return to?

2)

Report Format:

Lump Sum / +B.L. (\$

MER-OD

12800

Days Of Repair: 10

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S + RS, SI

Fees

Others

TOTAL

Add Fee:

Site Insp (\$

Interview (\$

Tech Invs (\$

Weekend (\$

Estimate Repair



Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645

Insurer Reference:
Repairer Reference: 045317
Date calculated: 28/12/2021 5:15 PM

Full Report
Registration: SMJ2407R
Printed: 28/12/2021 5:15 PM

Summary Information

Claim Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	26/12/21
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle	
Manufacturer:	BMW
Model:	5 SERIES F10
Sub Model:	520 I
Model Sheet Number:	01 42 05
Registration:	SMJ2407R
VIN number:	
Odometer:	128476

*Not Authorized
1/Rep &
Repairer After Paint
Ex @ 12500*

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

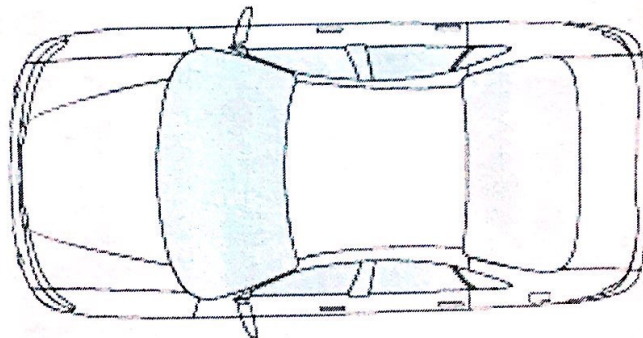

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

		Time Base 12 WU/h	Price = 42.00 SGD/h	
Code	Description		WU	Price SGD
NO NUMBER	ADD/TIME FOR MAIN WORK		2.0	7.00
35 555)	RENEW R/F SIDE PANEL		13.0	45.50
51 64 532	RENEW R/FRONT PANEL SUPPORT (FRT BUMPER SUPPORT REMOVED) INCLUDES: HEADLAMP, AIR GUIDE RADIATOR AND IMPACT ELEMENT REMOVE AND REFIT		15.0	52.50
51 23 621)	R + R BOTH BONNET LOCKS		3.0	10.50
51 23 631	RENEW L/BONNET STRIKER		1.0	3.50
51 23 631	RENEW R/BONNET STRIKER		1.0	3.50
51 11 656	R + R FRONT BUMPER		9.0	31.50
51 11 551	R + R FRONT UPPER BUMPER CARRIER		4.0	14.00
51 11 592	REMOVE/REFIT FRONT BUMPER BAR TRIM (WITH FRONT BUMPER BAR REMOVED)		6.0	21.00
63 10 514	ALIGN FRONT FOG LAMPS		2.0	7.00
61 71 561)	R + R WATER RESERVOIR		4.0	14.00
41 61 510	R + R BONNET		4.0	14.00
41 61 571)	RENEW L/BONNET HINGE		3.0	10.50

Code	Description	WU	Price SGD
41 61 572)	RENEW R/BONNET HINGE	3.0	10.50
51 76 530	R + R REAR BONNET SEAL	1.0	3.50
51 31 511)	RENEW WINDSCREEN	31.0	108.50
	DOES NOT INCLUDE: VEHICLE TEST		
72 12 730	R + R R/HEAD AIRBAG	4.0	14.00
51 71 947	R + R R/SILL PANEL COVER	6.0	21.00
65 77 726)	R + R R/SIDE IMPACT SENSOR	1.0	3.50
51 44 501	R + R HEADLINING	36.0	126.00
	(VEHICLE WITHOUT TILT/SLIDE SUNROOF)		
	INCLUDES: R + R SUN VISORS, FRONT PILLAR		
	TRIMS, CENTRE PILLAR TRIMS AND REAR		
	PILLAR TRIMS		
51 45 529	R + R INSTRUMENT CARRIER TRIM	37.0	129.50
51 45 531)	RENEW INSTRUMENT PANEL COVER	9.0	31.50
51 47 500	R + R FRONT ASSEMBLY PROTECTION	3.0	10.50
31 12 574)	REPLACE RH SUSPENSION ARM	4.0	14.00
	(WITH SUSPENSION STRUT REMOVED)		
36 12 501	R + R R/F WHEEL/TYRE	4.0	14.00
34 11 612	REMOVE/REFIT FRONT BRAKE DISC (N)	2.0	7.00
	(WITH BRAKE CALIPER REMOVED)		
31 31 502	R + R R/F STRUT	6.0	21.00
31 31 501	REPLACE RIGHT FRONT SUSPENSION STRUT	5.0	17.50
	(WITH SUSPENSION STRUT ASSEMBLY REMOVED)		
31 12 574	R + R L/LWR CONTROL ARM	8.0	28.00
31 12 573	R + R R/UPPER CONTROL ARM	8.0	28.00
31 12 626)	R + R L/F TENSION ROD	3.0	10.50
31 35 500)	DETACH + REFIT LEFT FRONT STABILIZER	3.0	10.50
31 35 500)	DETACH + REFIT RIGHT FRONT STABILIZER	3.0	10.50
31 35 501	R + R L/FRT PRESSURE ROD	3.0	10.50
31 35 501	R + R R/FRT PRESSURE ROD	3.0	10.50
32 21 737)	RENEW L + R TIE RODS	8.0	28.00
36 11 500	TYRE PUNCTURE INITIALIZE DISPLAY	1.0	3.50
00 00 556	VEHICLE CHECK	3.0	10.50
	(BY VEHICLE DIAGNOSTIC SYSTEM)		
1006	INSTRUMENT PANEL DASHBOARD		350.00* 28a
1007	HEADLINING COVER HEADLINING		350.00* 28a
Labour Cost		Hrs	WU
Panel / Mechanical Labour		21.80	262.0
Fixed Rate			917.00
			700.00
Total of Labour			1,617.00

Paint

Paint Work

Code	Description - MF	Time Basis 12 WU/h	
		WU	Price SGD
99 68 529	FRONT BUMPER PAINTING STAGE 2	16.0	56.00
LE 0634	R/WASHER NOZZLE TRIM PAINTING STAGE 2	2.0	7.00
99 35 519	R/F WING PAINTING STAGE 2	8.0	28.00
99 99 000	ADDITIONAL TIME FOR ONE MAIN WORK INCLUDES: MIX COLOUR AND SPRAY COLOUR SAMPLE	21.0	73.50

Total Paint

Hrs 3.90 WU 47.0 Price SGD 164.50

Material Cost - Paint
New Part Painting
Material-constant Metal
Total

Price SGD
83.85
13.47
97.32

Spare Parts

				prices as at 2021-12-15
Code	Description	Part Number	Part Source	Price SGD
0283	FRONT BUMPER COVER	51 11 7 285 960	Original	Bz 950.00 ✓
0306	R/AIR INTAKE TRIM	51 11 7 231 860	Original	30.00 ?
0308	R/BUMPER AIR GRILLE	51 11 7 200 700	Original	Sm 55.00 X
0326	R/F AIR DUCT	51 74 7 200 790	Original	25.00 ?
0333	FRT UPP BUMPER SUPP	51 11 7 200 705	Original	0.00
0336	FRT UPP BUMPER SUPP	SEE GUIDE NO. 0333	Original	250.00
D40	FRT UPP IMPACT DAMP	51 11 7 200 707	Original	Sm 55.00 X
0415	L/F GRILLE	51 13 7 203 649	Original	Sm 110.00 ✓
0416	R/F GRILLE	51 13 7 203 650	Original	Sm 110.00 ✓
0431	GRILLE BADGE	51 14 7 057 794	Original	Sm 60.00 ✓
0475	L/BONNET HINGE	41 61 7 207 199	Original	Sm 65.00 X
0476	R/BONNET HINGE	41 61 7 207 200	Original	Sm 65.00 X
0491	L/UPPER LOCK	51 23 7 183 763	Original	Sm 60.00 X
0492	R/UPPER LOCK	51 23 7 183 764	Original	Sm 60.00 X
0503	L/BONNET LOCK	51 23 7 206 453	Original	Sm 150.00 X
0504	R/BONNET LOCK	51 23 7 183 762	Original	Sm 150.00 X
0562	RIGHT HEADLAMP ASSY	63 11 7 203 242	Original	CMT 1,600.00 ✓
0594	R/F HEADLAMP BRACKET	41 35 7 207 210	Original	180.00 ?
0634	R/WASHER NOZZLE TRIM	51 11 7 246 870	Original	Sm 40.00 X
0638	R/F FOG LAMP	63 17 7 216 886	Original	Bz 180.00 ?
0742	R/F WING	41 35 5 A03 262	Original	Bz 880.00 ✓
0748	R/F SUPPORT	51 76 7 019 804	Original	220.00 ?
0842	R/F W-HOUSE CVR FRT	51 71 7 186 728	Original	D/1 65.00 ✓
0844	R/F W-HOUSE RR COVER	51 71 7 186 724	Original	D/1 65.00 ✓
88	R/F PANEL SUPPORT	51 64 7 200 794	Original	90.00 ?
1326	COWL PANEL INSUL	51 48 9 162 739		86.65 ?
1401	WINDSCREEN	51 31 4 898 963	Original	CMT 650.00 ✓
1411	WINDSCREEN BOND KIT	83 19 2 289 287	Original	0.00
1414	CLEANER R1 FRT SCRIN	83 19 2 211 217	Original	0.00
1417	INFO LABEL AIRBAG	71 21 2 122 334	Original	0.00
1419	WINDSCREEN BUFFER	51 31 7 288 462	Original	0.00
1423	FRONT SCREEN COVER	51 31 7 203 121	Original	55.00 ?
1436	FLUID RESERVOIR	61 66 7 269 668	Original	Sm 100.00 X
4325	PASSENGER AIRBAG	72 12 9 230 399	Original	Brm 1,590.00 ✓
4331	INSTRUMENT PANEL	51 45 9 277 289	Original	Brm 3,800.00 ✓
4616	R/HEAD AIRBAG	72 12 9 143 418	Original	Brm 790.00 ✓
4622	R/B-PILLAR SENSOR	65 77 9 224 177	Original	Sm 125.00 ✓
4942	R/A-PILLAR COVER	51 43 9 173 442	Original	60.00 ?
4952	R/UPP B PILLAR TRIM	51 43 7 358 986	Original	65.00 ?
4957	HEADLINING	51 44 9 173 445	Original	De form 1,360.00 ✓
7050	R/UPPER CONTROL ARM	31 12 6 775 967	Original	Bz 380.00 ✓

Code	Description	Part Number	Part Source	Price SGD
7053	L/F TRACK CONT ARM	31 12 6 794 203	Original	360.00 X
7054	R/F TRACK CONT ARM	31 12 6 794 204	Original	360.00 —
7071	L/F TENSION ROD	31 12 6 775 971	Original	350.00 X
7072	R/F TENSION ROD	31 12 6 775 972	Original	350.00 ✓
7078	R/F CPL SPRING STRUT	31 31 6 789 364	Original	350.00 —
7082	R/F STEERING KNUCKLE	31 21 4 082 760	Original	480.00 —
7092	R/F STRUT BEARING	31 30 6 795 082	Original	95.00 —
7124	R/F WHEEL HUB	31 20 6 865 152	Original	380.00 —
7202	R/F WHEEL	36 11 6 780 720	Original	800.00 —
7228	R/FR TYRE	225/55 R 17 .. W	Original	550.00 50% ✓
7261	FRONT STABILISER	31 35 6 777 933	Original	330.00 ?
7277	L/SWING SUPPORT	31 35 6 777 319	Original	70.00 X
7278	R/SWING SUPPORT	31 35 6 777 319	Original	70.00 ?
7309	L/TIE ROD	32 10 6 784 716	Original	245.00 X
7310	R/TIE ROD	32 10 6 784 719	Original	245.00 ?
7423	CIRCUIT CENTRE	61 31 9 354 047	Original	980.00 ?
7445	DRIVER AIRBAG	32 30 6 783 825	Original	1,930.00 ✓
1000	FRT SEAT BEAT RH	FRT SEAT BELT	Original	510.00 X
1001	FRT SEAT BELT LH	FRT SEAT BELT	Original	510.00 X
1002	REAR SEAT BELT RH	REAR SEAT BELT	Original	320.00 X
1003	REAR SEAT BELT LH	REAR SEAT BELT	Original	320.00 X
Savings				0.00
Subtotal				24,181.65
Total				24,181.65

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Extras

Code	Description	Price SGD
1004	AIR BAG ECU CPL AIR BAG ECU	1,120.00* ✓
1005	SEAT BELT A/BAG ECU SEAT BELT	320.00* X
Total Extras		1,440.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	24,181.65	
		24,181.65
Labour Time Base 12 WU/h		
Total 262.0 WU X 42.00 SGD/h		
Fixed Rate	917.00	
Total of Labour	700.00	
		1,617.00
Total Of Extras		
		1,440.00
Paint Work Time Base 12 WU/h		
Labour Cost 47.0 WU X 42.00 SGD/h		
Material Cost	164.50	
Total Paint Including Material	97.32	
		261.82
Repair Cost Excludes GST		27,500.47
GST (+7.0%)		1,925.03
Repair Cost Included GST		29,425.50

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	27/12/2021 18:34 (SGT)
Date of Accident	26/12/2021 11:30 (SGT)
Exact Location of Accident	Springside Cres, Singapore
Additional Location Information	BESIDE 15 SPRINGSIDE CRESCENT
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMJ2407R
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	KALIMUTHU GHOPINATH
NRIC No	SXXXX666I
Email Address	ghopina@yahoo.com.sg
Mobile Phone No	(Phone) +65-81234854
Alternative Phone No	(Office) +65-81234854

VEHICLE PARTICULARS

Manufacturer	BMW
Model	520i
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1998

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage	Comprehensive
Fleet Policy	No
Policy Number	DMPCSNW00029022102
Cover Note Number	-

DRIVER

Name of Driver	RAVINDIRA GHOPINATH
NRIC No	SXXXX804A

ARF/COE Rebate for Registered Vehicle

Owner Particulars

Owner ID Type:

Owner ID:

Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

QP Paid:

COE Rebate Amount:

Total Rebate Amount:

The information contained herein is correct as at 28 Dec 2021

Singapore NRIC

6661

SMJ2407R

Yes

03 Jan 2022

B.M.W.

520I 2.0L AT D/AB 2WD 4DR GAS/D NAV

Black

2013

A4590407N20B20B

WBAXG12020DX52592

135.0 kW (181 bhp)

\$42,734.00

28 Feb 2013

28 Feb 2013

1

\$37,734.00

Yes

27 Feb 2023

\$20,753.00

27 Feb 2023

E - Open Category

10

\$97,000.00

\$10,415.00

\$31,168.00

OK