

ASS. REC. BY: Tauph

REF: CS/TM/21013287/T16f3

**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_  
Estimated Cost: \_\_\_\_\_  
OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
To Inspect Vehicle No: \_\_\_\_\_  
at Workshop m/s \_\_\_\_\_  
of \_\_\_\_\_  
Insured: \_\_\_\_\_  
Policy No. \_\_\_\_\_  
Claims No. \_\_\_\_\_  
Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
(Client's Record)  
Make of Veh: \_\_\_\_\_

Veh No: SHB4811U Yr Regn: 2017, Sep  
Type: M.Car / M.Cycle / Bus / Van / Lorry /  Taxi / Prime Mover /  
Truck / Trailer or \_\_\_\_\_  
Make: toyota prius c.c. 1798  
Colour: yellow A/C: Insured / Std / NI / NA  
Sp. Reading: 529629 T/Radio: Insured / Std / NI / NA  
Eng/No: \_\_\_\_\_  
C/No: J TDKB3 FU X03563330  
Gen. Cond: Good / Fair / Poor / Burnt  
Steering: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_  
Brake: Inorder / Jammed / Leaked / Burnt or \_\_\_\_\_  
Modi: Nil / S/Rim / STD A/Rim or \_\_\_\_\_  
Tyre Size: F: 195/65R15  
R: 21

(Policy Condition)  
Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or Westlake  
Front R/Bal. 6 mm Rear R/Bal. 6 mm  
L/Bal. 6 mm L/Bal. 6 mm  
D.O.A. \_\_\_\_\_ D.O.I. 29/12/21  
Survey held at Comfort Logon  
Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or  
Frt of S

Bal. or Market Value: \_\_\_\_\_  
IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No  
GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
Est. Repairs: \_\_\_\_\_ days Res.: Yes or No  
Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No  
CA / REV / REP. / 24 HRS  
Date: \_\_\_\_\_ Person Contacted: Amey Vehicle: IN / OUT

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction

Date/Time, File Pass to?  : Preli. Report  
 : Final Report  
1) \_\_\_\_\_  
Date/Time, File Return to?  
2) \_\_\_\_\_  
Rep. Format: \_\_\_\_\_  
Lump Sum / I.B. (\$) \_\_\_\_\_

Days Of Repair: \_\_\_\_\_  
Resurvey No. of Trip: \_\_\_\_\_  
Add Fee:  : Site Insp (\$ \_\_\_\_\_)  
 : Interview (\$ \_\_\_\_\_)  
 : Tech. Invs (\$ \_\_\_\_\_)  
 : Weekend (\$ \_\_\_\_\_)

Survey Fee: \_\_\_\_\_  
Transportation: \_\_\_\_\_  
S + RS. \$ \_\_\_\_\_  
Photos \_\_\_\_\_  
Others \_\_\_\_\_  
TOTAL \_\_\_\_\_

# ComfortDelGro Engineering Pte Ltd (Co.Reg.No:199506048W)

59 Loyang Drive  
Singapore 508969  
Tel: 6214 8300

**TP INSURER: Tokio Marine Insurance Singapore Ltd (HQ)**  
**CCPL**

Singapore

## PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:		Date of Loss:	28/12/2021
Vehicle Reg. No.:	<b>SHB4811U</b>	Driveable?	YES
Party At Fault:	UNKNOWN		
Make/Model:	TOYOTA PRIUS HYBRID, 1.8 CVT TAXI (A)	Vehicle Reg. Date:	13/09/2017
Vehicle Colour:	YELLOW	Gen Condition:	GOOD
Engine No:	2ZRS061460	Chassis No:	JTDKB3FUX03563330
Odometer:	529629 KM		
Paint Type:			
List Item Discount:	25.00 %		
Total Loss?	<b>NO</b>		
Est. Duration of Repair (day)	4		
Present Location:	COMFORTDELGRO ENGINEERING PTE LTD (LOYANG)		

<b>COST OF CLAIMS</b>	<b>Amount</b>
Parts	5,221.26
Miscellaneous Items	11.00
Labour	1,595.00
Paintwork Labour	0.00
Towing	0.00
<b>Gross Total (S\$)</b>	<b>6,827.26</b>
<b>+ GST 7.00% (S\$)</b>	<b>477.91</b>
<b>Nett Amount (S\$)</b>	<b>7,305.17</b>

**This claim is handled by: CHIANG LIAT CHOON**

Generated using Merimen e-Claims Internet Estimation & Adjusting System

**REPAIR DETAILS**

**Reference**

**Part Source:** MRM-SG Version: 1.0 (Last Synchronised: 29 Dec 2021)  
**Parts:** 144 TOYOTA PRIUS HYBRID 1.8 CVT TAXI (A) (Catalogue:Merimen Singapore 1.0)  
**Labour:** Repairer's (Price-denominated Standard List)  
**Print Code:** ComfortDelGro Engineering Pte Ltd/SHB4811U/29/12/2021 08:39  
**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page  
**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk \*.

**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRONT BUMPER	25.00	0.00	<i>M</i> *499.90 FL
2	1		*FRONT BUMPER BRACKET LH/RH	25.00	0.00	? <del>82.30</del> *82.30 FL <i>LHX</i>
3	1		*FRONT FENDER RH	25.00	0.00	<i>BT</i> *945.30 FL
4	1		*FRONT FENDER SHIELD RH	25.00	0.00	<i>M</i> *198.50 FL
5	1		*FRONT FENDER EMBLEM RH	25.00	0.00	<i>el</i> *86.50 FL
6	1		*FRONT BUMPER RETAINER RH	25.00	0.00	<i>MS</i> *86.30 FL
7	1		*FRONT HEAD LAMP RH	25.00	0.00	<i>cut</i> *2,735.28 FL
8	1		*FRONT DAY LIGHT RH	25.00	0.00	<i>ant</i> *920.00 FL
9	1		*FRONT WHEEL COVER RH	25.00	0.00	<i>ant</i> *346.40 FL
10	1		*FRONT HEAD LAMP PANEL RH	25.00	0.00	X *240.10 FL
11	1		*FRONT HEAD LAMP MOUNTING RH	25.00	0.00	? *25.50 FL
12	1		*FRONT SUPPORT RADIATOR RH	25.00	0.00	X *83.50 FL
13	1		*FRONT SUPPORT RADIATOR LOWER	25.00	0.00	X *225.40 FL
14	1		*FRONT WIPER SPARE TANK ASSY	25.00	0.00	X *486.70 FL
<b>Sub Total (S\$)</b>						<b>6,961.68</b>
- List Item Discount on L Items (S\$)						1,740.42
<b>Total Parts (S\$)</b>						<b>5,221.26</b>

F=Franchise part. L=ListItemDisc.

ComfortDelGro Engineering Pte Ltd/SHB4811U/29/12/2021 08:39. Not valid without Reference section.  
 Generated using Merimen e-Claims IEAS

### Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
<b>Miscellaneous Items</b>			
1	1	OD/TP Case (Insurer)	11.00
<b>Sub Total (S\$)</b>			<b>11.00</b>

### Estimates on Labour

No	Particulars	Lab.Type	Amount
<b>Labour Items</b>			
1	PANEL BEATING	New	525 875.00
2	SPRAY PAINTING	New	500 600.00
3	CHECK WIRING	New	30 60.00
4	RESET WHEEL ALIGNMENT	New	✓ 60.00
<b>Gross Labour Cost (S\$)</b>			<b>1,595.00</b>

ComfortDelGro Engineering Pte Ltd/SHB4811U/29/12/2021 08:39. Not valid without Reference section.  
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

*Tanpin 72485749  
 'w' 29/12/21 @ 430  
 4/5 Resurvey after repair  
 Tanpin & Whitford  
 2-3 days.*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date:

Team: ARC Repair TP(CFSO)1

**JOB CARD** Sales Order: 4156883

JC NO:305499536


CUSTOMER  
R/MS CITYCAB PTE LTD  
CUSTOMER NO 7010070  
ADDRESS 383 SIN MING DRIVE  
Singapore SINGAPORE 575717  
TEL (R) 65551188 (O)  
(P)  
DISCOUNT CARD NO.

REGN NO: SHB4811U	MILEAGE
MAKE: TOYOTA	FUEL E.....1/2.....F
MODEL PRIUS HYBRID(G4)	DATE/TIME IN 28.12.2021 13:00
YR OF MANU 13.09.2017	TARGET DATE
CHASSIS CODE JTDKB3FUX03563330	COMPLETION DATE/TIME:

JOB DESCRIPTION

Accident Date: 28.12.2021  
NATURE: 3P 28.12.2021

S/NO	LABOR CODE	DESCRIPTION
------	------------	-------------

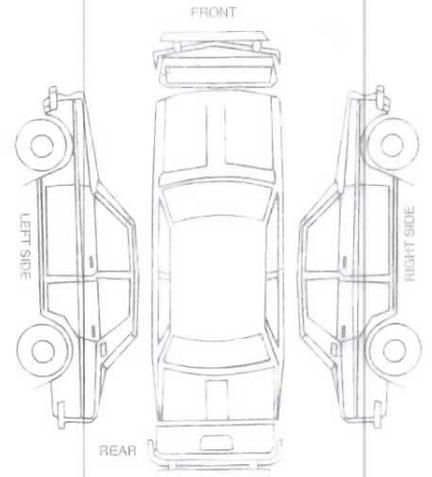

CHECKED & PASSED OUT BY: \_\_\_\_\_

\_\_\_\_\_  
SERVICE ADVISOR

\_\_\_\_\_  
CUSTOMER'S SIGNATURE

Acknowledgement Slip

Exit Pass

Plate No.: SHB4811U CHIANG

Vehicle No.: SHB4811U

Signature of Service Advisor

Signature/Date

Name of Service Advisor

Date

Vehicle returned to Service Reception upon collection

To be kept by Security Guard