

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Denise

Supplementary Estimate-1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/1071/2021/GW

26-Jan-22

CHANG

1 of 1


SLT 7852 P

AUDI A4 1.4 TFSI

Quantity	Description	Unit Price	Amount
<u>Labours</u>			
1	TO DISLODGE AND REINSTALL FRONT LOCK CARRIER TO FACILITATE RENEWAL OF FRONT REINFORCEMENT BEAM BRACKET.	\$ 780.00	✓ <i>SL/S</i>
<u>Parts</u>			
1	BONNET BOWDEN CABLE <i>Damaged</i>	\$ 64.00	✓ <i>SL/S</i>
GRAND TOTAL			\$ 844.00

For Premium Automobiles Pte Ltd

Adrian Ling
SL/S Resigned

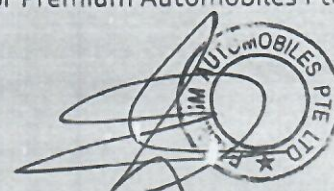

Authorised Signature

* Add 3 days for additional repairs of bonnet and partial removal of lock carrier to facilitate replacement of bumper reinforcement.

PREMIUM AUTOMOBILES

55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLT 2852 P

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	S/N \$ 360.00	X
2	TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE	S/N \$ 700.00	X
3	TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM VACUUM AND REGAS	S/N \$ 1,400.00	X
4	TO DISMANTLE AND RENEW FRONT BUMPER AND BOTH HEADLIGHT (TO REPAIR BONNET) AND BOTH FENDERS. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 4,500.00	S
5	TO RESPRAY FRONT BUMPER, BOTH FRONT FENDER AND BONNET.	\$ 3,500.00	S
6	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 192.00	✓
TOTAL LABOUR CHARGES		: \$ 10,652.00	

sls
+ 250
+ 275

sls.


+ 550

+ 3 day

Car-in 25/1/22 wip: 61131

PREMIUM AUTOMOBILES

Kiam /



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

AJF-Adrian

- 3 days

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. 5LT 7852 P

DAMAGED PARTS & PRICES

S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER <i>ok</i>	1	\$ 2,111.00	✓
2	FRONT BUMPER FIXING PARTS <i>new</i>	1	TBC	+
3	FRONT BUMPER SECURING STRIP	2	\$ 71.00	?
4	FRONT BUMPER GRILLE - CENTER <i>ok</i>	1	\$ 196.00	✓
5	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>new</i>	1	\$ 210.00	+
6	FRONT BUMPER AIR GUIDE - LH / RH <i>new</i>	2	\$ 126.00	+
7	RADIATOR GRILLE <i>ok</i>	1	\$ 1,152.00	✓
8	FRONT AIR GUIDE GRILLE - LH / RH <i>new</i>	2	\$ 270.00	+
9	FRONT FOAM FILLER PIECE <i>ok</i>	1	\$ 124.00	✓
10	FRONT BUMPER REINFORCEMENT BEAM <i>ok</i>	1	\$ 845.00	✓
11	FRONT BUMPER GUIDE SECTION - LH <i>new</i>	1	\$ 36.00	+
12	FRONT BUMPER GUIDE SECTION - RH <i>new</i>	1	\$ 38.00	+
13	FRONT REINFORCEMENT BEAM BRACKET - LH / RH <i>new</i>	2	\$ 456.00	+
14	FRONT BUMPER COVER <i>ok</i>	1	\$ 127.00	✓
15	SIGN CAUTION STICKER <i>new</i>	1	\$ 14.00	✓
16	AIR CONDITIONER STICKER <i>new</i>	1	\$ 8.00	✓
17	FRONT LOCK CARRIER BRACKET <i>ok</i>	1	\$ 137.00	✓
18	FRONT LOCK CARRIER SUPPORT - LH / RH <i>ok</i>	2	\$ 58.00	✓
19	FRONT HORN - LH / RH <i>new</i>	2	\$ 252.00	+
20	FRONT HORN BRACKET - LH / RH <i>new</i>	2	\$ 58.00	+
SUB TOTAL SPARE PARTS			\$ 6,289.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408599

TEL: 6366 2323 FAX: 6341 1183

EMAIL: NORA.KHAIR@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLT 7852 P

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	LED HEADLIGHT - LH / RH <i>new</i>	2 \$	15,386.00 +	
22	LIFT CYLINDER FOR HEADLIGHT WASHER SYSTEM - LH	1 \$	210.00 +	
23	LIFT CYLINDER FOR HEADLIGHT WASHER SYSTEM - RH	1 \$	210.00 +	
24	CORRUGATED PIPE FOR HEADLIGHT WASHER SYSTEM	1 \$	93.00 +	
25	FRONT LOCK CARRIER <i>new</i>	1 \$	1,016.00 +	
26	RADIATOR SUPPORT BRACKET - LH / RH <i>new</i>	2 \$	76.00 ✓	
27	A/C CONDENSER <i>new</i>	1 \$	622.00 +	
28	A/C CONDENSER <i>temperature sensor</i> <i>new</i>	1 \$	19.00 ✓	<i>sls</i>
29	RADIATOR <i>new</i>	1 \$	555.00 +	
30	ADDITIONAL RADIATOR <i>new</i>	1 \$	511.00 +	
31	RADIATOR COOLANT <i>new</i>	6 \$	266.00 +	
32	RADIATOR AIR GUIDE LH / RH <i>torn</i>	2 \$	56.00 ✓	<i>sls</i>
33	RADIATOR INNER AIR GUIDE LH / RH <i>torn</i>	2 \$	24.00 ✓	<i>sls</i>
34	RADIATOR LOWER AIR GUIDE	1 \$	22.00 ?	
35	RADIATOR CENTRE AIR GUIDE	1 \$	16.00 ?	
36	FRONT NO PLATE <i>new</i>	S/N \$	60.00 ✓	
37	SUNDRIES	\$	350.00 ?	
TOTAL SPARE PARTS		:	\$ 25,881.00	
TOTAL LABOUR CHARGES		:	\$ 10,652.00	
GRAND TOTAL		:	\$ 36,533.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.