

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CC4/GRB22000095/Ues3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKX 5485Uat Workshop m/s Sme

of _____

Insured: SLQ 4325M

Policy No. _____

Claims No. _____

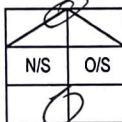
Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: \$ 49

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 11 days Res.: Yes or NoLump Sum: 15 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: 27AS35168Veh No: SKX 5485UYr Regn: 18/12/15Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /Truck / Trailer or CA /Make: Suzuki SX 45-CROSS c.c. 1580Colour Red

A/C: Insured / Std / NI / NA

Sp. Reading 91147

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: TSMJVB22500248465Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / SRim / STD A/Rim orTyre Size: F: 215 / 45 R14

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 3.1.12/21D.O.I. 4.1.12/22

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear & Frt.

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction Rep 10k.NOTE \$13832 After 13/1/22headly list \$3146.15no second hand parts use cost priceNote new parts replacement.23/1/22 Repair sum \$13,800 informed Gary limited Repair

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐ : Site Insp (\$ _____)) S + RS \$ _____☐ : Interview (\$ _____)

) Photos

☐ : Tech. Invs (\$ _____)

) Others

☐ : Weekend (\$ _____)

)

Report Format : _____

Lump Sum / I.B.I: (\$ _____)

TOTAL

Registration \$ 13,800 not Adjusted
LKK
wrens
4/1/21

SME MOTOR PTE LTD

1 Kaki Bukit Ave 6 #02-15, AutoBay @ Kaki Bukit, Singapore 417883

Tel: 6747 6106 (6 Lines) Fax: 6744 2368

Email: service@smemotor.com.sg Website: www.smemotor.com.sg

Co. & GST Reg. No: 201119451E

4/3
Take photo. After repair:
Tel: 62563561
11 days

TP INSURER:

NIL

India International Insurance Pte Ltd (HQ)

Singapore

Claimant Insurer:

NTUC Income Insurance Co-operative Ltd

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	22/III/TP-001(01)
Policy No:		Date of Loss:	31/12/2021
Vehicle Reg. No.:	SKX5485U	Driveable?	
Party At Fault:	UNKNOWN		
Driver (TP):	YAP LI YUN		
Make/Model:	SUZUKI SX4, 1.6 (A)	Vehicle Reg. Date:	18/12/2015
Vehicle Colour:	RED		
Engine No:	M16A1921764	Chassis No:	TSMJYB22S00218465
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	12		
Remarks:	VEHICLE IS IN, KINDLY ARRANGE FOR SURVEY.		
Present Location:	SME MOTOR PTE LTD (KAKI BUKIT)		

COST OF CLAIMS

	Amount
Parts	13,829.20
Miscellaneous Items	486.00
Labour	3,420.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$)	17,735.20
+ GST 7.00% (\$)	1,241.46
Nett Amount (\$)	18,976.66

This claim is handled by: WEN YING

Generated using Merimen e-Claims Internet Estimation & Adjusting System

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 04 Jan 2022)
Parts: 144 SUZUKI SX4 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SKX5485U)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*REAR GATE	0.00	0.00	22 *600.00 F
2	1		*REAR GATE SUZUKI PLATE	0.00	0.00	22 *25.00 F
3	1		*REAR GATE S-CROSS SX4 PLATE	0.00	0.00	22 *27.00 F
4	1		*REAR GATE LOCK	0.00	0.00	22 *195.00 F
5	1		*REAR GATE INNER RUBBER	0.00	0.00	22 *125.00 F
6	1		*REAR BUMPER (TOP)	0.00	0.00	22 *330.00 F
7	1		*REAR BUMPER (LOWER)	0.00	0.00	22 *360.00 F
8	2		*REAR BUMPER RETAINER	0.00	0.00	22 *40.00 F
9	10		*REAR BUMPER CLIPS	0.00	0.00	22 *30.00 F
10	1		*REAR BUMPER REINFORCEMENT	0.00	0.00	22 *195.00 F
11	1		*REAR END PANEL	0.00	0.00	22 *290.00 F
12	1		*REAR END PANEL TOP GARNISH	0.00	0.00	22 *95.00 F
13	6		*TOP GARNISH CLIPS	0.00	0.00	22 *18.00 F
14	1		*FRT BONNET	0.00	0.00	22 *550.00 F
15	1		*FRT BONNET INSULATOR	0.00	0.00	22 *150.00 F
16	8		*INSULATOR CLIPS	0.00	0.00	22 *24.00 F
17	1		*FRT BONNET LOCK	0.00	0.00	22 *45.00 F
18	1		*FRT GRILLE	0.00	0.00	22 *195.00 F
19	1		*GRILLE CENTRE LOGO	0.00	0.00	22 *25.00 F
20	1		*GRILLE OUTER MOULDING (NO STOCK)	0.00	0.00	22 *195.00 F
21	4		*GRILLE CLIPS	0.00	0.00	22 *12.00 F
22	1		*FRT BUMPER (TOP) AGENT	0.00	0.00	22 *420.00 F
23	2		*FRT BUMPER RETAINER	0.00	0.00	22 *36.00 F
24	10		*FRT BUMPER CLIPS	0.00	0.00	22 *30.00 F
25	1		*FRT BUMPER (LOWER) AGENT	0.00	0.00	22 *360.00 F
26	1		*FRT BUMPER LOWER SPOILER	0.00	0.00	22 *125.00 F
27	1		*FRT BUMPER REINFORCEMENT	0.00	0.00	22 *265.00 F
28	2		*HEADLAMP	0.00	0.00	22 *5,500.00 F
29	1		*HEADLAMP SUPPORT PANEL ASSY	0.00	0.00	22 *550.00 F
30	1		*AIRCON CONDENSER (NO STOCK)	0.00	0.00	22 *800.00 F
31	1		*RADIATOR	0.00	0.00	22 *530.00 F
32	1		*RADIATOR MOTOR ASSY	0.00	0.00	22 *430.00 F

F=Franchise part.

Sub Total (\$\$) 12,572.00
+ Margin on L,N Items 10.00% (\$\$) 1,257.20
Total Parts (\$\$) 13,829.20

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

cost plus 102

11934
12284
102
P-13523-4
S.N-316
L-2720
T6859.4
152
14075

REPAIR DETAILS

Reference

Part Source: MRM-SG

Version: 1.0 (Last Synchronised: 18 Jan 2022)

Parts: 144

SUZUKI SX4 1.6 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's

(Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SKX5485U)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRT BUMPER (LOWER) <i>change price</i>	0.00	0.00	*680.00 F X
			AGENT (NO STOCK)			
2	1		*FRT BUMPER INNER SPONGE	0.00	0.00	*160.00 F
3	2		*AIRCON SIDE DEFLECTOR	0.00	0.00	*90.00 F
4	2		*REAR END PANEL AIR DUCT	0.00	0.00	*110.00 F
Sub Total (S\$)						1,040.00
+ Margin on L,N Items 10.00% (S\$)						104.00
Total Parts (S\$)						1,144.00

F=Franchise part.

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No Qty Particulars

Amount

Miscellaneous Items

1	1	FRT NUMBER PLATE	40.00	✓
2	1	RADIATOR COOLANT	25.00	✓
3	1	REAR WINDSCREEN GUM	60.00	✓
4	1	REVERSE SENSOR (4 PCS)	350.00	✓
5	1	OD/TP Case (Insurer)	11.00	✓
Sub Total (\$\$)			486.00	

Estimates on Labour

No Particulars

Lab.Type

Amount

Labour Items

1	WIRE CHECKING	New	30.00	✓
2	REMOVE & REFIX REAR WINDSCREEN	New	120.00	✓
3	REMOVE & REFIX REAR BOOT UPHOLSTERY TO FACILITATE REPAIR	New	150.00	80
4	CAVITY PROTECTION ON ALL AFFECTED AREAS	New	120.00	80
5	REMOVE & REFIX AIRCON AND GAS	New	100.00	✓
6	LABOUR CHARGE	New	1,500.00	1100
7	SPRAY PAINTING	New	1,400.00	1200
Gross Labour Cost (\$\$)			3,420.00	

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

2720