



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2204691

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 29/07/2022
Reference CC6/CTI22000219/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJJ 6656Y
Insured Veh. YN 2848M
Claim No. SNM22D200124/C02
Policy No. DMCVSNA00049832100
Accident Date 05/01/2022
Inspection Date 06/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref:	CC6/CTI22000219/Apa3q2
3 ANSON ROAD #16-00			Date:	29/07/2022
SPRINGLEAF TOWERSINGAPORE 079909			Code:	CTI
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YN 2848M	Veh. Inspected	SJJ 6656Y	
Policy No.	DMCVSNA00049832100	Coverage (\$)	0.00	
Claim No.	SNM22D200124/C02	Excess (\$)	0.00	
Assign From		Assign Date	06/01/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA VIOS	c.c	1497	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	MR053HY9305081104	Colour	BLACK	
Odometer	148921 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/45 R16	KUMHO	6 mm	
L/H Front Tyre	205/45 R16	KUMHO	6 mm	
R/H Rear Tyre	205/45 R16	KUMHO	6 mm	
L/H Rear Tyre	205/45 R16	KUMHO	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION.				
DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/01/2022	Inspection Date	06/01/2022	
Survey held at	MG SOLUTION PTE LTD 23 KAKI BUKIT AVE 4 (SOUTH WING) #02-03B VICOM INSPECTION CENTRE, SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJJ 6656Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOT LID	BUCKLED	890.20	645.00
1	BOOT LID LOGO	NECESSARY	69.00	69.00
1	BOOT LID TOP LOCK	NOT NECESSARY	135.00	-
2	BOOT LID HINGE @\$213.00	NOT NECESSARY	426.00	-
1	REAR BUMPER	DEFORMED	560.20	560.20
2	REAR BUMPER SIDE RETAINER (FRONT) @\$115.00	NOT NECESSARY	230.00	-
2	REAR BUMPER SIDE RETAINER (REAR) @\$65.00	O/S DAMAGED	130.00	65.00
1	REAR BUMPER REFLECTOR RH	CRACKED	90.00	90.00
1	TAIL LAMP RH	CRACKED	534.00	285.00
1	TAIL LAMP INNER SEAL RH	NECESSARY	55.30	30.00
1	TAIL LAMP PANEL RH	TO REPAIR SEE LABOUR	268.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	712.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	135.00	-
	LESS 25% DISCOUNT		-1,058.68	-436.05
			3,176.02	1,308.15
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-
1	BOOT LID SPOILER (SN)	CRACKED	1,600.00	800.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	20.00	20.00
1	REAR BUMPER LOWER LID (SN)	CRACKED	1,000.00	600.00
1	REAR END PANEL INSULATION SEAL (SN)	NOT NECESSARY	100.00	-
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	20.00	-
1	REVERSE SENSOR (SN)	NOT NECESSARY	220.00	-
			3,010.00	1,420.00
	<u>LABOUR</u>			
	TO PANEL BEAT ,WELD ,CUT ,KNOCK, GRAZA ADJUST REPLACE NEW PARTS.INCLUSIVE OF THE REPAIR OF TAIL LAMP PANEL RH AND REAR END PANEL .		1,600.00	700.00
	TO PUTTY ,SPRAY PAINT ,POLISH WAX ADJACENT PANELS.		1,600.00	1,000.00

Report Ref No. CC6/CTI22000219/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY TUFF COAT AND RUST PROOF ADJACENT PANELS.		250.00	60.00
	WIRING BULB CHECKING.		120.00	30.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		120.00	50.00
	TRANSFER BOOT LID MECHANISM .		150.00	60.00
			3,840.00	1,900.00
GRAND TOTAL			10,026.02	4,628.15
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,700.00

Report Ref No. CC6/CTI22000219/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 6656Y

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

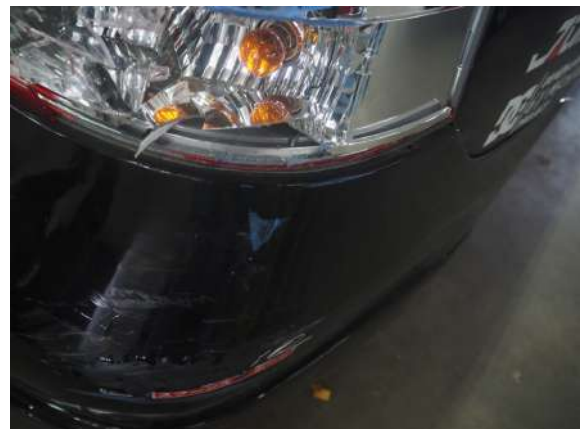



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 6656Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 6656Y

RE-INSPECTION

