

ASS. REC. BY:

REF:

C12 / 22000301/ke

6

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

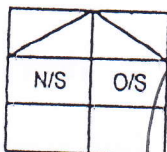

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

07

days

Res.: Yes or No

Lum Sum:

1-B-1%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S110 9991P

Yr Regn:

01, 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Toy Prius

c.c

1798

Colour

m.p. white / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

71508

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB3FU303093514

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD / Rlm or

Tyre Size:

F: Firestone 195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

S

mm

R/Bal.

3

mm

L/Bal.

S

mm

L/Bal.

3

mm

D.O.A.

6/1/22

D.O.I.

7/1/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S Rear body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

/ To submit report to insurance

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

) S + RS. \$

) Fuel

) Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Not Authored
Resurvey B4 paint

Trans-cab Auto Services Pte Ltd

AAD2201-031

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD9991P

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

07 JAN 2022

SHD9991P

JTDKB3FU303093514

TOYOTA

PRIUS **GEN 4**

06/01/2022

China-

28/01/2021

PART

LIST

1	PANEL SUB-ASSY, FRONT DOOR, RH	\$	R	1,300.70	X
1	LOCK ASSY, FRONT DOOR W/MOTOR, RH	\$	R	603.20	
1	MOULDING, FRONT DOOR WINDOW FRAME, FRONT RH	\$	Sn	38.60	
1	FRAME SUB-ASSY, FRONT DOOR OUTSIDE HANDLE, RH	\$	Sn	193.50	
1	HANDLE ASSY, FRONT DOOR, OUTSIDE RH	\$	Sn	390.60	
1	MOTOR ASSY, POWER WINDOW REGULATOR, RH	\$	Sn	926.00	
1	WEATHERSTRIP, FRONT DOOR OPENING TRIM, RH	\$	Sn	321.10	
1	HINGE ASSY, FRONT DOOR, LOWER RH	\$	R	110.60	
1	HINGE ASSY, FRONT DOOR, UPPER RH	\$	R	97.50	
1	REGULATOR SUB-ASSY, FRONT DOOR WINDOW, RH	\$	Sn	238.30	
1	TAPE, BLACK OUT, NO.2 FRT RH	\$	Rn	43.50	
1	TAPE, BLACK OUT, NO.1 FRT RH	\$	Rn	13.30	
1	TAPE, BLACK OUT, NO.3 FRT RH	\$	Rn	26.30	
1	PANEL SUB-ASSY, REAR DOOR, RH	\$	R	1,294.90	✓
1	FRAME SUB-ASSY, REAR DOOR OUTSIDE HANDLE, RH	\$	Sn	193.50	X
1	HANDLE ASSY, REAR DOOR OUTSIDE, RH	\$	Sn	97.40	X
1	WEATHERSTRIP, REAR DOOR OPENING TRIM, RH	\$	Sn	293.00	X
1	MOTOR ASSY, POWER WINDOW REGULATOR, REAR RH	\$	Sn	926.00	X
1	REGULATOR SUB-ASSY, REAR DOOR WINDOW, RH	\$	Sn	206.70	X
1	TAPE, BLACK OUT, NO.2 REAR RH	\$	Rn	34.90	✓
1	TAPE, BLACK OUT, NO.3 REAR RH	\$	Rn	15.40	✓
1	TAPE, BLACK OUT, NO.1 REAR RH	\$	Rn	21.90	✓
1	HINGE ASSY, REAR DOOR, LOWER RH	\$	R	87.10	X
1	HINGE ASSY, REAR DOOR, UPPER RH	\$	R	98.90	X
1	MIRROR ASSY, OUTER REAR VIEW, RH	\$	Sn	1,436.60	X

Trans-cab Auto Services Pte Ltd**AAD2201-031**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD9991P

1	PANEL SUB-ASSY, QUARTER, RH	\$	B ₁	871.50	✓
1	LINER, REAR WHEEL HOUSE, RH	\$	D ₁	139.80	✓
1	MOULDING ASSY, BODY ROCKER PANEL, RH	\$	S _n	594.80	X
1	COVER, REAR BUMPER	\$	CM	485.60	✓
1	RIM	\$	DC	1,900.10	✓
TOTAL		\$		13,001.30	
25%		\$		3,250.33	
		\$		9,750.98	

Special Nett

1	REAR FENDER LINER CLIP	\$	na	65.00	✓
1	REAR BUMPER RETAINER CLIP	\$	na	75.00	505a
1	TYRE	\$	S _n	350.00	X
1	HUB CAP	\$	CM	211.50	✓
1	DOOR STICKER TEL. NO	\$	na	100.00	805a
1	DOOR TRIM CLIP	\$	na	75.00	X
1	DOOR WEATHERSTRIP CLIP	\$	na	80.00	X
TOTAL		\$		956.50	
TOTAL PARTS		\$		10,707.48	

LABOUR

To Rust-Proofing and apply undercoat Of The Affected Areas.	\$	240.00	601
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	1001
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	1,600.00	8001
To transfer of rear end panel fittings, attachment to facilitate bodywork repair.	\$	na 380.00	X

Trans-cab Auto Services Pte Ltd**AAD2201-031**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD9991P

Putty And Spray Painting Of The Affected Portion.	\$	1,600.00	8801
To reinstall rear bumper parking sensor.	\$	170.00	501
To transfer of tire, rim and on wheel balancing.	\$	170.00	201
To Check Electrical Lighting Concerned.	\$	170.00	201
To check steering geometry and computer wheel alignment	\$	220.00	601
To remove and refit of rear fender fittings, attachment and perform water seepage test.	\$	nn 170.00	X

TOTAL \$ 5,100.00**Over All Total \$ 15,807.48****(PART-BY-PART) Repair Days**~~20 Days~~

7 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: