



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV No. AC2200544

INV Date 26/01/2022

Reference CS/EQI22000366/Kvy3e2

Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SLU 6079G

Insured Veh. SLN 6700H

Claim No. DM22HO00041/JT

Policy No. DMPPHQ21-003482

Accident Date 08/01/2022

Inspection Date 11/01/2022

Description	Total
Survey Inspection	160.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	160.00
GST (7%)	11.20
Grand Total	171.20

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

KHM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Ref: CS/EQI22000366/Kvy3e2 Date: 26/01/2022 Code: EQI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SLN 6700H	Veh. Inspected	SLU 6079G
Policy No.	DMPPHQ21-003482	Coverage (\$)	0.00
Claim No.	DM22HO00041/JT	Excess (\$)	0.00
Assign From	JAIME TAY	Assign Date	11/01/2022
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA WISH (A)	c.c	1797
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	ZGE200018631	Colour	METALLIC BLACK
Odometer	177688 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	BRIDGESTONE	7 mm
L/H Front Tyre	195/65 R15	BRIDGESTONE	7 mm
R/H Rear Tyre	195/65 R15	BRIDGESTONE	3 mm
L/H Rear Tyre	195/65 R15	BRIDGESTONE	3 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	08/01/2022	Inspection Date	11/01/2022
Survey held at	ALAN'S UNITED AUTO PTE LTD BLK 7 SIN MING INDUSTRIAL ESTATE #01-76 SINGAPORE 575642		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 6079G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TAIL GATE	BENT	1,477.30	1,272.00
1	TAIL GATE GLASS MOULDING-TOP	NECESSARY	43.50	43.50
1	TAIL GATE GLASS MOULDING-LOW	NECESSARY	31.30	31.30
2	TAIL GATE GLASS SIDE SEAL @\$35.30	NECESSARY	70.60	70.60
1	TAIL GATE OUTER CHROME	SERVICEABLE	173.90	-
1	TAIL GATE LOGO	NECESSARY	66.20	66.20
1	TAIL GATE INNER TRIM COVER	BUCKLED	328.20	328.20
1	TAIL GATE INNER LOCK	DENTED	361.60	361.60
2	TAIL GATE LAMP @\$153.10	SERVICEABLE	306.20	-
1	REAR END PANEL	BENT	453.90	453.90
1	END PANEL TOP GARNISH	BUCKLED	253.20	253.20
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	543.20	-
1	REAR BUMPER FASCIA	BENT	491.90	491.90
2	REAR BUMPER BRACKET @\$48.40	TO REPAIR SEE LABOUR	96.80	-
2	REAR BUMPER SIDE RETAINER - L @\$89.90	SERVICEABLE	179.80	-
2	REAR BUMPER SIDE RETAINER - S @\$40.10	SERVICEABLE	80.20	-
1	REAR FLOOR PANEL TOP COVER	SERVICEABLE	562.90	-
	LESS 25% DISCOUNT		-1,380.18	-843.10
			4,140.52	2,529.30
1	TAIL GATE RUBBER (SN)	DISTORTED / DENTED	302.60	151.30
	LESS 25% DISCOUNT		-75.65	-
			226.95	151.30
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR BUMPER REVERSE SENSOR (SN)	DENTED	300.00	200.00
1	REAR W/S GLASS SEALANT (SN)	NECESSARY	60.00	40.00
1	REAR NO. PLATE WITH BOX (SN)	DENTED	60.00	45.00

Report Ref No. CS/EQI22000366/Kvy3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR BUMPER CLIP (SN)	NECESSARY	40.00	40.00
			460.00	325.00
	LABOUR			
	TO REMOVE & REFIX REAR WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.		150.00	120.00
	TO REMOVE ROOF LINING, FRONT AND REAR SEATS, TRIM BOARD AND CARPET.		120.00	60.00
	TO APPLY UNDERSEALING.		80.00	60.00
	TO REMOVE AND RENEW EXHAUST SILENCER BOX.	NOT NECESSARY	60.00	-
	TO PUTTY AND SPRAY REPLACED PARTS.		1,200.00	800.00
	TO REMOVE, CUT-OUT DAMAGED PARTS, PANEL BEATING, WELDING, ALIGN, REFIX AND TO RENEW ABOVE PARTS. INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL AND REAR BUMPER BRACKET.		1,000.00	700.00
			2,610.00	1,740.00
GRAND TOTAL			7,437.47	4,745.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,800.00

Report Ref No. CS/EQI22000366/Kvy3e2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 10/01/2022 13:03 (SGT)
Date of Accident 08/01/2022 11:25 (SGT)
Exact Location of Accident Singapore
Additional Location Information BISHAN STREET 21
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLU6079G

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner SOH CHUAN SENG TIMOTHY (SU QUANCHENG)
NRIC No SXXXX694G
Email Address AH_TIM@YAHOO.COM
Mobile Phone No (Phone) +65-82826490
Alternative Phone No +65-82826490

VEHICLE PARTICULARS

Manufacturer Toyota
Model Wish
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party
Vehicle Category Private car
Transmission Auto
CC 1797

INSURANCE COMPANY

Name of Insurance Company ECICS Limited
Type of Coverage Comprehensive
Fleet Policy No
Policy Number MPC21P00158300
Cover Note Number -

DRIVER

Name of Driver SOH CHUAN SENG TIMOTHY (SU QUANCHENG)
NRIC No SXXXX694G

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time


Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

A - SLU6079G

B - SLN6700H

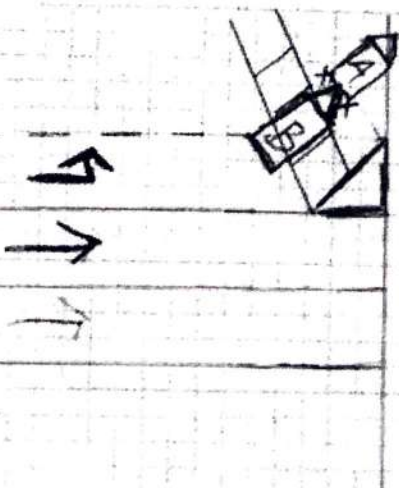



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6079G

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6079G

RE-INSPECTION

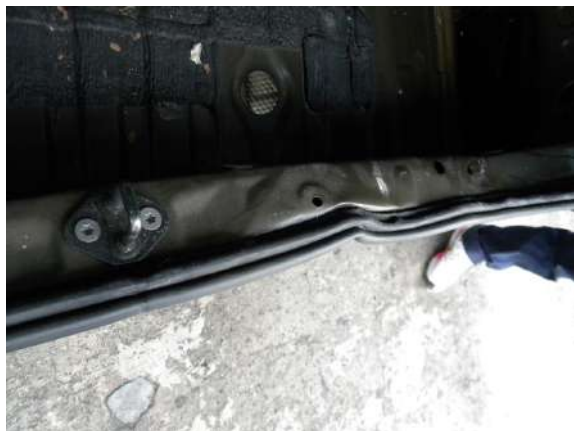



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLU 6079G

RE-INSPECTION

