



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2204709

INV Date 29/07/2022

Reference CC4/LPC22000377/Eea3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMR 8232X

Insured Veh. SKX 6841T

Claim No. 21/22/22/VP05/025344

Policy No. Z21VP05030221

Accident Date 07/01/2022

Inspection Date 07/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22000377/Eea3q2 Date: 29/07/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKX 6841T	Veh. Inspected	SMR 8232X	
Policy No.	Z21VP05030221	Coverage (\$)	0.00	
Claim No.	21/22/22/VP05/025344	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	11/01/2022	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W. 520I	c.c	1998	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	WBAJR12000CD20768	Colour	GREY	
Odometer	36297 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	245/45 R18	BRIDGESTONE	5 mm	
L/H Front Tyre	245/45 R18	BRIDGESTONE	5 mm	
R/H Rear Tyre	245/45 R18	BRIDGESTONE	5 mm	
L/H Rear Tyre	245/45 R18	BRIDGESTONE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	07/01/2022	Inspection Date	07/03/2022	
Survey held at	PERFORMANCE MOTORS LTD 303 ALEXANDRA ROAD SINGAPORE 159941			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMR 8232X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	SUNDRIES (SN)	NECESSARY	80.00	80.00
1	FRT RH DOOR ALUMINIUM (SN)	DENTED	1,881.90	1,881.90
1	FRT RH SIDE PANEL ALUMINIUM (SN)	DENTED	938.00	938.00
1	RH TRIM AIR DUCT SIDE PANEL (CHROM) (SN)	CUT	48.80	48.80
5	RIVET (SN)	NECESSARY	2.50	2.25
1	FRT RH WHEEL ARCH RR SECTION COVER (SN)	NOT NECESSARY	133.35	-
1	(S/L) DOOR WEATHERSTRIP (SN)	NECESSARY	182.70	182.70
1	FRT RH DOOR LOWER SEAL (SN)	NOT NECESSARY	43.05	-
2	ADJUST ABLE BLIND RIVET (SN) (ADDITIONAL)	NECESSARY	3.00	3.00
1	RH AIR DUCT SIDE PANEL INNER (SN) (ADDITIONAL)	BROKEN	65.10	65.10
			3,378.40	3,201.75
<u>LABOUR</u>				
	TO REPLACE RIGHT FRONT DOOR ,RIGHT FRONT FENDER INCLUDING TO KNOCK OUT DENTED AREA CAUSED BY THE ACCIDENT.		2,550.00	1,700.00
	TO RESPRAY RIGHT FRONT FENDER AND RIGHT FRONT DOOR .		1,770.00	1,680.00
	TO CARRY OUT BODY CAVITY PRESERVATION.		236.00	168.00
	TO CONDUCT CHECK ON ALL DOORS AND BOOTLID CENTRAL LOCKING SYSTEM FOR PROPER FUNCTION.		177.00	168.00
	TO CHECK ELECTRICAL WIRING SYSTEM AND LIGHTING INCLUDING RESET AND CHECK AIR BAG FOR PROPER FUNCTION .		295.00	168.00
			5,028.00	3,884.00
GRAND TOTAL			8,406.40	7,085.75
RECOMMENDED COST OF REPAIRS				7,085.75

Report Ref No. CC4/LPC22000377/Eea3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 8232X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

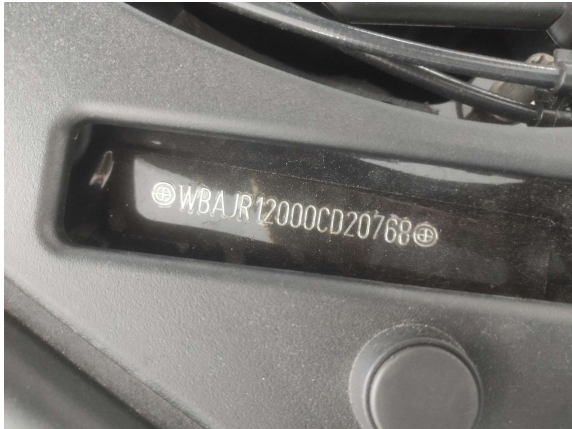



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMR 8232X

RE-INSPECTION

