



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2202044

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 08/04/2022
Reference CC3/CTI22000423/Rpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 5705L
Insured Veh. SMX 9166R
Claim No. SNM22D200207/C02
Policy No. DMPCSNW00065572100
Accident Date 10/01/2022
Inspection Date 11/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI22000423/Rpa3q2 Date: 08/04/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMX 9166R	Veh. Inspected	SHB 5705L
	Policy No.	DMPCSNW00065572100	Coverage (\$)	0.00
	Claim No.	SNM22D200207/C02	Excess (\$)	0.00
	Assign From		Assign Date	11/01/2022
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA PRIUS TAXI (SMRT)	c.c	1798
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	JTDKN36U705767479	Colour	MAROON
	Odometer	849542 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	SAILUN	6 mm
	L/H Front Tyre	195/65 R15	SAILUN	6 mm
	R/H Rear Tyre	195/65 R15	SAILUN	6 mm
	L/H Rear Tyre	195/65 R15	SAILUN	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	10/01/2022	Inspection Date	11/01/2022
	Survey held at	STRIDES AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 5705L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER REAR (DISC 25%)	DEFORMED	458.60	343.95
10	BUMPER CLIPS @\$2.10 (DISC 25%)	NECESSARY	21.00	15.75
1	BUMPER SIDE RETAINER RR/LH (DISC 25%)	CRACKED	94.80	71.10
1	BUMPER REINFORCEMENT REAR (DISC 25%)	BENT	205.70	154.27
1	ARM SUB-ASSY ,RR BUMPER LH (DISC 25%)	BENT	139.60	104.70
1	BUMPER LIP COVER RR/LH (DAMAGED)	OLD DAMAGED	72.20	-
1	ANTENNA ELECTRICAL LOWER REAR	NOT NECESSARY	157.40	-
1	BUMPER SIDE RETAINER RR/LH	NOT NECESSARY	94.80	-
1	BUMPER SIDE RETAINER RR/RH	NOT NECESSARY	94.80	-
1	BUMPER LIP COVER RR/LH	NOT NECESSARY	72.20	-
1	BUMPER LIP COVER RR/RH	NOT NECESSARY	118.10	-
1	UNDER COVER SUB-ASSY ,RR FLOOR	NOT NECESSARY	514.50	-
1	UNDER COVER RR SHIELD	NOT NECESSARY	63.90	-
1	BUMPER REINFORCEMENT REAR	NOT NECESSARY	205.70	-
1	BUMPER LIP REAR	NOT NECESSARY	228.90	-
1	SENSOR REVERSE	NOT NECESSARY	180.00	-
1	ARM SUB-ASSY ,RR BUMPER RH	NOT NECESSARY	139.60	-
1	ARM SUB-ASSY ,RR BUMPER RH	NOT NECESSARY	139.60	-
			3,001.40	689.77
	<u>LABOUR</u>			
	PANEL BEATING & BODY WORK.		507.00	200.00
	SPRAY PAINT.		738.00	300.00
	TO TEST AND REFIX REVERSE SENSOR SYSTEM.		120.00	40.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
	TO CHECK WIRING AND SYSTEM FUNCTION.	NOT NECESSARY	80.00	-
	TO WASH AND VACUUM .	NOT NECESSARY	60.00	-
			1,605.00	540.00
	GRAND TOTAL		4,606.40	1,229.77



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			1,100.00
---	--	--	-----------------

Report Ref No. CC3/CTI22000423/Rpa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5705L

INSPECTION

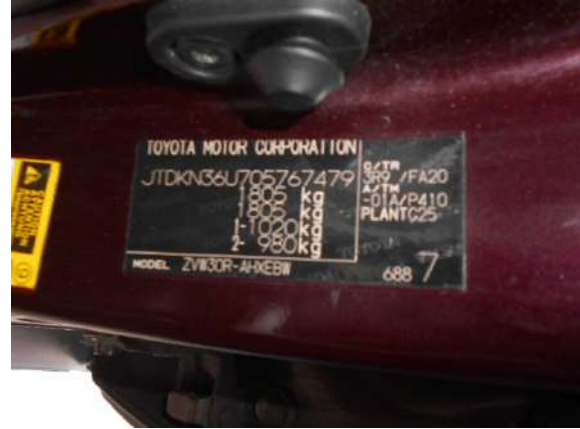



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 5705L

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

