



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2302275

INV Date 13/04/2023

Reference CC4/LPC22000429/Epa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLL 6077J
Insured Veh. XD 6436G
Claim No. 21/22/22/VC00/025354
Policy No. Z/21/VC00/111537
Accident Date 10/01/2022
Inspection Date 11/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22000429/Epa3q2 Date: 13/04/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 6436G	Veh. Inspected	SLL 6077J	
Policy No.	Z/21/VC00/111537	Coverage (\$)	0.00	
Claim No.	21/22/22/VC00/025354	Excess (\$)	0.00	
Assign From	ENG HUEY NI	Assign Date	11/01/2022	
2. Vehicle Particulars & Condition				
Make & Model	MAZDA 3	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JM6BN22A8H0144958	Colour	BLACK	
Odometer	444638 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	FIRESTONE	5 mm	
L/H Front Tyre	205/60 R16	FIRESTONE	5 mm	
R/H Rear Tyre	205/60 R16	FIRESTONE	5 mm	
L/H Rear Tyre	205/60 R16	FIRESTONE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	10/01/2022	Inspection Date	11/01/2022	
Survey held at	PEGASUS ENGINEERING & TRADING PTE LTD 74 Kian Teck Road Singapore 628800			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLL 6077J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DENTED	1,075.00	1,075.00
2	REAR BUMPER TOW COVER @\$55.00	NOT NECESSARY	110.00	-
2	REAR BUMPER REFLECTOR @\$125.00	NOT NECESSARY	250.00	-
10	REAR BUMPER CLIPS @\$4.00	NECESSARY	40.00	30.00
4	REAR BUMPER RIVET @\$5.00	NECESSARY	20.00	10.00
1	REAR BUMPER INNER CENTER BRACKET	NOT NECESSARY	45.00	-
1	REAR BOOTLID	DENTED	1,285.00	1,057.00
1	REAR BOOTLID 'MAZDA' EMBLEM	NECESSARY	75.00	75.00
1	REAR BOOTLID 'MAZDA 3' BADGE	NECESSARY	75.00	75.00
1	REAR BOOTLID 'SKYACTIVE' BADGE	NECESSARY	85.00	85.00
2	REAR BOOTLID HINGES @\$155.00	TO REPAIR SEE LABOUR	310.00	-
2	REAR BOOTLID REFLECTOR @\$358.00	CUT	716.00	716.00
6	REAR BOOTLID REFLECTOR CLIPS @\$5.00	NECESSARY	30.00	20.00
1	REAR BOOTLID INNER TRIM COVER	NOT NECESSARY	395.00	-
10	REAR BOOTLID INNER TRIM COVER CLIPS @\$5.00	NOT NECESSARY	50.00	-
2	REAR BOOTLID NO PLATE LAMP @\$95.00	NOT NECESSARY	190.00	-
1	REAR BOOTLID WEATHERSTRIP	NOT NECESSARY	198.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	755.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	125.00	-
1	REAR REINFORCEMENT	DENTED	545.00	545.00
1	REAR SPARE TYRE FLOOR PANEL	NOT NECESSARY	795.00	-
1	REAR SPARE TYRE TOOLKIT FOAM	NOT NECESSARY	228.00	-
1	REAR SPARE TYRE PANEL FLOOR BOARD	NOT NECESSARY	340.00	-
2	REAR FENDER @\$1575.00	TO REPAIR SEE LABOUR	3,150.00	-
10	REAR FENDER INNER TRIM COVER CLIPS @\$4.00	NOT NECESSARY	40.00	-
1	REAR WINDSCREEN GLASS MOULDING	NOT NECESSARY	198.00	-
2	REAR TAILLAMP @\$535.00	BROKEN (1 PCS ONLY)	1,070.00	535.00
6	REAR TAILLAMP CLIPS @\$5.00	NECESSARY (3 PCS ONLY)	30.00	15.00

Report Ref No. CC4/LPC22000429/Epa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR TAILLAMP PANEL @\$398.00	NOT NECESSARY	796.00	-
	LESS 20% DISCOUNT		-2,604.20	-847.60
			10,416.80	3,390.40
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NO PLATE & CASING (SN)	CUT	60.00	40.00
1	REAR WINDSCREEN GLASS SEALANT (SN)	NOT NECESSARY	60.00	-
1	SET REAR REVERSE SENSOR (SN)	BROKEN	280.00	200.00
			400.00	240.00
	<u>LABOUR</u>			
	TO REMOVE & REPLACED REAR REVERSE SENSOR .		100.00	30.00
	TO REMOVE & REARRANGE REAR ELECTRICAL WIRING SYSTEM.		100.00	30.00
	TO REMOVE & RESTONE REAR WINDSCREEN GLASS .	NOT NECESSARY	200.00	-
	TO REMOVE & REFIX BACK REAR INNER GARNISHES ,TRIMMINGS ,SEATS & FLOOR BOARD FOR FACILITATE REPAIR .		120.00	30.00
	TO APPLY RUSTPROOFING /TUFFCOATING TREATMENT TO REPLACED PARTS.		120.00	30.00
	TO PANEL BEATING ,KNOCKING AND STRAIGHTEN THE NECESSARY PORTION ,REMOVE AND RENEWAL OF PARTS ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF REAR BOOTLID HINGES,REAR END PANEL AND REAR FENDER.		2,000.00	600.00
	TO PUTTY AND SPRAY PAINT ON THE ALL AFFECTED AREAS .		1,500.00	1,000.00
			4,140.00	1,720.00
GRAND TOTAL			14,956.80	5,350.40
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,300.00

Report Ref No. CC4/LPC22000429/Epa3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLL 6077J

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

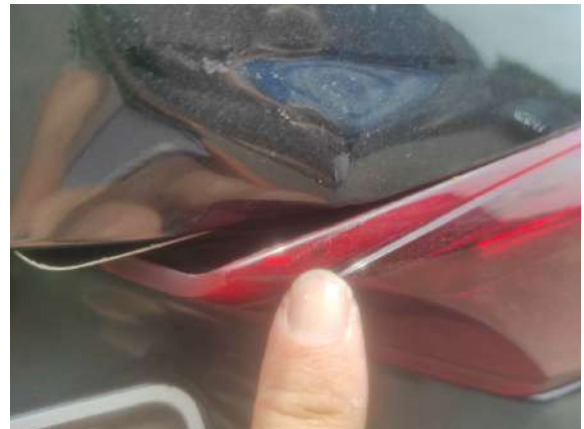



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

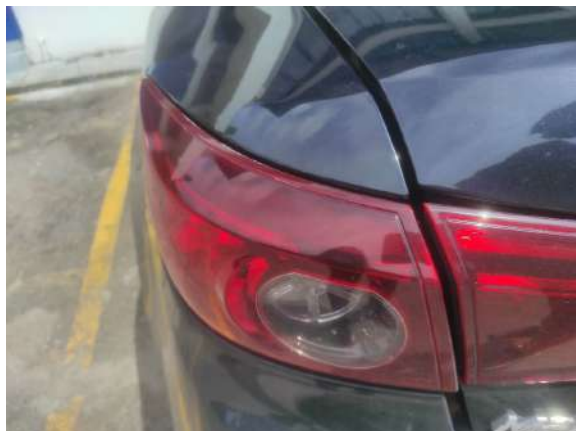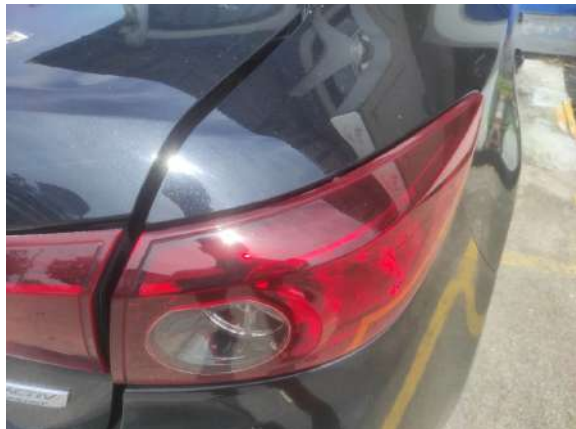



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLL 6077J

RE-INSPECTION

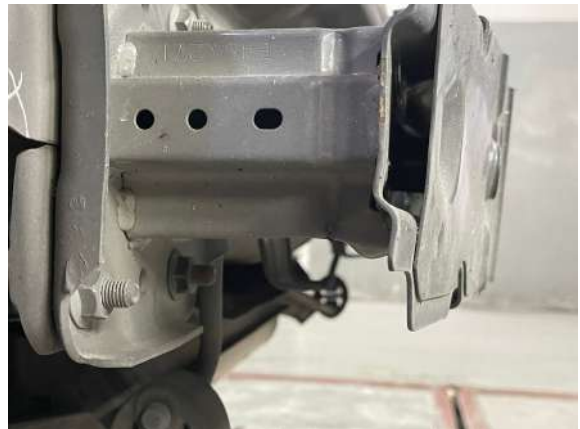




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

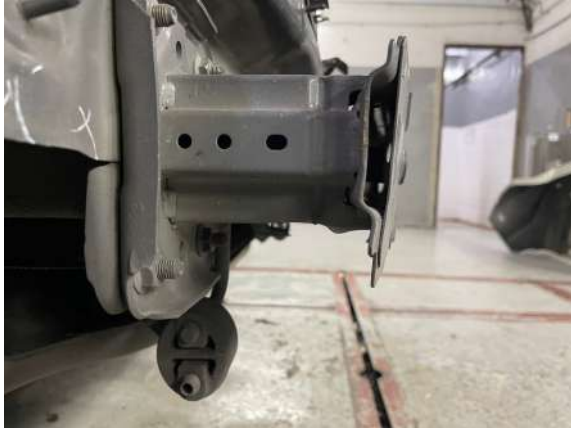




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

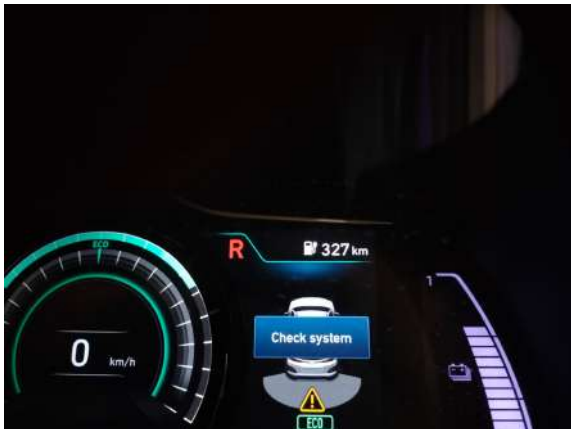



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLL 6077J

RE-INSPECTION

