



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2303959
3 ANSON ROAD #16-00	INV Date	20/06/2023
SPRINGLEAF TOWER	Reference	CC6/CTI22000681/Apa3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMN 7835J
Insured Veh.	GBB 4402M
Claim No.	SNM22D200436/C02
Policy No.	DMCVSNW00124482101
Accident Date	14/01/2022
Inspection Date	18/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC6/CTI22000681/Apa3q2

Date: 20/06/2023

Code: CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBB 4402M	Veh. Inspected	SMN 7835J
Policy No.	DMCVSNW00124482101	Coverage (\$)	0.00
Claim No.	SNM22D200436/C02	Excess (\$)	0.00
Assign From		Assign Date	18/01/2022

2. Vehicle Particulars & Condition

Make & Model	NISSAN SYLPHY	c.c	1598
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	MNTBBAB17Z0035308	Colour	BRONZE
Odometer	37088 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/60 R16	YOKOHAMA	6 mm
L/H Front Tyre	195/60 R16	YOKOHAMA	6 mm
R/H Rear Tyre	195/60 R16	YOKOHAMA	6 mm
L/H Rear Tyre	195/60 R16	YOKOHAMA	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	14/01/2022	Inspection Date	18/01/2022
Survey held at	VENTURES AUTO PTE LTD 23 KAKI BUKIT AVENUE 4, #04-01, AAS KAKI BUKIT CENTRE, SINGAPORE 415933		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 7835J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BOOTLID (N)	DENTED	1,345.20	980.00
1	BOOTLID SMART KEY ANTENNA (N)	NOT NECESSARY	252.80	-
1	BOOTLID OUTER CHROME GARNISH (N)	CRACKED	298.60	298.60
2	BOOTLID REFLECTORS @\$298.50 (N)	CUT	597.00	597.00
2	BOOTLID NUMBER PLATE LAMPS @\$85.90 (N)	NOT NECESSARY	171.80	-
1	BOOTLID EMBLEM 'SYLPHY' (N)	NECESSARY	95.80	95.80
1	BOOTLID LOGO (N)	NECESSARY	92.60	92.60
1	BOOTLID INNER TRIM (N)	TORN	305.20	254.00
1	BOOTLID INNER LOCK (N)	DAMAGED	156.70	156.70
1	BOOTLID LOWER LATCH (N)	NOT NECESSARY	82.70	-
1	BOOTLID WEATHERSTRIP (N)	CUT	198.60	198.60
2	BOOTLID HINGE @\$125.80 (N)	NOT NECESSARY	251.60	-
1	REAR BUMPER (N)	DISTORTED	895.60	625.00
2	REAR BUMPER REFLECTORS @\$85.60 (N)	NOT NECESSARY	171.20	-
2	REAR BUMPER RETAINERS @\$110.20 (N)	NECESSARY	220.40	78.00
1	REAR BUMPER SPONGE (N)	CRACKED	245.80	245.80
2	REAR BUMPER SUPPORT BRACKETS @\$135.90 (N)	DENTED	271.80	184.00
2	TAILLAMPS @\$425.80 (N)	CUT	851.60	794.00
2	TAILLAMPS INNER SEAL @\$35.00 (N)	NOT NECESSARY	70.00	-
1	TAILLAMPS PANEL (LH) (N)	DENTED	198.60	198.60
1	END PANEL (N)	DENTED	456.90	456.90
1	END PANEL TOP GARNISH (N)	DEFORMED	195.60	195.60
1	END PANEL SMART KEY SENSOR (N)	DAMAGED	185.30	185.30
1	REVERSE SENSOR WIRE HARDNESS (N)	NOT NECESSARY	385.90	-
1	REAR FENDER LH (N)	NOT NECESSARY	1,389.50	-
1	REAR FENDER QUARTER GLASS MOULDING (N)	NOT NECESSARY	85.30	-
1	REAR WINDSCREEN MOULDING (N)	NOT NECESSARY	185.60	-
2	REAR FENDER INNER TRIM @\$325.80 (N)	NOT NECESSARY	651.60	-
2	REAR FENDER INNER COWLING @\$158.20 (N)	NOT NECESSARY	316.40	-
1	REAR TOOL BOX SPONGE (N)	CRACKED	223.90	223.90
1	REAR SPARE TYRE TOP BOARD (N)	DEFORMED	398.70	285.00

Report Ref No. CC6/CTI22000681/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPARE TYRE PANEL (N)	TO REPAIR SEE LABOUR	785.30	-
	LESS 10% DISCOUNT		-1,203.36	-614.54
			10,830.24	5,530.86
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	50.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	30.00	10.00
1	SET REVERSE SENSOR (SN)	DAMAGED	250.00	200.00
1	SET REVERSE CAMERA (SN)	NOT NECESSARY	350.00	-
2	SET REAR FENDER INNER COWLING CLIPS (SN)	NOT NECESSARY	60.00	-
2	SET REAR FENDER INNER TRIM (SN)	NOT NECESSARY	60.00	-
1	SET REAR BOOT INNER TRIM CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	SET REAR QUARTER GLASS SEALANT (SN)	NOT NECESSARY	80.00	-
1	SET FLOOR PANEL INSULATOR PADS (SN)	NOT NECESSARY	150.00	-
1	NISSAN TOP CARRIER TRAY (SN)	NOT NECESSARY	250.00	-
1	EMERGENCY BREAK DOWN SIGN (SN)	NOT NECESSARY	200.00	-
2	END PANEL INSULATOR SEAL (SN)	NECESSARY	80.00	60.00
			1,700.00	330.00
	<u>LABOUR</u>			
	TO RENEW DAMAGED PARTS ,REPLACE ,BEAT , WELD ,REALIGN AND ALIGNE ALL PARTS.INCLUSIVE OF THE REPAIR OF REAR SPARE TYRE PANEL .		2,000.00	1,000.00
	TO RESPRAY AFFECTED AREAS .		2,000.00	900.00
	TO TUFFCOAT AFFECTED AREA.		200.00	60.00
	TO REMOVE/REFIT INTERIOR UPHOLSTERY AND REAR SEATS.		250.00	60.00
	TO APPLY SEALANT AND UNDERCOATING TO THE AFFECTED AREAS .		200.00	60.00
	TO REMOVE /REFIT WIRING CHECKS ON REAR TAILLAMPS .		150.00	30.00
	TO REMOVE/REFIT REAR WINDSCREEN .	NOT NECESSARY	150.00	-
	TO REMOVE/REFIT REAR FENDER QUARTER GLASS .	NOT NECESSARY	120.00	-
	TO REMOVE AND INSTALL REAR CAMERA.		150.00	50.00

Report Ref No. CC6/CTI22000681/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE/REPLACE REVERSE SENSORS AND DISTANCE SETTLING.		150.00	50.00
	TO REMOVE AND REPLACE BOOTLID MECHANISM.		150.00	60.00
			5,520.00	2,270.00
GRAND TOTAL			18,050.24	8,130.86
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,500.00

Report Ref No. CC6/CTI22000681/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 7835J

INSPECTION

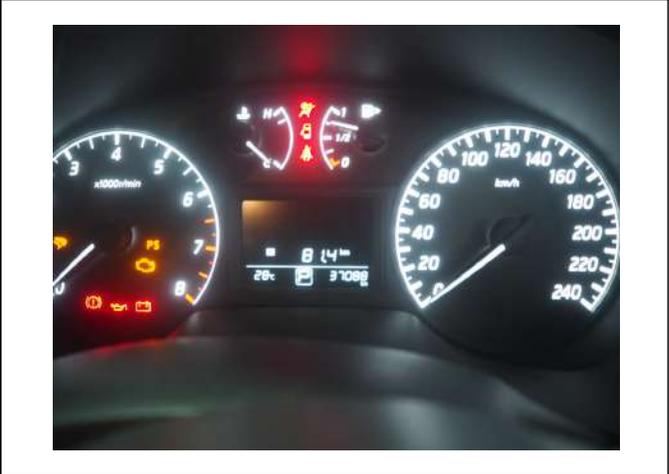



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

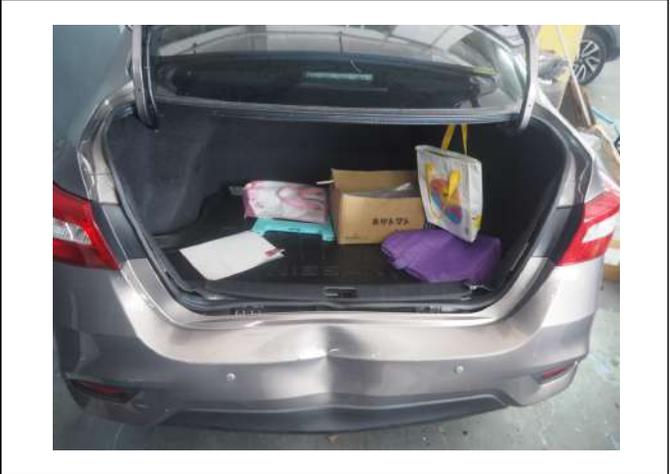








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

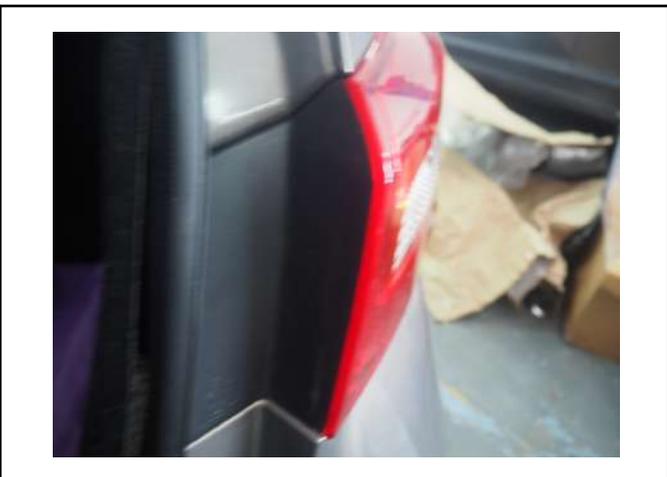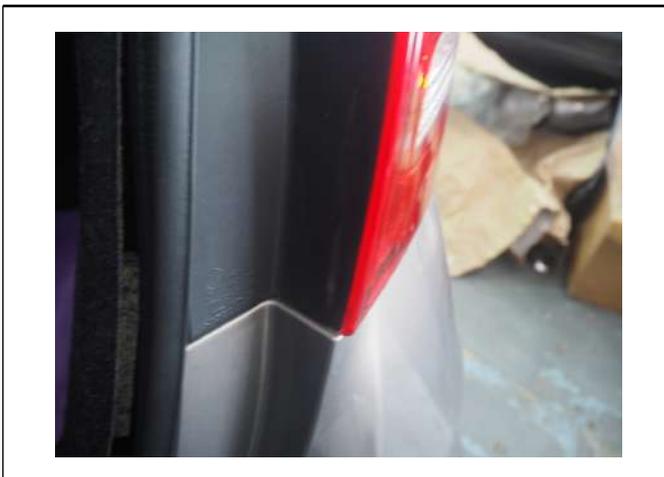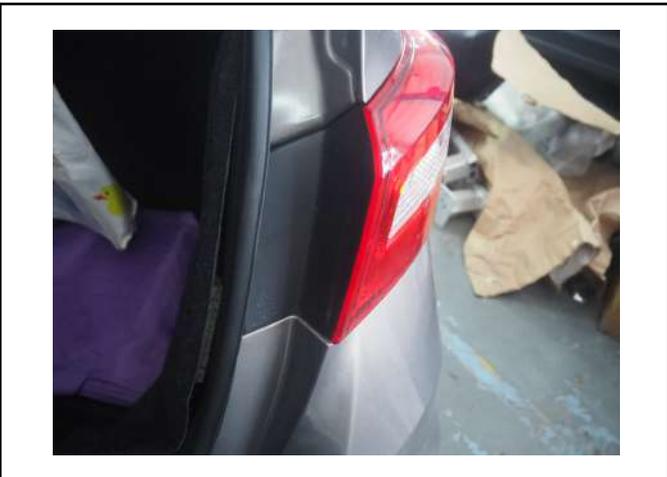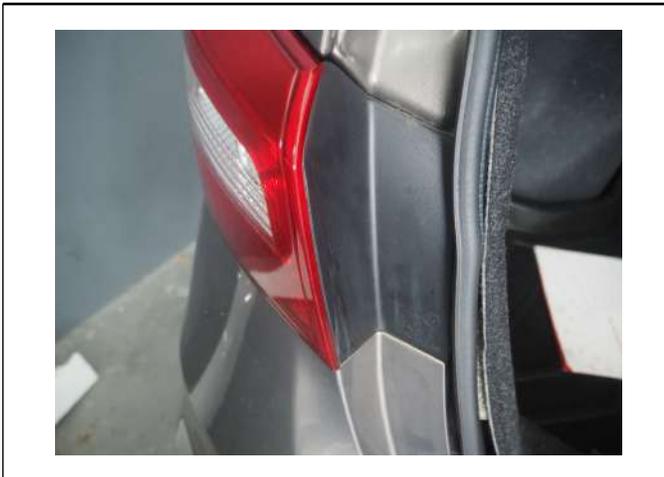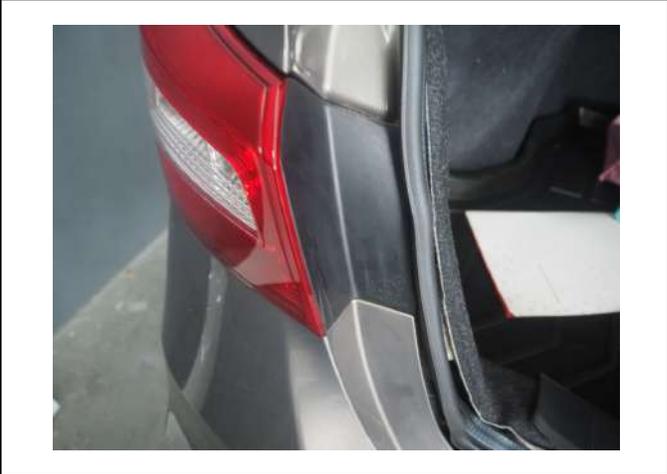



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

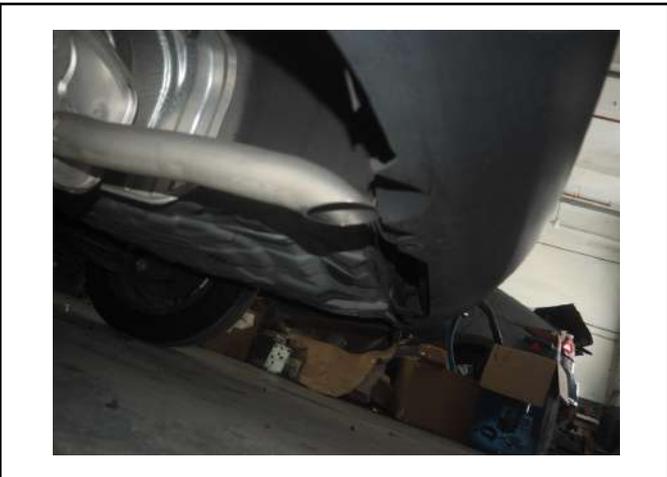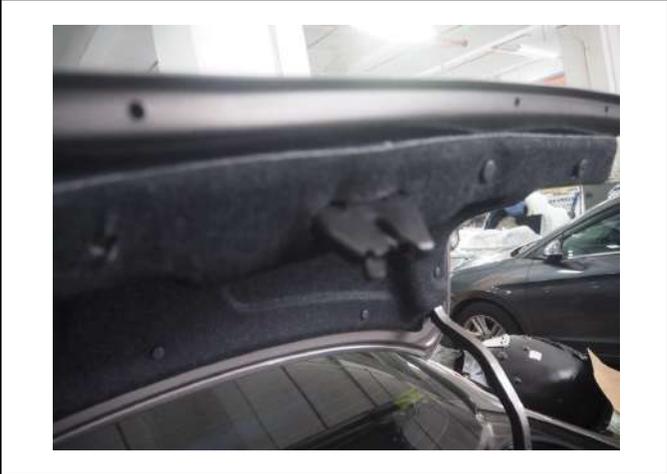




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

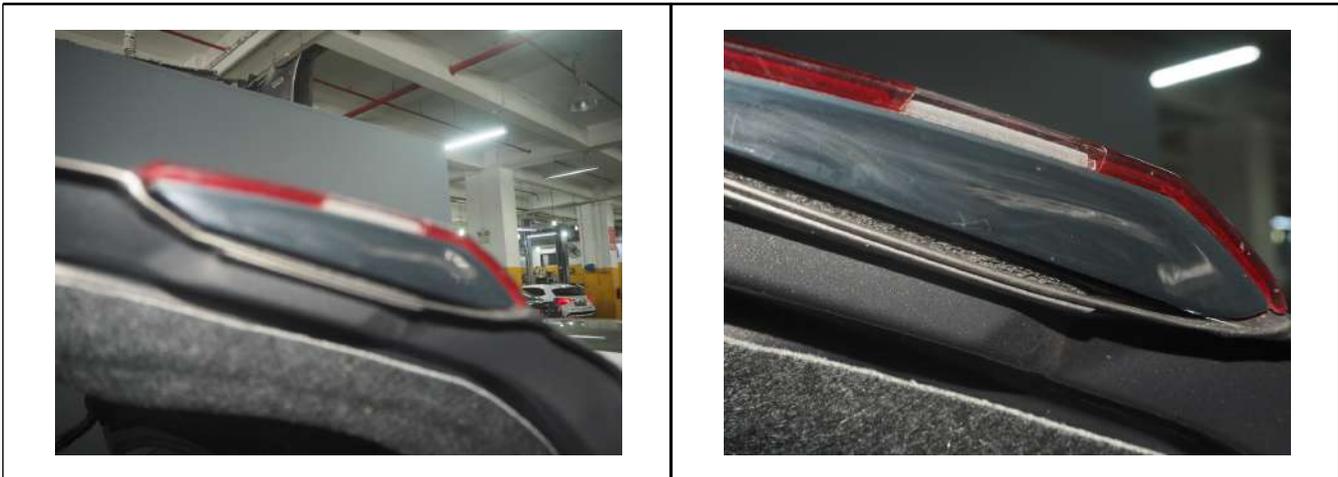



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 7835J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

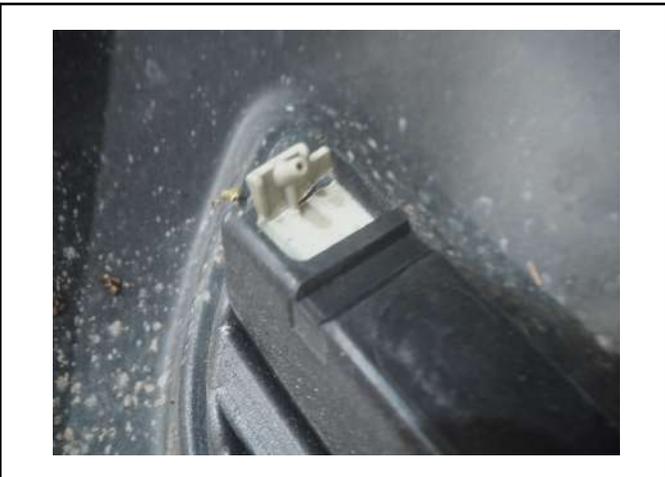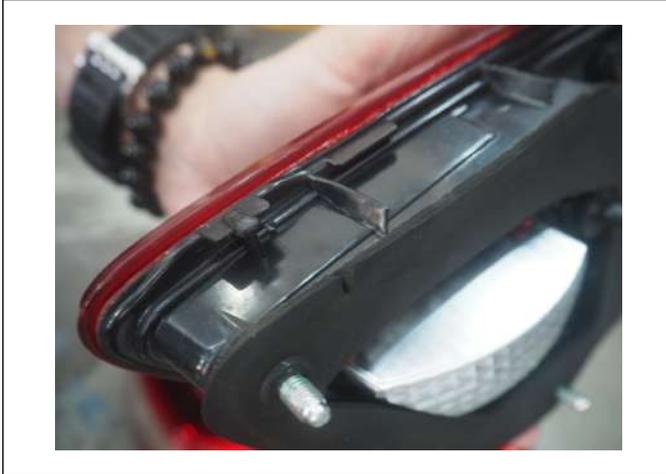




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

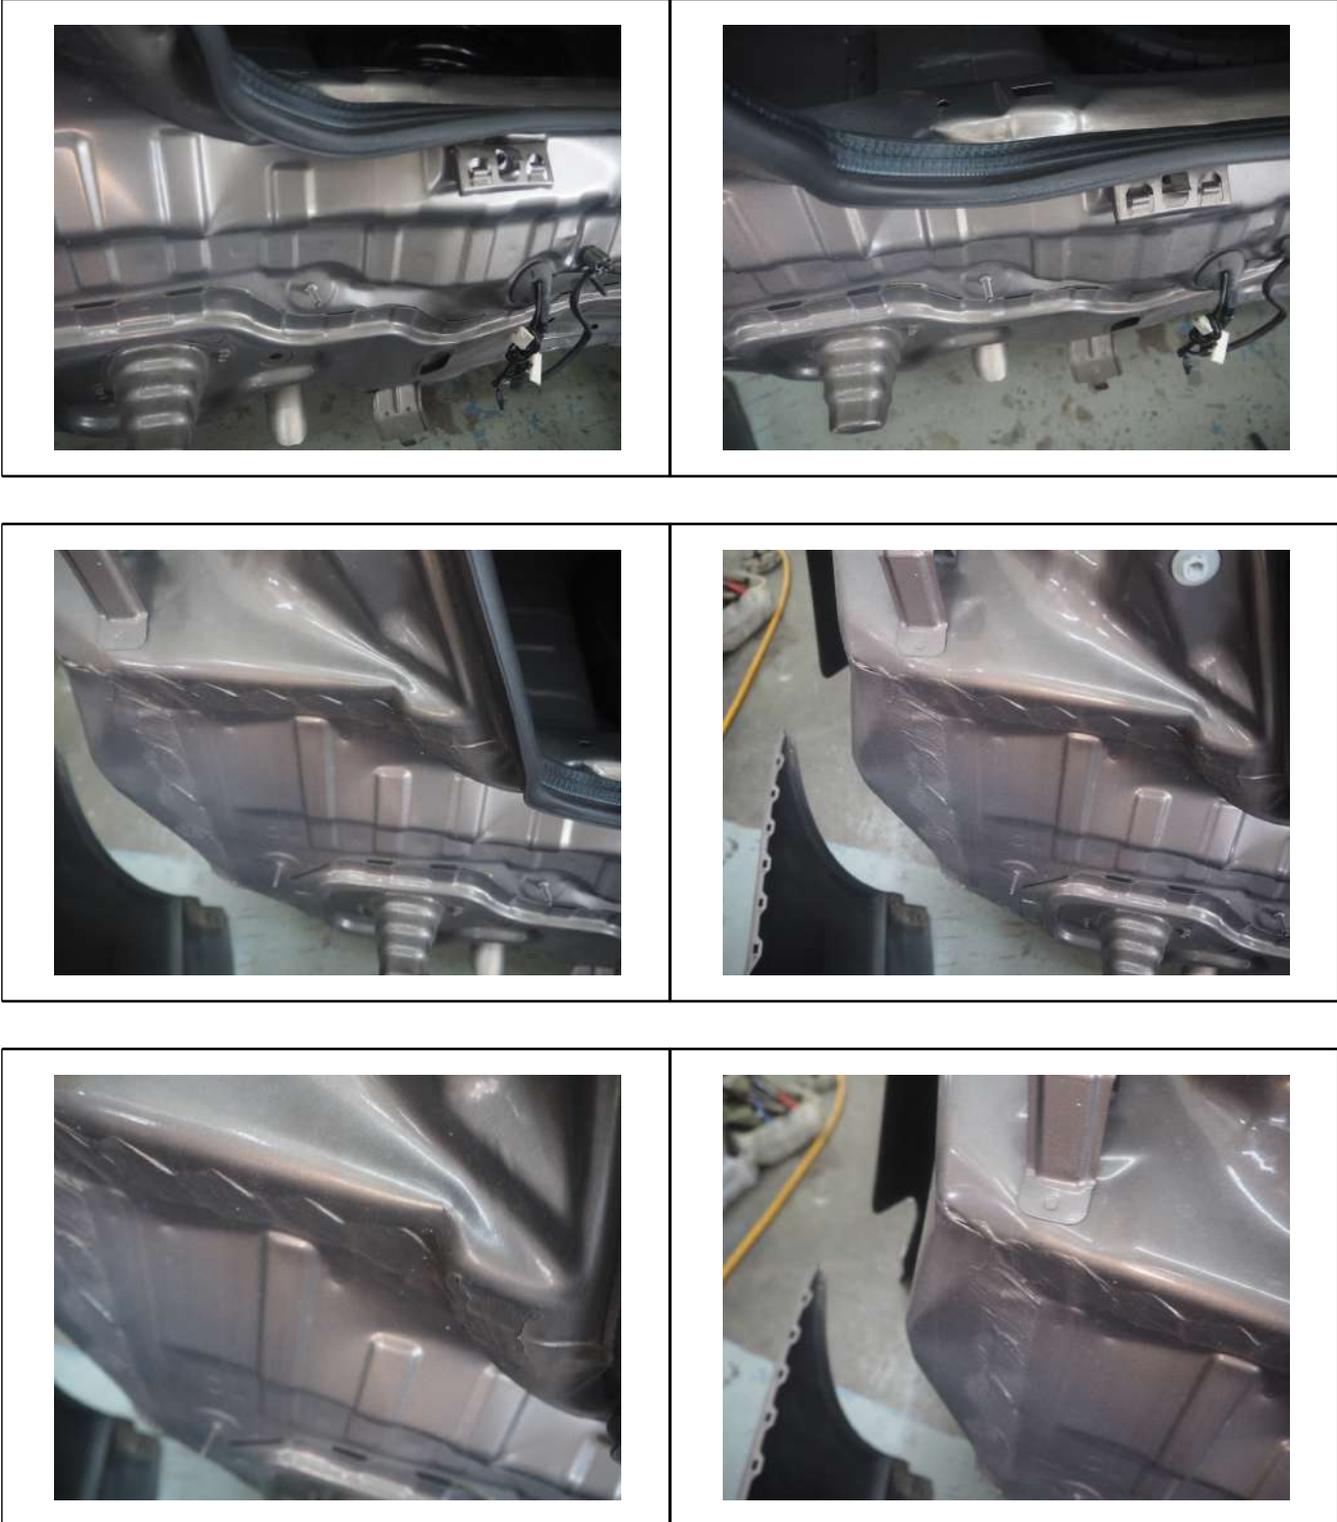



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

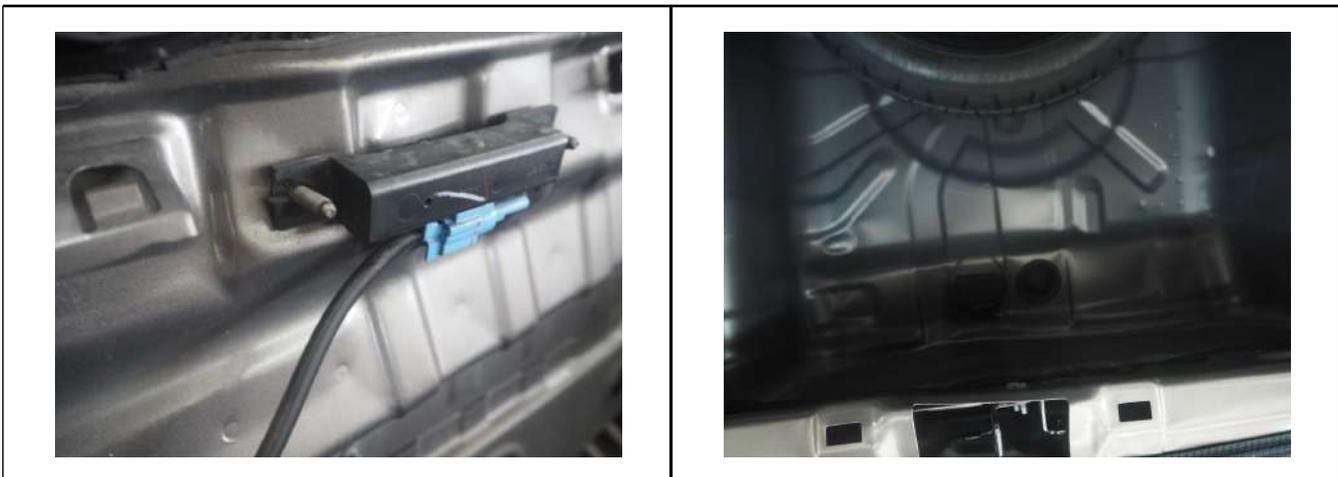




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

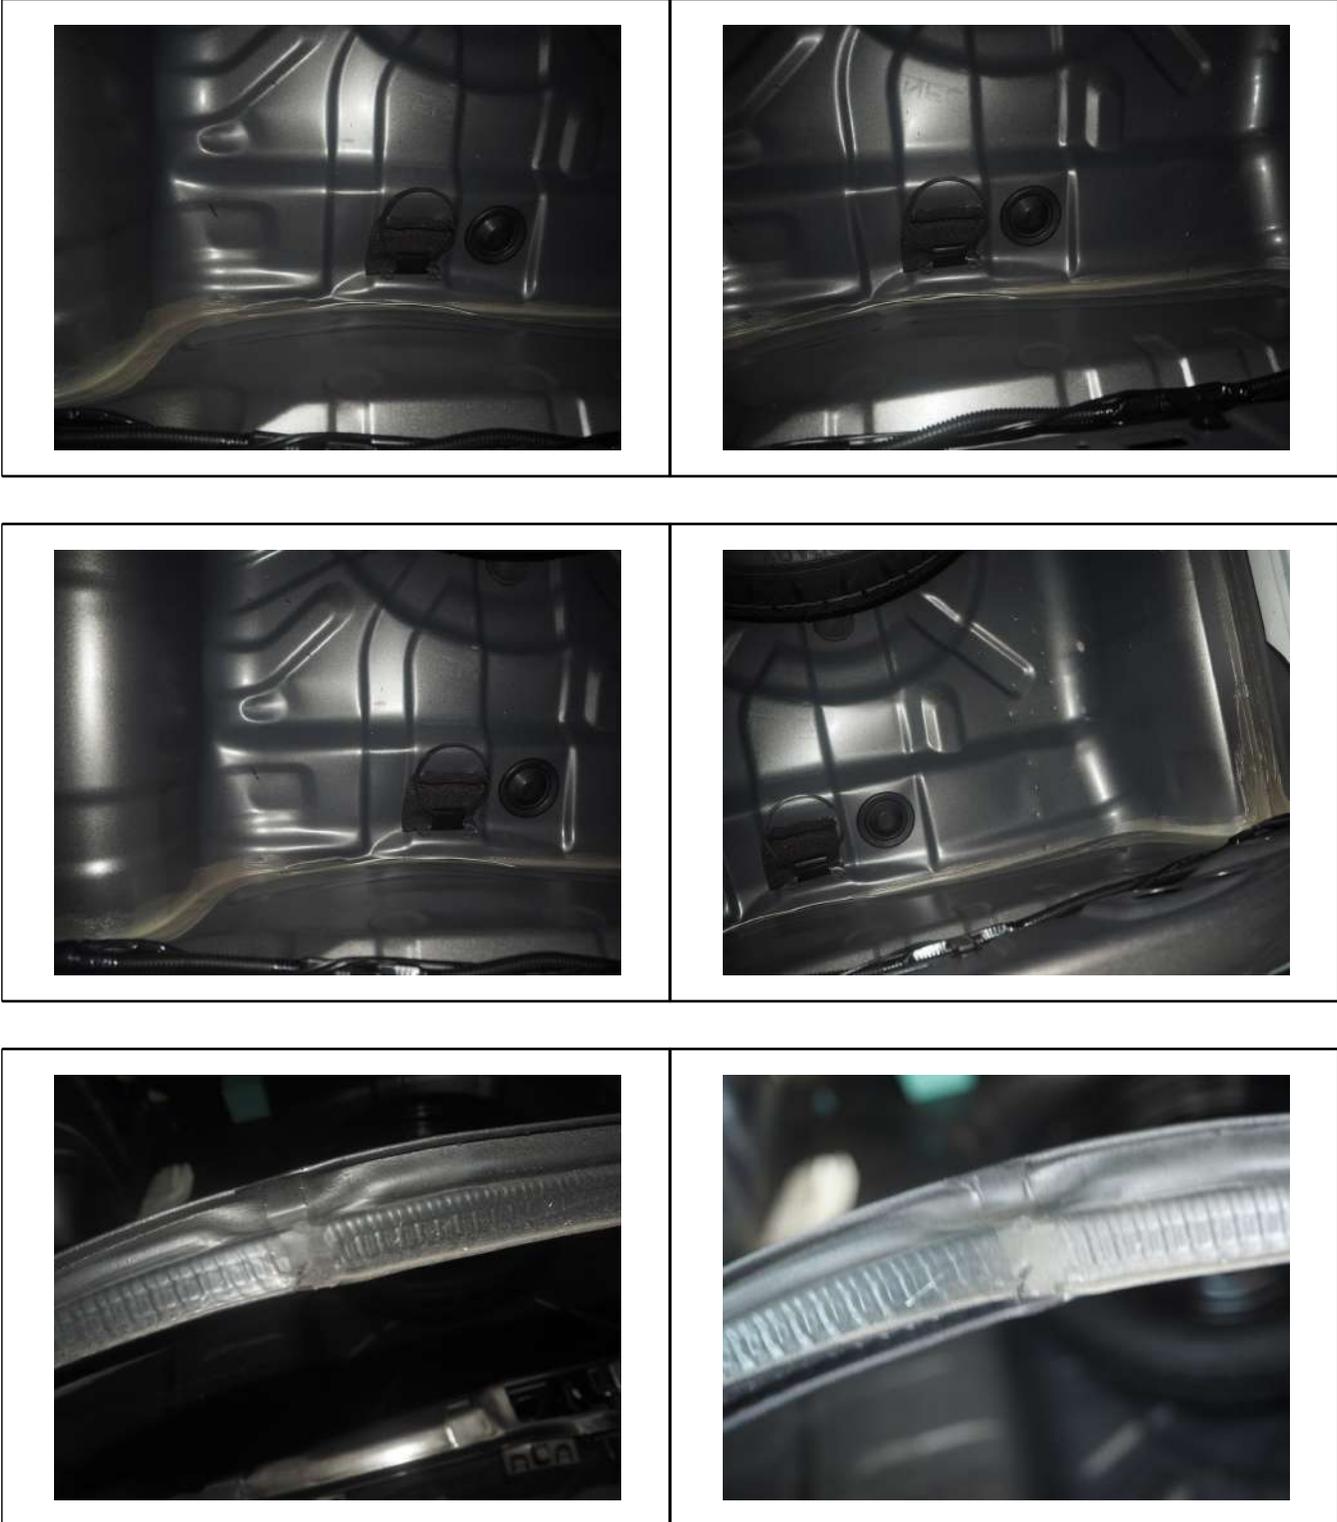



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 7835J

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

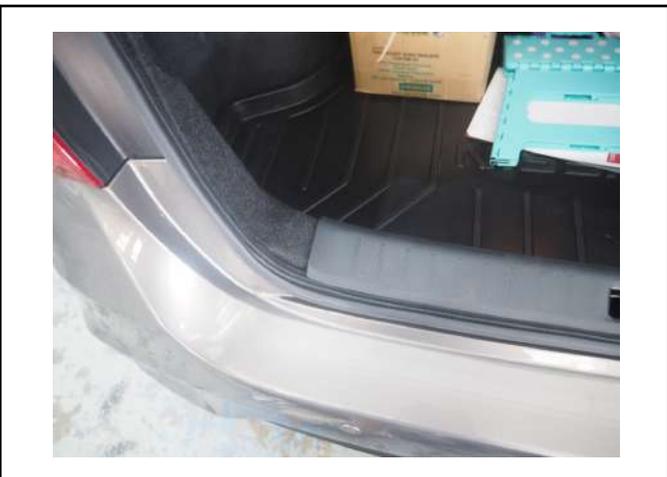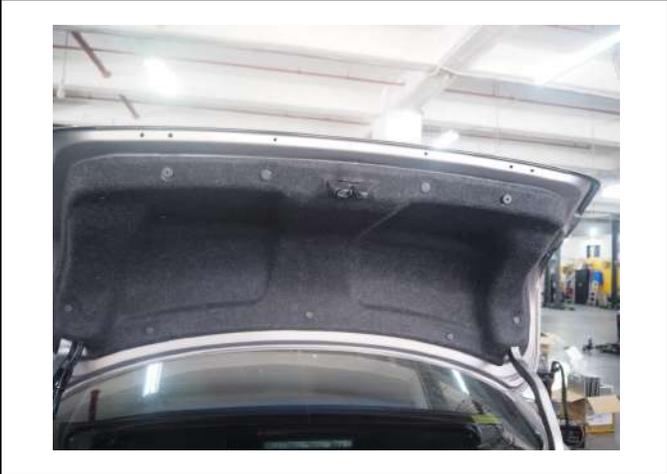



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

