

ASS. REC. BY: Marcus

REF:

CS/CT/22000724/443

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

Consistent? : Yes or No

Consistent? : Yes or No

Res.: Yes or No

3 Val.: Yes or No



CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

CNY 1-2-22

Nott 531881

MA 830119

pass out 14-2-22

\$7492.78

confirm \$8,824.11
(Red: 3270, 27%)

Veh No:

Yr Regn:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS/DUN/EXNOVA/GY/FS/LIZA/MIC/OHTSU/PIR/SUMI/TOYO/YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Survey held at

Rear

R/Bal.

L/Bal.

D.O.I.

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Preli. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

) S + RS, SI

) Photos

) Others

TOTAL

Report Format :

Sum / I.B.I. (\$

New Cars

Used Cars

Rental Cars

Sell My Car

Directory

Products

Insurance

Articles

Forum

Resources

Login Sign up

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

2019 Volkswagen Golf Variant 1.4 TSI RL SR @ \$116.8K



Promo! Interest @ 1.88%
Trust Motoring StarAd



Browse by Category

5 vehicles



Nissan Sylphy

Sort by Date Posted

20 results/page

Advanced Search

Search

Search Selection

Nissan Sylphy

Any

Any

2018

Eng Cap

Any

Mileage

Any

Veh Type

Any

Status

Available



Nissan Sylphy 1.6A

\$64,500

\$8,160 /yr

13-Dec-2018

1,598 cc

Sedan

Available

Posted: 15-Jan-2022

Tags: 2018 Nissan Sylphy, Nissan Sylphy, Nissan, Sylphy

PREMIUM AD



Nissan Sylphy 1.6A Premium

\$60,800

\$7,970 /yr

25-Aug-2018

1,598 cc

Sedan

Available

Viewing By Appt Only. 1.98% Full Loan Package. Spacious Internally And At Boot, Fully Agent Service. Flexible Loan 100% Provided. Lo...

Posted: 15-Jan-2022

Tags: 2018 Nissan Sylphy, Nissan Sylphy, Nissan, Sylphy



Nissan Sylphy 1.6A Premium

\$63,777

\$8,220 /yr

30-Oct-2018

1,598 cc

Sedan

Available

100% Loan Available, Fully Maintained By Agent, Spacious Interior With Large Boot Space, Accident Free, Efficient Fuel Consumption At...

Posted: 13-Jan-2022

Tags: 2018 Nissan Sylphy, Nissan Sylphy, Nissan, Sylphy

PREMIUM AD



Nissan Sylphy 1.6A Premium

\$67,800

\$9,030 /yr

01-Sep-2018

1,598 cc

55,000 km

Sedan

Available

This Is A Good Unit! 1 Single Owner Only, Fully Agent Maintained, Black With Sporty Black Interior, Low Mileage Done, Paintwork Good...

Posted: 07-Jan-2022

Tags: 2018 Nissan Sylphy, Nissan Sylphy, Nissan, Sylphy



Nissan Sylphy 2.0A (For Lease)

\$1,680/mth Nissan Sylphy 2.0A leasing @ just \$1680/mth. Call us or visit our website now for more information. Min 6 months lease.
More info about this vehicle



Nissan Sylphy 1.6A Premium

\$65,800

\$8,730 /yr

25-Aug-2018

1,598 cc

Sedan

Available

Kept In Immaculate Condition. Full Loan/High Loan Available. 1 Owner Unit With Low Mileage Done. 120 Point Check By Our In House...

Posted: 06-Jan-2022

Tags: 2018 Nissan Sylphy, Nissan Sylphy, Nissan, Sylphy

PREMIUM AD

Save this search criteria, to get email alerts whenever a match is found.

Make

Model

Price

Depreciation

Reg Date

Eng Cap

Mileage

Veh Type

Status

For old advertisements, view Expired ads

20 results/page

Home

New Cars

Used Cars

Rental Cars

Sell My Car

Directory

Products

Insurance

Article

Forum

Resources

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, sports cars or stationwagons, SUV, MPV, hatchback, to COE cars & OPC cars. You can also buy from a car auction, look up car loans, financial services, low mileage cars, car brands, carpark rates & car insurance. Find buy used Nissan Sylphy, Nissan Sylphy Singapore, used Nissan Sylphy Singapore, used Nissan Sylphy, used vehicles Singapore or even buy used Nissan Sylphy Singapore. We have new car dealers comprising parallel importers, authorised car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner Compare sites for job openings for Singapore jobs, real estate, mover, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

os://www.sgcarmart.com/used_cars/listing.php?RGD=2018&MOD=Nissan Sylphy&RPG=20&VEH=... 21-Jan-22

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 520D

Vehicle Details

Vehicle No.: SMG7954K
Vehicle to be Exported: No
Intended Deregistration Date: 21 Jan 2022
Vehicle Make: NISSAN
Vehicle Model: SYLPHY 1.6 CVT
Primary Colour: Grey
Manufacturing Year: 2018
Engine No.: HR16937636C
Chassis No.: MNTBBAB17Z0033943
Maximum Power Output: 85.0 kW (113 bhp)
Open Market Value: \$16,509.00
Original Registration Date: 31 Dec 2018
First Registration Date: 31 Dec 2018
Transfer Count: 0
Actual ARF Paid: \$16,509.00 *8254*

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 30 Dec 2028
PARF Rebate Amount: \$12,381.00

Intended COE Rebate Details

COE Expiry Date: 30 Dec 2028
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$25,556.00
COE Rebate Amount: \$17,738.00
Total Rebate Amount: \$30,119.00

The information contained herein is correct as at 21 Jan 2022

OK

Jin, Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SMG7954K
Repairer Reference: SMG7954K
Date calculated: 19/01/2022 11:27 AM

Full Report
Registration: SMG7954K
Printed: 19/01/2022 11:27 AM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SMG7954K	Date of Incident:	15/01/22
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	NISSAN		
Model:	SYLPHY (B17T)		
Sub Model:	BASE MODEL		
Model Sheet Number:	71 PT 01		
Registration:	SMG7954K		
VIN number:	MNTBBAB17Z0033943		
Odometer:	43606		
Model Specs			
RR PARK DIST CONTROL	1.6 LTR 85 KW	GEARBOX CVT	ABS
WHEELS 5.5J X 15	WHEEL COVER 15"	TWO COAT METALLIC	PREPARE OFF VEHICLE

*Not Authorised
on
20/1/22
the ph. Selangor.
24 days.
9/2/22*

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

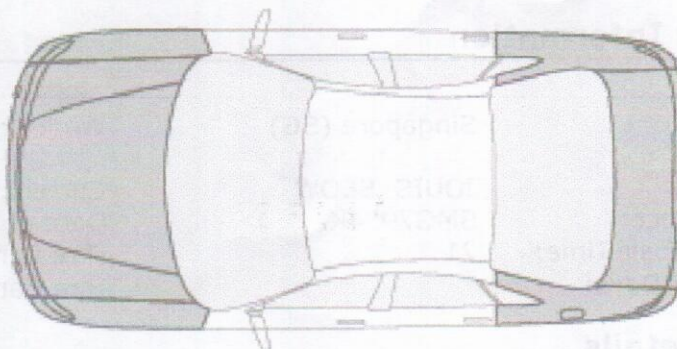

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	JOB ALLOWANCE		5.0	21.00
UA10A1	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS		9.0	37.80
VB10A1)	R + R L/R DOOR SILL COVER		1.0	4.20
VB10A1)	R + R R/R DOOR SILL COVER		1.0	4.20
UT20A1	R + R LEFT ROOF MOULDING		2.0	8.40
UT20A1	R + R RIGHT ROOF MOULDING		2.0	8.40
NO NUMBER	RENEW L/R SIDE PANEL AND END PANEL INCLUDES: R + R REAR SEAT, SEAL, TAIL LAMPS, REAR BUMPER AND ALL TRIMS IN THE REPAIR SECTION		90.0	378.00
NO NUMBER	RENEW R/R SIDE PANEL (ADD/WORK) INCLUDES: R + R TRIMS AND NECESSARY ATTACHED PARTS		50.0	210.00
8004A1)	R + R L/R QTR GLASS		7.0	29.40
8004A1)	R + R R/R QTR GLASS		7.0	29.40
NO NUMBER	RENEW LEFT REAR OUTER WHEELHOUSE		15.0	63.00

Code	Description	WU	Price SGD
NO NUMBER UC10A1)	RENEW RIGHT REAR OUTER WHEELHOUSE	15.0	63.00
	RENEW REAR BUMPER (REMOVED)	2.0	8.40
NO NUMBER	R + R L/R PARKING SYSTEM SENSOR	1.0	4.20
NO NUMBER	R + R REAR CENTRE PARKING AID SENSOR	1.0	4.20
NO NUMBER 7700A1)	R + R R/R PARKING SYSTEM SENSOR	1.0	4.20
UM10A1	R + R FUEL TANK	11.0	46.20
	RENEW BOOTLID	20.0	84.00
	INCLUDES: LOAD COMP COVER, BOTH INNER TAILLAMPS AND REQUIRED ATTACHED PARTS R + R		
UM12A1)	R + R BOOT LID BOTH HINGES	5.0	21.00
8002A1)	R + R REAR WINDOW	20.0	84.00
	INCLUDES: R + R ADDITIONAL BRAKE LAMP		
NO NUMBER	RENEW BOOT FLOOR	40.0	168.00
NO NUMBER	RENEW L/R SIDEMEMBER (COMPOSITE WORK) (REAR END PANEL AND BOOT FLOOR REMOVED)	58.0	243.60
NO NUMBER	RENEW R/R SIDEMEMBER (COMPOSITE WORK) (REAR END PANEL AND BOOT FLOOR REMOVED)	58.0	243.60
7712A1)	R + R REAR SILENCER	1.0	4.20
1781	L/R DOOR REPAIR	10 30.0*	126.00
1782	R/R DOOR REPAIR	10 30.0*	126.00
	<i>Repair front bumper 20u</i>		
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	48.20	482.0
	Total of Labour		2,024.40
			2,024.40

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	L/R BUMPER BRACKET SURFACE PAINT	4.0	
	R/R BUMPER BRACKET SURFACE PAINT	4.0	
	REAR PANEL NEW PART PAINTING	21.0	
	BOOTLID NEW PART PAINTING	13.0	
	L/R SIDE PANEL CPL NEW PART PAINTING	29.0	
	R/R SIDE PANEL CPL NEW PART PAINTING	29.0	
	BOOTFLOOR SURFACE PAINT	8.0	
	L/R SIDE MEMBER CPL SURFACE PAINT	4.0	
	R/R SIDE MEMBER CPL SURFACE PAINT	4.0	
	L/R OUTER WHEELHOUSE SURFACE PAINT	6.0	
	R/R OUTER WHEELHOUSE SURFACE PAINT	4.0	
	FRONT BUMPER NEW PART PAINT K1G/P	32.0	
	REAR BUMPER NEW PART PAINT K1R	11.0	
	L/R DOOR REPAIR PAINTING <50%	15.0	
	R/R DOOR REPAIR PAINTING <50%	15.0	

Paint Material Per Part

Code	Description	Price SGD
2627	L/R BUMPER BRACKET SURFACE PAINT	1.25
2628	R/R BUMPER BRACKET SURFACE PAINT	1.25

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	25.85
2931	BOOTLID NEW PART PAINTING	32.51
3481	L/R SIDE PANEL CPL NEW PART PAINTING	40.70
3482	R/R SIDE PANEL CPL NEW PART PAINTING	40.70
3901	BOOTFLOOR SURFACE PAINT	20.17
3991	L/R SIDE MEMBER CPL SURFACE PAINT	3.74
3992	R/R SIDE MEMBER CPL SURFACE PAINT	3.74
4161	L/R OUTER WHEELHOUSE SURFACE PAINT	9.96
4162	R/R OUTER WHEELHOUSE SURFACE PAINT	2.99
0281	FRONT BUMPER NEW PART PAINT K1G/P	129.60
2581	REAR BUMPER NEW PART PAINT K1R	51.17
1781	L/R DOOR REPAIR PAINTING <50%	25.19
1782	R/R DOOR REPAIR PAINTING <50%	25.19

Labour Cost - Paint

Factor	Hrs	WU	Price SGD
Time Paint		199.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.80	8.0	33.60
Total	10 WU/h	23.20	974.40

Material Cost - Paint

	Price SGD
New Part Painting	139.70
New Part Painting - Plastic K1R	51.17
New Part Painting - Plastic K1G/PUR	129.60
Repair Painting	50.38
Surface-/Blend Paint	43.10
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	455.35

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/0	Price SGD
3016	BADGE MODEL	84890 3RA1A	Original	su X	60.0
2977	BOOT/TAILGATE LOCK	84630 3AW0A	Original	twi ✓	60.0
3901	BOOTFLOOR	G4514 3STMA	Original	3uc ✓	500.0
4978	BOOT FLOOR CARPET	84902 3SB0A	Original	su X	260.0
2931	BOOTLID	H430M 3SMMA	Original	Buc ✓	550.0
2987	BOOT LID MOULDING	84810 3ST1A	Original	but/cro ✓	150.0
2944	BOOTLID SEAL	84830 3SB3J	Original	msu X	55.0
1002	END PANEL BOOTLID	SENSOR	Original	3uc X	80.0
3018	EQUIPMENT BADGE	84898 3RA0A		R X	0.0
0281	FRONT BUMPER	62022 3ST1H	Original	an X	380.0
0295	FRT BUMPER ABSORBER	62090 3ST0A	Original	an X	100.0
0419	FRT BUMPER GRILLE	62254 3ST0A	Original	an X	250.0
0410	GRILLE	62312 3SB0A	Original	an ✓	300.0
2953	L/BOOT HINGE	H4400 3RAMA	Original	su X	60.0
4981	L/BOOT LID TRIM	84941 3SB0A	Original	su X	225.0

Code	Description	Part Number	Part Source	Price SGD
3861	L/QTR WDW BOND KIT	KNGKWI1		0.00
2627	L/R BUMPER BRACKET	85213 EE530	Original <i>11X</i>	✓ 30.00
3307	L/R BUMPER REFLECTOR	26565 5C000	Original <i>301</i>	✓ 50.00
2625	L/R BUMP IMPACT DAMP	85093 3ST0A	Original <i>510</i>	100.00
2619	L/R INN BUMPER BRKT	85227 3ST1A	Original <i>11 X</i>	30.00
3295	L/R INNER LAMP	26559 3SB3A	Original <i>11 X</i>	✓ 90.00
3291	L/R OUTER LAMP	26559 3SB0A	Original <i>cnc</i>	✓ 260.00
4161	L/R OUTER WHEELHOUSE	G6711 3SBMA	Original <i>cnc</i>	✓ 35.00
1829	L/R QUARTER GLASS	83301 3SB1A	Original <i>R X</i>	300.00
3991	L/R SIDE MEMBER CPL	G5511 3STMA	Original <i>R X</i>	160.00
3481	L/R SIDE PANEL CPL	G8101 3RAMA	Original <i>Buc</i>	✓ 800.00
2954	R/BOOT COMPART HINGE	H4400 3RAMA	Original <i>suc X</i>	60.00
4982	R/BOOT LID TRIM	84940 3SB0A	Original <i>suc X</i>	225.00
3862	R/QTR WDW BOND KIT	KNGKWI1	<i>11 X</i>	0.00
2628	R/R BUMPER BRACKET	85212 EE530	Original <i>301</i>	✓ 30.00
3308	R/R BUMPER REFLECTOR	26560 5C000	Original <i>suc X</i>	50.00
2626	R/R BUMP IMPACT DAMP	85092 3ST0A	Original <i>11 X</i>	100.00
2620	R/R INN BUMPER BRKT	85226 3ST1A	Original <i>20</i>	30.00
3296	R/R INNER LAMP	26554 3SB3A	Original <i>cnc</i>	✓ 90.00
3292	R/R OUTER LAMP	26554 3SB0A	Original <i>cnc</i>	✓ 260.00
4162	R/R OUTER WHEELHOUSE	G6710 3SBMA	Original <i>11 X</i>	35.00
1830	R/R QUARTER GLASS	83300 3SB1A	Original <i>11 X</i>	300.00
3992	R/R SIDE MEMBER CPL	G5510 3STMA	Original <i>11 X</i>	160.00
3482	R/R SIDE PANEL CPL	G8100 3RAMA	Original <i>Buc</i>	800.00
3015	REAR BADGE	84890 3RA0A	Original <i>11 X</i>	40.00
2581	REAR BUMPER	85022 3ST6H	Original <i>Dis</i>	550.00
2711	REAR PANEL	G9110 3SBMA	Original <i>suc</i>	280.00
3160	REAR SCREEN BOND KIT	G2891 89925	<i>11</i>	0.00
3161	REAR SCREEN SEAL	G2716 89900	<i>11</i>	0.00
1000	REVERSE SENSOR	SENSOR	Original <i>chid</i>	200.00
2624	RR CTR BUMPER ABSORB	85090 3ST0A	Original <i>11 X</i>	100.00
1004	RR FENDER VENTILATOR COVER		Original <i>cnc</i>	40 80.00
1003	SPARE TYRE PANEL TOP	SPONGE	Original <i>negad</i>	160 150.00
2973	TAILGATE PILOT PIN	84620 3AW0B	Original <i>11 X</i>	50.00
4985	UPP REAR PANEL TRIM	84921 3SB0A	Original <i>Dis</i>	60 65.00
3017	VERSION BADGE	84895 3SH7A	<i>11 X</i>	0.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal
Fixed Sundry Parts Price
Total

0.00
8,540.00
100.00
8,640.00

soofhd weatherstrip \$65 11 X

*4955
P- 4964*

Final Calculation

	SGD	SGD
Parts	8,540.00	
Fixed Sundry Parts Price	100.00 ✓	
Total Parts		8,640.00
Labour Time Base 10 WU/h		
Total 482.0 WU X 42.00 SGD/h	2011.30 2,024.40	
Total of Labour		2,024.40
Paint Work Time Base 10 WU/h		
Labour Cost 232.0 WU X 42.00 SGD/h	1041.60 974.40	
Material Cost	470.71 455.31	
Total Paint Including Material		1,429.71
Repair Cost Excludes GST		12,094.11
GST (+7.00%)		846.59
Repair Cost Included GST		12,940.70

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

豐達汽車私人有限公司
FONG TAT MOTOR CO. PTE. LTD.
 Head Office: No. 3 Kallang Way 2A, FONG TAT Building Singapore 347493
 Tel: 67494998, 67479292 Fax: 67490980, 67477481 Website: www.fongtat.com
 Main Branch (Town): 355-357 Serangoon Road Singapore 218115 Tel: 62985333, 62949832
 Fax: 62982158, 62942354, 62935021
 UEN No.: 198301435R

VOICE TO: JIN AUTO SERVICES PTE LTD
 BLK 14 #01-410/412 DEPU LANE 10
 SINGAPORE 539195

SMG7954K

GST Reg. No.: M2-0059747-8

NISSAN TOYOTA OPEL OEM PARTS
 TEL: 67426889 62949832 67479292
 67426878 62985333 67455824

NISSAN TOYOTA OPEL OEM PARTS

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

TEL: 62954551

67496954

HONDA/HYUNDAI DIV

TEL: 62970688 64542288

67493588

MAZDA/FORD DIV

TEL: 62935722

67420368

AIRCON/WIS GLASS

TEL: 62952336

67495997

達汽車私人有限公司

FONG TAT MOTOR CO. PTE. LTD.

Office: No. 3 Kallang Way 2A, FONG TAT Building Singapore 347493
67494998, 67479292 Fax: 67490980, 67477481 Website: www.fongtat.com
Branch (Town): 355-357 Serangoon Road Singapore 218115 Tel: 62985333, 62949832
62992158, 62942354, 62935021
No.: 198301435R

JIN AUTO SERVICES PTE LTD

#01-410/412 DEFU LANE 10
ORE 539195

54K

GST Reg. No.: M2-0059747-8

NISSAN TOYOTA OPEL OEM PARTS
TEL: 67426889 62949832 67479292
67426878 62985333 67455824
MITSUBISHI/PROTON
TEL: 62954551
67496954
HONDA/HYUNDAI DIV
TEL: 62970688 64542288
67493588
MAZDA/FORD DIV
TEL: 62935722
67420368
AIRCON/W/S GLASS
TEL: 62952336
67495997

TAX INVOICE

TAX INVOICE NO.: CL437111
INVOICE DATE : 15/02/2022
CREDIT TERMS : 60
SALES ORDER NO.:
SALESMAN : LHK
PAGE(S) : 2

AUTHORISED STOCKISTS:

NISSAN TOYOTA OPEL
Genuine Parts GENUINE PARTS GENUINE PARTS

MAZDA
Genuine Parts

ROCKY TOKICO
GENUINE PARTS

FORD HYUNDAI

ASCOT AISI
CLUTCHES CLUTCHES WATER PUMP

ACE NIKKI OSTEN
ELECTRIC PARTS

BIKS SANKEI
ELECTRIC PARTS

DESCRIPTION	LOC.	QUANTITY	UNIT PRICE	(SIN)	(SIN)
4M400 AIR DUCT-DRAFTER *		1 PCS		40.00	40.00
3SB3A RR.BOOT LAMP RH		1 PCS		30.00	30.00
3SB3A RR.BOOT LAMP LH		1 PCS		90.00	90.00
3SB0A RR CLOSING RH		1 PCS		30.00	30.00
3SB0A RR.PANAL GARNISH		1 PCS		60.00	60.00
09321 CLIP +		2 PCS		1.00	5.00
5C000 RR.REFLECTOR LH		1 PCS		50.00	50.00
3SB0A RR.SPONGE SPACER FLOOR		1 PCS		160.00	160.00
3ST0A RR.S.RETAINER RH 3ST1A		1 PCS		30.00	30.00
3ST0A RR.S.RETAINER LH 3ST1A		1 PCS		30.00	30.00
ED000 TAIL LAMP CLIP WHITE+		1 PCS		4.00	4.00

FONG TAT MOTOR CO. PTE. LTD. GOODS SOLD ARE NOT RETURNABLE FOR CASH GOODS RECEIVED

TOTAL

ATURE

SIGNATURE

達汽車私人有限公司

FONG TAT MOTOR CO. PTE. LTD.

Office: No. 3 Kallang Way 2A, FONG TAT Building Singapore 347493
67494998, 67479292 Fax: 67490980, 67477481 Website: www.fongtat.com
Branch (Town): 355-357 Serangoon Road Singapore 218115 Tel: 62985333, 62949832
62992158, 62942354, 62935021
No.: 198301435R

JIN AUTO SERVICES PTE LTD

#01-410/412 DEFU LANE 10
ORE 539195

4K

GST Reg. No.: M2-0059747-8

NISSAN TOYOTA OPEL OEM PARTS
TEL: 67426889 62949832 67479292
67426878 62985333 67455824
MITSUBISHI/PROTON
TEL: 62954551
67496954
HONDA/HYUNDAI DIV
TEL: 62970688 64542288
67493588
MAZDA/FORD DIV
TEL: 62935722
67420368
AIRCON/W/S GLASS
TEL: 62952336
67495997

TAX INVOICE

TAX INVOICE NO.: CL437111
INVOICE DATE : 15/02/2022
CREDIT TERMS : 60
SALES ORDER NO.:
SALESMAN : LHK
PAGE(S) : 2

AUTHORISED STOCKISTS:

NISSAN TOYOTA OPEL
Genuine Parts GENUINE PARTS GENUINE PARTS

MAZDA
Genuine Parts

ROCKY TOKICO
GENUINE PARTS

FORD HYUNDAI

ASCOT AISI
CLUTCHES CLUTCHES WATER PUMP

ACE NIKKI OSTEN
ELECTRIC PARTS

BIKS SANKEI
ELECTRIC PARTS

DESCRIPTION	LOC.	QUANTITY	UNIT PRICE	(SIN)	(SIN)
3SN5A RR.BUMP.SPONGE 2019		1 PCS		100.00	100.00
GST Excl Amount :					4964.00
Special Discount :					
GST @ 7% :					347.48
					4955

FONG TAT MOTOR CO. PTE. LTD. GOODS SOLD ARE NOT RETURNABLE FOR CASH GOODS RECEIVED

TOTAL 5311.48

PRINT RV

Jin Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: SMG7954K
Repairer Reference: SMG7954K
Date calculated: 18/03/2022 4:21 PM

Full Report
Registration: SMG7954K
Printed: 18/03/2022 4:22 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SMG7954K	Date of Incident:	15/01/22
Estimated Repair Time:	21	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	NISSAN
Model:	SYLPHY (B17T)
Sub Model:	BASE MODEL
Model Sheet Number:	71 PT 01
Registration:	SMG7954K
VIN number:	MNTBBAB17Z0033943
Odometer:	43606

Model Specs

FROM 09.2018	XENON HEADLAMPS	LEATHER TRIM	DOOR WOOD INSERT
EQUIPMENT PREMIUM	RR PARK DIST CONTROL	1.6 LTR 85 KW	GEARBOX CVT
ABS	WHEELS 5.5J X 15	WHEEL COVER 15"	TWO COAT METALLIC
PREPARE OFF VEHICLE			

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	L/R OUTER WHEELHOUSE SURFACE PAINT	6.0	
	R/R OUTER WHEELHOUSE SURFACE PAINT	4.0	
	FRONT BUMPER NEW PART PAINT K1G/P	32.0	
	REAR BUMPER NEW PART PAINT K1R	11.0	
	L/R DOOR REPAIR PAINTING <50%	15.0	
	R/R DOOR REPAIR PAINTING <50%	15.0	
	REAR FLOOR C-MEMBER SURFACE PAINT	4.0	
	RR FLOOR CTR C-MEMB SURFACE PAINT	5.0	
	FLOOR PNL L/LUG COMP SURFACE PAINT	4.0	
	FLOOR PNL R/LUG COMP SURFACE PAINT	4.0	
	PARCEL SHELF PANEL SURFACE PAINT	7.0	

Paint Material Per Part

Code	Description	Price SGD
2627	L/R BUMPER BRACKET SURFACE PAINT	1.25
2628	R/R BUMPER BRACKET SURFACE PAINT	1.25
2711	REAR PANEL NEW PART PAINTING	25.85
2931	BOOTLID NEW PART PAINTING	32.51
3481	L/R SIDE PANEL CPL NEW PART PAINTING	40.70
3482	R/R SIDE PANEL CPL NEW PART PAINTING	40.70
3901	BOOTFLOOR SURFACE PAINT	20.17
3991	L/R SIDE MEMBER CPL SURFACE PAINT	3.74
3992	R/R SIDE MEMBER CPL SURFACE PAINT	3.74
4161	L/R OUTER WHEELHOUSE SURFACE PAINT	9.96
4162	R/R OUTER WHEELHOUSE SURFACE PAINT	2.99
0281	FRONT BUMPER NEW PART PAINT K1G/P	129.60
2581	REAR BUMPER NEW PART PAINT K1R	51.17
1781	L/R DOOR REPAIR PAINTING <50%	25.19
1782	R/R DOOR REPAIR PAINTING <50%	25.19
3931	REAR FLOOR C-MEMBER SURFACE PAINT	2.99
3961	RR FLOOR CTR C-MEMB SURFACE PAINT	4.98
4177	FLOOR PNL L/LUG COMP SURFACE PAINT	1.49
4178	FLOOR PNL R/LUG COMP SURFACE PAINT	1.49
4285	PARCEL SHELF PANEL SURFACE PAINT	17.43

Labour Cost - Paint

Factor	Hrs	WU	Price SGD
Time Paint		223.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.80	8.0	33.60
Total	10 WU/h	256.0	1,075.20

Code	Description	WU	Price SGD
UC10A1)	RENEW REAR BUMPER (REMOVED)	2.0	8.40 ✓
NO NUMBER	R + R L/R PARKING SYSTEM SENSOR	1.0	4.20 ✓
NO NUMBER	R + R REAR CENTRE PARKING AID SENSOR	1.0	4.20 ✓
NO NUMBER	R + R R/R PARKING SYSTEM SENSOR	1.0	4.20 ✓
7700A1)	R + R FUEL TANK	1.0	4.20 ✓
UM10A1	RENEW BOOTLID	11.0	46.20 ✓
	INCLUDES: LOAD COMP COVER, BOTH INNER TAILLAMPS AND REQUIRED ATTACHED PARTS R + R	20.0	84.00 ✓
8002A1)	R + R REAR WINDOW	20.0	84.00 ✓
	INCLUDES: R + R ADDITIONAL BRAKE LAMP	20.0	84.00 ✓
NO NUMBER	RENEW BOOT FLOOR	✓ 40.0	168.00 ✓
7712A1)	R + R REAR SILENCER	✓ 1.0	4.20 ✓
PW10A1)	R + R LEFT REAR WHEEL	1.0	4.20 ✓
PW10A1)	R + R RIGHT REAR WHEEL	1.0	4.20 ✓
PC10A1)	R + R LEFT REAR BRAKE DRUM (WHEEL REMOVED)	1.0	4.20 ✓
PC10A1)	R + R RIGHT REAR BRAKE DRUM (WHEEL REMOVED)	1.0	4.20 ✓
PC11A1)	R + R REAR BRAKE DRUMS ADD WORK	1.0	4.20 ✓
7604A1)	L/R COIL SPRING DETACH + REFIT	2.0	8.40 ✓
7604A1)	R/R COIL SPRING DETACH + REFIT	2.0	8.40 ✓
7604A1)	R + R LEFT REAR SHOCK ABSORBER	2.0	8.40 ✓
7604A1)	R + R RIGHT REAR SHOCK ABSORBER	2.0	8.40 ✓
7605A1)	ADD/WORK FOR R + R REAR SHOCK ABSORBER	2.0	8.40 ✓
0281	FRONT BUMPER REPAIR	20.0*	84.00
1781	L/R DOOR REPAIR	30.0*	126.00
1782	R/R DOOR REPAIR	30.0*	126.00
3931	REAR FLOOR C-MEMBER REPAIR	50.0*	210.00
3961	RR FLOOR CTR C-MEMB REPAIR	50.0*	210.00
3992	R/R SIDE MEMBER CPL REPAIR	50.0*	210.00
4001	L/S-MEMBER END PANEL REPAIR	50.0*	210.00
4002	R/S-MEMBER END PANEL REPAIR	60.0*	252.00
4177	FLOOR PNL L/LUG COMP REPAIR	60.0*	252.00
4178	FLOOR PNL R/LUG COMP REPAIR	40.0*	168.00
4285	PARCEL SHELF PANEL REPAIR	40.0*	168.00
		20	45.0*
		20	84.00
		30	126.00
		30	126.00
		30	210.00
		30	210.00
		20	210.00
		25	252.00
		25	252.00
		X	40.0*
		X	40.0*
		20	45.0*
		76.40	3,208.80
		764.0	3,208.80
			3,208.80

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	L/R BUMPER BRACKET SURFACE PAINT	4.0	
	R/R BUMPER BRACKET SURFACE PAINT	4.0	
	REAR PANEL NEW PART PAINTING	21.0	
	BOOTLID NEW PART PAINTING	13.0	
	L/R SIDE PANEL CPL NEW PART PAINTING	29.0	
	R/R SIDE PANEL CPL NEW PART PAINTING	29.0	
	BOOTFLOOR SURFACE PAINT	8.0	
	L/R SIDE MEMBER CPL SURFACE PAINT	4.0	
	R/R SIDE MEMBER CPL SURFACE PAINT	4.0	

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

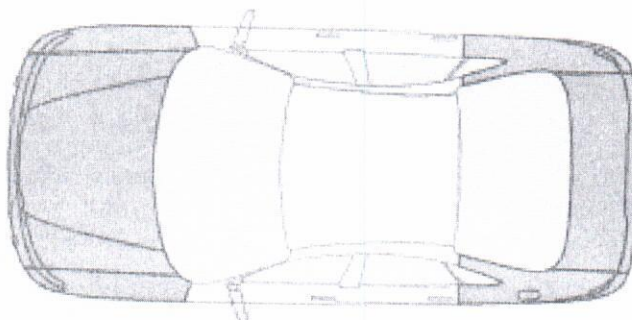

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	JOB ALLOWANCE		5.0	21.00
UA10A1)	R + R FRONT BUMPER		6.0	25.20
	INCLUDES: R + R FRONT GRILL			
UA18A1	R + R FRONT BUMPER GRILLE	4.00	5.0	21.00
NO NUMBER	R + R FRONT NUMBER PLATE		1.0	4.20
VB10A1)	R + R L/R DOOR SILL COVER		1.0	4.20
VB10A1)	R + R R/R DOOR SILL COVER		1.0	4.20
UT20A1	R + R LEFT ROOF MOULDING		2.0	8.40
UT20A1	R + R RIGHT ROOF MOULDING		2.0	8.40
NO NUMBER	RENEW L/R SIDE PANEL AND END PANEL		90.0	378.00
	INCLUDES: R + R REAR SEAT, SEAL, TAIL LAMPS, REAR BUMPER AND ALL TRIMS IN THE REPAIR SECTION			
NO NUMBER	RENEW R/R SIDE PANEL (ADD/WORK)		50.0	210.00
	INCLUDES: R + R TRIMS AND NECESSARY ATTACHED PARTS			
8004A1)	R + R L/R QTR GLASS		7.0	29.40
8004A1)	R + R R/R QTR GLASS		7.0	29.40

Material Cost - Paint

New Part Painting	Price SGD
New Part Painting - Plastic K1R	139.76
New Part Painting - Plastic K1G/PUR	51.17
Repair Painting	129.60
Surface-/Blend Paint	50.38
Material-constant Metal Preparation	71.48
Material-constant Plastic	28.60
Total	12.70
	483.69

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01 Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	35.00
1830	R/R QUARTER GLASS	83300 3SB1A	Original	0.00
1831	L/R QUARTER GLASS	83301 3SB1A		0.00
2581	REAR BUMPER	85022 3ST6H*	Original	550.00
2620	R/R INN BUMPER BRKT	85226 3ST1A*	Original	30.00
2624	RR CTR BUMPER	85090 3ST0A*	Original	100.00
	ABSORB			
2627	L/R BUMPER BRACKET	85213 EE530*	Original	30.00
2628	R/R BUMPER BRACKET	85212 EE530*	Original	30.00
2711	REAR PANEL	G9110 3SBMA*	Original	280.00
2931	BOOTLID	H430M 3SMMA*	Original	550.00
2977	BOOT/TAILGATE LOCK	84630 3AW0A*	Original	60.00
2987	BOOT LID MOULDING	84810 3ST1A*	Original	150.00
3015	REAR BADGE	84890 3RA0A	Original	0.00
3016	BADGE MODEL	84890 3RA1A	Original	0.00
3017	VERSION BADGE	84895 3SH7B*	Original	0.00
3018	EQUIPMENT BADGE	84898 3RA0A*	Original	0.00
3160	REAR SCREEN BOND KIT	G2891 89925		0.00
3161	REAR SCREEN SEAL	G2716 89900		0.00
3291	L/R OUTER LAMP	26559 3SB0A*	Original	260.00
3292	R/R OUTER LAMP	26554 3SB0A*	Original	260.00
3295	L/R INNER LAMP	26559 3SB3A	Original	90.00
3296	R/R INNER LAMP	26554 3SB3A	Original	90.00
3307	L/R BUMPER REFLECTOR	26565 5C000	Original	50.00
3481	L/R SIDE PANEL CPL	G8101 3RAMA	Original	800.00
3482	R/R SIDE PANEL CPL	G8100 3RAMA	Original	800.00
3861	L/QTR WDW BOND KIT	KNGKWI1		0.00
3862	R/QTR WDW BOND KIT	KNGKWI1		0.00
3901	BOOTFLOOR	G4514 3STMA*	Original	500.00
4985	UPP REAR PANEL TRIM	84921 3SB1A*	Original	60.00
1003	SPARE TYRE PANEL TOP	SPONGE	Original	160.00
1004	RR FENDER VENTILATOR COVER		Original	40.00
1005	bootlidweatherstrip	SUPPLEMENTARY	Original	65.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			4,990.00
u: Used parts	Fixed Sundry Parts Price			100.00
	Total			5,090.00

Extras

Code	Description	Price SGD
------	-------------	-----------

Code	Description	Price SGD
1000	REVERSE SENSOR SENSOR	200.00*
	Total Extras	200.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	4,990.00	
Total Parts	100.00	5,090.00
Labour Time Base 10 WU/h		
Total 764.0 WU X 42.00 SGD/h	3,208.80	
Total of Labour		3,208.80
Total Of Extras		200.00
Paint Work Time Base 10 WU/h		
Labour Cost 256.0 WU X 42.00 SGD/h	1,075.20	
Material Cost	483.69	
Total Paint Including Material		1,558.89
Repair Cost Excludes GST		10,057.69
GST (+7.00%)		704.04
Repair Cost Included GST		10,761.73

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.