



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2203643
3 ANSON ROAD #16-00	INV Date	13/06/2022
SPRINGLEAF TOWER	Reference	CC6/CTI22000857/Apa3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	PD 500M
Insured Veh.	GBG 1953H
Claim No.	SNM22D200635/C02
Policy No.	DMCVSNW00058712102
Accident Date	22/01/2022
Inspection Date	24/01/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22000857/Apa3q2 Date: 13/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBG 1953H	Veh. Inspected	PD 500M
Policy No.	DMCVSNW00058712102	Coverage (\$)	0.00
Claim No.	SNM22D200635/C02	Excess (\$)	0.00
Assign From		Assign Date	24/01/2022
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA HIACE	c.c	2982
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	KDH2230022567	Colour	WHITE
Odometer	351153 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/ R15C	BRIDGESTONE	6 mm
L/H Front Tyre	195/ R15C	BRIDGESTONE	6 mm
R/H Rear Tyre	195/ R15C	BRIDGESTONE	6 mm
L/H Rear Tyre	195/ R15C	BRIDGESTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	22/01/2022	Inspection Date	24/01/2022
Survey held at	YSK AUTO WORKSHOP 1 KAKI BUKIT AVE 6 @ AUTOBAY #01-71 SINGAPORE 417883		
5a. Remarks			
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. PD 500M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT LH DOOR	DISTORTED	1,795.80	1,611.00
1	FRONT LH DOOR LOCK	NOT NECESSARY	292.30	-
1	FRONT LH DOOR WEATHERSTRIPE	NOT NECESSARY	272.50	-
1	FRONT LH DOOR INNER TRIM BOARD	CRACKED	586.90	449.40
1	FRONT LH DOOR GLASS REGULATOR	DAMAGED	245.90	245.90
1	FRONT LH DOOR GLASS REGULATOR MOTOR	NOT NECESSARY	475.00	-
1	FRONT LH DOOR WING MIRROR	CUT	778.00	549.00
1	FRONT LH STEP GARNISH	NOT NECESSARY	221.40	-
	LESS 25% DISCOUNT		-	-713.83
			4,667.80	2,141.47
<u>SPECIAL NETT ITEMS</u>				
1	FRONT LH DOOR INNER TRIM BOARD CLIPS (SN)	NECESSARY	30.00	30.00
1	FRONT LH STEP GARNISH CLIPS (SN)	NOT NECESSARY	20.00	-
			50.00	30.00
<u>LABOUR</u>				
	PANEL BEATING.		400.00	200.00
	SPRAY PAINTING.		400.00	200.00
	WIRING.		50.00	30.00
	TO TRANSFER DOOR FITTINGS.		150.00	80.00
			1,000.00	510.00
GRAND TOTAL			5,717.80	2,681.47
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,100.00

Report Ref No. CC6/CTI22000857/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PD 500M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. PD 500M

RE-INSPECTION

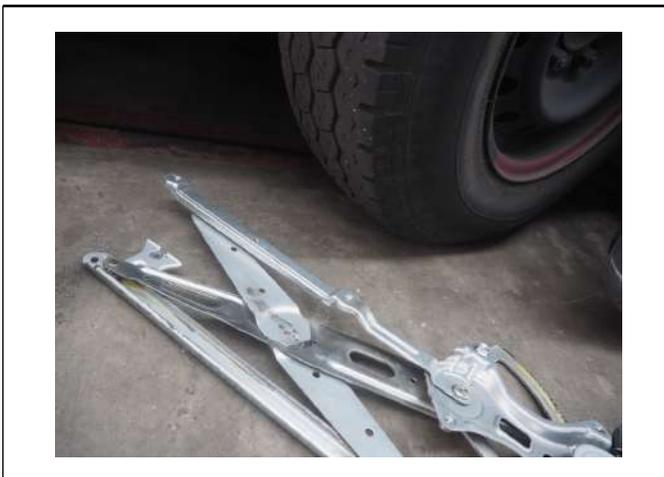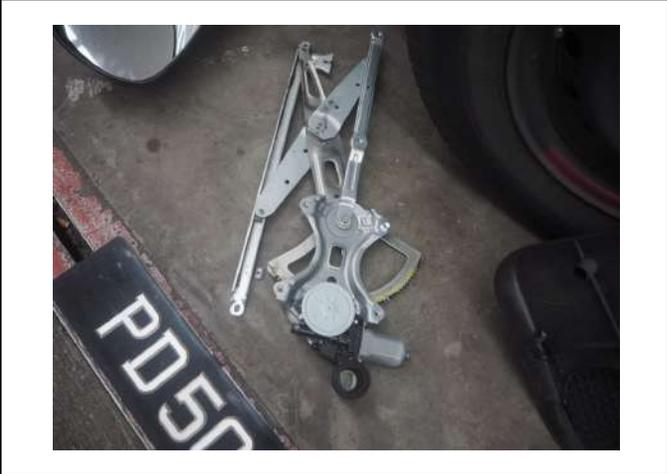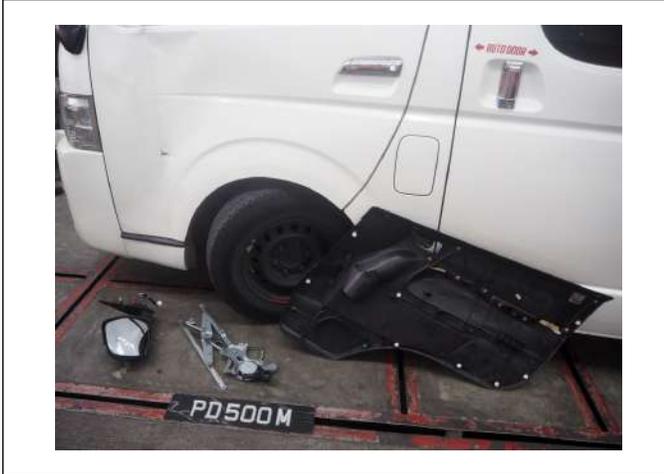



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

