



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2301215

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 01/03/2023
Reference CC6/CTI22000875/Uya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLL 882R

Insured Veh. GBJ 9496S

Claim No. SNM22D200650/C02/SNM22D200650/CHEE
SC

Policy No. DMCVSNW0013962100

Accident Date 03/12/2021

Inspection Date 19/01/2022

Description	Total
Survey Inspection	280.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	280.00
GST (8%)	22.40
Grand Total	302.40

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22000875/Uya3q2	
			Date: 01/03/2023	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBJ 9496S	Veh. Inspected	SLL 882R	
Policy No.	DMCVSNW0013962100	Coverage (\$)	0.00	
Claim No.	SNM22D200650/C02/SNM22D200650/CHEESC	Excess (\$)	0.00	
Assign From		Assign Date	19/01/2022	
2. Vehicle Particulars & Condition				
Make & Model	B.M.W 523I (A)	c.c	2497	
Engine No.	HIDDEN	Year of Reg.	2011	
Chassis No.	WBAFP32010C868198	Colour	WHITE	
Odometer	233891 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	255/35Z R20	MICHELIN	6 mm	
L/H Front Tyre	255/35Z R20	MICHELIN	6 mm	
R/H Rear Tyre	285/30Z R20	MICHELIN	6 mm	
L/H Rear Tyre	285/30Z R20	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/12/2021	Inspection Date	19/01/2022	
Survey held at	MY CAR CONSULTANT PTE LTD 60 JALAN LAM HUAT #05-21 CARROS CENTRE SINGAPORE 737869			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLL 882R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOTLID	TO REPAIR SEE LABOUR	2,631.40	-
1	BOOTLID WEATHERSTRIP	NOT NECESSARY	355.60	-
1	BOOTLID INNER LOCK	NOT NECESSARY	488.80	-
1	BOOTLID LAMP RH	NOT NECESSARY	321.20	-
1	BOOTLID EMBLEM '523I'	NOT NECESSARY	139.20	-
2	REVERSE SENSOR @\$251.90	SERVICEABLE	503.80	-
1	REAR BUMPER TOWING COVER	TORN	112.90	38.00
1	REAR BUMPER REFLECTOR RH	NOT NECESSARY	86.30	-
1	REAR BUMPER CENTER GARNISH BRACKET	NOT NECESSARY	481.70	-
1	REAR BUMPER REINFORCEMENT	DENTED	1,394.80	615.00
2	REAR BUMPER REINFORCEMENT SUPPORT @\$230.50	CRACKED	461.00	195.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	1,661.70	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	345.70	-
1	TAILLAMP RH	NOT NECESSARY	1,455.70	-
	LESS 5% DISCOUNT		-521.99	-42.40
			9,917.81	805.60
1	EXHAUST PIPE TIP (SN)	TWISTED	1,332.40	380.00
	LESS 5% DISCOUNT		-66.62	-
			1,265.78	380.00
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER SPORT (SN)	DISTORTED	2,500.00	1,800.00
1	REAR BUMPER DIFFUSER CARBON (SN)	CRACKED	1,500.00	980.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	50.00
1	SET REAR END PANEL TOP GARNISH CLIP (SN)	NOT NECESSARY	65.00	-
1	SET TAILLAMP CLIP (SN)	NOT NECESSARY	35.00	-
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	80.00	-
			4,260.00	2,830.00

Report Ref No. CC6/CTI22000875/Uya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	CUT OFF REPLACE REAR END PANEL AND FLOOR PANEL ,STRAIGHTEN,REALIGN REAR CHASSIS FRAME AND RENEW OTHER DAMAGE PARTS .INCLUSIVE OF THE REPAIR OF REAR END PANEL AND BOOTLID.		1,000.00	400.00
	TO SPRAY PAINT ON AFFECTED AREA .		1,000.00	600.00
	TO APPLY TUFF COAT ON PAINTING AREA.	NOT NECESSARY	250.00	-
	REMOVE AND INSTALL REAR PARKING SENSOR AND WIRING HARNESS .PERFORM DISTANCE SENSORY TESTING.		80.00	50.00
	REMOVE AND INSTALL CUSHION SEAT /UPHOLSTERY AND REAR COMPARTMENT LINNING TO FACILITATE REPAIR .		250.00	60.00
	PERFORM REAR LIGHTING WIRING CHECK AND TEST FUNCTION .		100.00	20.00
	TRANSFER REAR BOOT ATTACHMENT AND MECHANISM INTO NEW BOOT LID .	NOT NECESSARY	200.00	-
	PERFORMED DIAGNOSTIC CHECK AND RESET ANY FAULT CODE IF NECESSARY .	NOT NECESSARY	120.00	-
	DISMANTLE AND INSTALL EXHAUST PIPE SYSTEM TO ENABLE REPAIRS.	NOT NECESSARY	150.00	-
			3,150.00	1,130.00
GRAND TOTAL			18,593.59	5,145.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,100.00

Report Ref No. CC6/CTI22000875/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLL 882R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

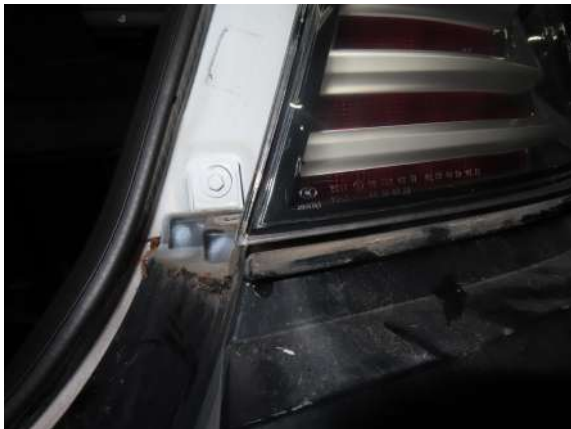



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLL 882R

RE-INSPECTION

