

(08/11/13) wef
ASS. REC. BY: JSB

REF:

CS/CTI 22000908 Rty3


6160

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: SLL 4483H
at Workshop m/s Auto / NAW26
of 6, MARSLIN LN
Insured: CTI
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: TBA
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

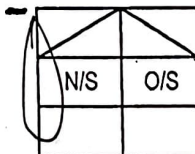

Bal. or Market Value: 66K
IDAC Accident Rpt: _____ Consistent? : Yes or No
GIA / PR Seen: _____ Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Date / Time Action / Instruction

REPAIR LIMIT - 23K

Veh No: SLL 4483H Yr Regn: 2017 / FEB
Type M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or _____
Make: MAZDA 6 SEDAN 2.0L SP c.c. 1998
Colour: BROWN A/C: Insured / Std / NI / NA
Sp. Reading: 67960 T/Radio: Insured / Std / NI / NA
Eng/No: _____
C/No: JM66L/071H0105377
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Leaked / Burnt or
Brake: In order / Jammed / Leaked / Burnt or
Modi: Nil / S/Rim / STD A/Rim or
Tyre Size: F: 255/35ZR19
R: _____
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO/YOKO or HABILEAP
Front Rear
R/Bal. 6 mm R/Bal. 6 mm
L/Bal. 6 mm L/Bal. 6 mm
D.O.A. 13/01/22 D.O.I. 26/01/22
Survey held at Auto/INSURE
Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or
The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

): S + RS SI

☐

: Interview (\$

): Photos

☐

: Tech. Invs (\$

): Others

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

Auto Insure Pte. Ltd
Marsiling Lane
739145



Insurer Reference: SLL4483H
Repairer Reference: M4083/SLL4483H
Date calculated: 25/01/2022 11:19 AM

Full Report
Registration: SLL4483H
Printed: 25/01/2022 11:19 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Marvyn Chua	Currency:	SGD
Claim Reference:	SLL4483H	Date of Incident:	13/01/22
Estimated Repair Time:	14	Hire Car Start:	
Actual Repair Days:	14	Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MAZDA
Model:	6 (GL)
Sub Model:	BASE MODEL
Model Sheet Number:	36 M6 01
Registration:	SLL4483H
VIN number:	JM6GL1071H0105377
Odometer:	67960

Model Specs

FOG LAMPS	2.0 LTR 121KW	6-SPEED GEARBOX	TWO COAT METALLIC
-----------	---------------	-----------------	-------------------

File Condition


File Status

Accident Damage:

File of Inspection:

Image Areas

All ☐
Underbody ☐

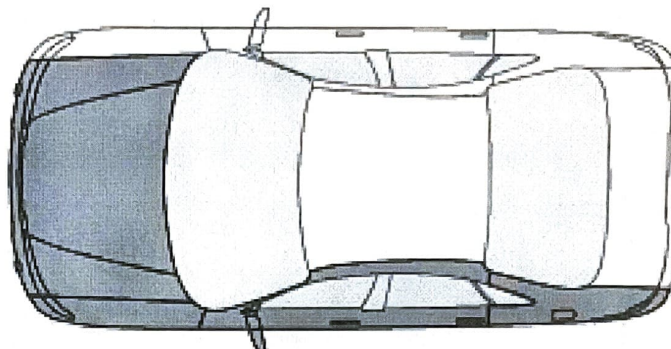

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
A0109E-A-X	ALIGN + ADJUST FRONT AND REAR		12.0	50.40
S0201X-R-X	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS		7.0	29.40
S0612X-R-X)	R + R FRONT PANEL		1.0	4.20
S1401A-R-X)	R + R FRONT SCREEN INCLUDES: R + R WIPER ARMS, COWL GRILLE AND INTERIOR MIRROR		20.0	84.00
T0301Z-R-X)	R + R HEADLAMPS (BUMPER REMOVED) INCLUDES: ADJUST HEADLAMPS		4.0	16.80
S0503X-R-X	RENEW BONNET INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE		5.0	21.00
NO NUMBER	R + R UPPER RADIATOR GRILLE TRIM		2.0	8.40
S0201X-R-X)	R + R FRONT BUMPER SUPPORT		10.0	42.00
T0106X-R-X)	R + R HOUSING		23.0	96.60
NO NUMBER	R + R RADIATOR GRILLE LOWER TRIM		1.0	4.20

Description
WU Price SGD

4B-R-X)	R + R L/BONNET SEAL	1.0	4.20
11B-R-X)	RENEW L/F WING	3.0	12.60
	INCLUDES: WING, WHEELHOUSE AND HEADLAMP REMOVE + REFIT		
	NOT INCLUDED : FRONT BUMPER R + R		
	ADJUST HEADLAMPS		
NO NUMBER	RENEW LEFT FRONT WHEEL HOUSE BRACKET	5.0	21.00
S0504A-R-X)	R + R R/BONNET HINGE	1.0	4.20
T0304A-R-X)	R + R R/HEADLAMP	2.0	8.40
	(BUMPER REMOVED)		
	INCLUDES: ADJUST HEADLAMP		
S0431Z-R-ZAX	R + R LEFT ROOF MOULDING	2.0	8.40
S2201B-R-X)	R + R L/HEAD AIRBAG	2.0	8.40
NO NUMBER	REPLACE L/B-PILLAR/SILL ADD/WORK	119.0	499.80
S1001B-R-X	RENEW L/F DOOR	16.0	67.20
	INCLUDES: R + R LEFT FRONT DOOR, ALL		
	ADD ON PARTS ASSEMBLE AND DOOR ADJUST		
S1101B-R-X	RENEW L/R DOOR	16.0	67.20
	INCLUDES: R + R REAR DOOR,		
	CONVERT ALL ATTACHED PARTS,		
	ADJUST DOOR		
S2202A-R-X)	R + R R/F SIDE AIRBAG SENSOR	1.0	4.20
S1402X-R-X	R + R REAR SCREEN	21.0	88.20
S2202B-R-X)	R + R L/R SIDE AIRBAG SENSOR	2.0	8.40
S2202A-R-X)	R + R R/R SIDE AIRBAG SENSOR	2.0	8.40
NO NUMBER	DETACH + REFIT FLOOR CARPET	4.0	16.80
S1701X-R-X	R + R HEADLINING	14.0	58.80
	INCLUDES: R + R SUN VISORS, ROOF GRAB		
	HANDLES, ROOF INTERIOR LAMP AND UPPER		
	PILLAR TRIMS		
S0901Z-R-X	R + R FRONT SEATS	4.0	16.80
S0919A-R-X)	R + R RIGHT FRONT SEAT BELT	1.0	4.20
S0905B-R-X)	R + R LEFT FRONT SEAT REST COVER	3.0	12.60
S2201B-R-X)	R + R L/SIDE AIRBAG	1.0	4.20
S0708X-R-X)	R + R INSTRUMENT PANEL	15.0	63.00
	(FRT SEAT AND CENTRE CONSOLE REMOVED)		
	INCLUDES:REQUIRED TRIMS REMOVE AND REFIT		
S0803X-R-X	R + R CENTRE CONSOLE INSERT	3.0	12.60
S2206X-R-X	R + R AIRBAG CONTROL UNIT	5.0	21.00
F0105X-R-X	R + R INTAKE AIR INSULATOR FILTER	3.0	12.60
NO NUMBER	ADJUST L/MIRROR CAMERA	6.0	25.20
NO NUMBER	DETACH + REFIT EXHAUST	3.0	12.60
F0702X-R-X)	R + R CATALYST	6.0	25.20
M0101B-R-X)	R + R LEFT DRIVE GEAR CPL	8.0	33.60
M0201B-R-X)	R + R L/F STEERING KNUCKLE	5.0	21.00
R0106B-R-X)	R + R L/F CONTROL ARM REAR	3.0	12.60
R0109B-R-X)	R + R LEFT FRONT SHOCK ABSORBER	3.0	12.60
NO NUMBER	DETACH + REFIT L/FR BRAKE CALIPER	1.0	4.20
NO NUMBER	DIS + ASS L/F SHOCK ABSORBER/COIL SPRING	2.0	8.40
R0402B-R-X	R + R L/F STABILIZER CONNECTING ROD	3.0	12.60
Q0103A-R-X)	RENEW L/F WHEEL (REMOVED)	3.0	12.60
NO NUMBER	R + R REAR AXLE SUPPORT	5.0	21.00
Q0103A-R-X)	RENEW L/R WHEEL (REMOVED)	3.0	12.60
R0504B-R-X)	R + R L/REAR TRAILING LINK	3.0	12.60
M0310B-R-X)	R + R L/REAR DRIVE SHAFT END	5.0	21.00

Description		WU	Price SGD
5B-R-X)	R + R L/RR CONTROL ARM	2.0	8.40
NUMBER	DETACH + REFIT L/R BRAKE CALIPER	1.0	4.20
13B-R-X)	R + R L/R SWING ARM	1.0	4.20
42	R/F WING REPAIR	10.0*	42.00
.17	L/F WHEELHOUSE REPAIR	20.0*	84.00
133	L/F W-HOUSE REINF REPAIR	20.0*	84.00
1201	L/F INN SIDE MEMBER REPAIR	30.0*	126.00
3481	L/RR SIDE PANEL REPAIR	30.0*	126.00

Labour Cost	Hrs	WU	
Panel / Mechanical Labour	49.20	492.0	2,066.40
Alignment			
Measuring Work	1.20	12.0	50.40
Total of Labour			2,116.80

Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU	Price SGD
	BONNET NEW PART PAINTING	26.0	
	L/F WING NEW PART PAINTING	11.0	
	L/F LWR WING BRACKET SURFACE PAINT	4.0	
	RADIATOR CROSSMEMBER SURFACE PAINT	4.0	
	L/F W-HOUSE SUPPORT SURFACE PAINT	4.0	
	LEFT FRONT DOOR NEW PART PAINTING	16.0	
	L/R DOOR NEW PART PAINTING	15.0	
	L/B-PILLAR/SILL NEW PART PAINTING	38.0	
	FRONT BUMPER NEW PART PAINT K1R	10.0	
	R/F WING REPAIR PAINTING >50%	17.0	
	L/RR SIDE PANEL REPAIR PAINTING >50%	24.0	
	L/F WHEELHOUSE SURFACE PAINT	6.0	
	L/F W-HOUSE REINF SURFACE PAINT	4.0	
	L/F INN SIDE MEMBER SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	88.24
0741	L/F WING NEW PART PAINTING	23.74
0793	L/F LWR WING BRACKET SURFACE PAINT	1.25
1021	RADIATOR CROSSMEMBER SURFACE PAINT	4.48
1131	L/F W-HOUSE SUPPORT SURFACE PAINT	3.74
1481	LEFT FRONT DOOR NEW PART PAINTING	45.41
1781	L/R DOOR NEW PART PAINTING	39.73
2279	L/B-PILLAR/SILL NEW PART PAINTING	57.75
0281	FRONT BUMPER NEW PART PAINT K1R	46.25
0742	R/F WING REPAIR PAINTING >50%	18.17
3481	L/RR SIDE PANEL REPAIR PAINTING >50%	31.21
1117	L/F WHEELHOUSE SURFACE PAINT	11.45
1133	L/F W-HOUSE REINF SURFACE PAINT	4.48
1201	L/F INN SIDE MEMBER SURFACE PAINT	2.49

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			183.0	
Preparation Main Work Metal		2.10	21.0	88.20
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	20.90	209.0	877.80

Material Cost - Paint

New Part Painting	Price SGD
New Part Painting - Plastic K1R	254.87
Repair Painting	46.25
Surface-/Blend Paint	49.38
Material-constant Metal	27.89
Material-constant Plastic	18.10
Total	9.00
	405.49

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	
				Price SGD	
7440	AIRBAG CONTROL UNIT	GMC857K30A	Original <i>ha</i> ✓	900.00	
8402	AIR FILTER LWR HSG	PE01133AY	Original ?	60.00	
8401	AIR FILTER UPPER HSG	PE01133AX	Original <i>con</i> ✓	45.00	
0471	BONNET	GHY05231X	Original <i>lt</i> ✓	540.00	
0481	BONNET INSULATION	GHP956681	Original <i>de</i> ✓	80.00	
0524	FRONT BONNET SEAL	GHP956770	Original <i>ne</i> ✓	90.00	
0527	FRONT BONNET SEAL	GHP956750	Original <i>ne</i> ✓	20.00	
0281	FRONT BUMPER	GHP950031C8N	Original <i>Joan</i> ✓	540.00	
1009	FRONT PANEL	GHP953110B	Original <i>lt</i> ✓	165.00	
0340	FRT BUMPER SUPPORT	GHP950070A	Original <i>lt</i> ✓	345.00	
0295	FRT TOWING EYE COVER	GHP950A11A64	Original <i>mis</i> ✓	15.00	
9661	FUSE BOX	TK4866760	Original <i>con</i> ✓	300.00	
0416	GRILLE FRAME	GHP950717D	Original <i>con</i> ✓	45.00	
4957	HEADLINING	GHK16803ZE75	Original <i>de</i> ✓	1,500.00	
0411	L/AIR GRILL LWR TRIM	GHP9507K1C	Original <i>mis</i> ✓	100.00	
1393	L/A-PILLAR COVER	GJE8507S0A	Original ?	145.00	
0475	L/BONNET HINGE	GHP952420B	Original <i>lt</i> ✓	30.00	
2279	L/B-PILLAR/SILL	GHY371271	Original ?	580.00	
1751	L/D/MIRROR INDICATOR	B63B69182A	Original <i>seal</i> ✓	55.00	
1737	L/DOOR MIRROR	GRR569181A	Original <i>bro</i> ✓	255.00	
1743	L/DOOR MIRROR GLASS	B62S691G7	Original X	35.00	
1741	L/DOOR MIRROR HSG	B63B691N764	Original <i>con</i> ✓	70.00	
1749	L/DOOR MIRROR TRIM	GHP96916YB	Original <i>gor</i> ✓	25.00	
4589	L/F BACKREST COVER	HK288181B02	Original <i>form</i> ✓	11,400.00	
0319	L/F BUMPER BRACKET	GHP9500U1C	Original <i>con</i> ✓	25.00	
0347	L/F BUMPER COVER	GHR450C21A	Original <i>cut</i> ✓	30.00	
1577	L/F DOOR LOCK	GJE859310A	Original <i>lt</i> ✓	165.00	
1565	L/F DOOR OUT HANDLE	KD475941XG64	Original <i>seal</i> ✓	130.00	
1659	L/F DOOR REAR STRIP	GHP950M20D	Original X	30.00	
1509	L/F DOOR SEAL	GHP959760C	Original <i>ne</i> ✓	50.00	
1519	L/F DOOR WINDOW	GRT7595109D	Original <i>repair</i> ✓	180.00	
7035	L/F DRIVE SHAFT	GDB72560X	Original ?	600.00	
0641	L/F FOG LAMP CPL	TK2151690A	Original <i>con</i> ✓	150.00	
1585	L/F HANDLE BRACKET	GHP95942XD	Original <i>ne</i> ✓	50.00	
1591	L/F HANDLE SEAL	KD5359414	Original <i>ne</i> ✓	10.00	

	Description	Part Number	Part Source	Price SGD
	L/F HANDLE TRIM	KD5359415B51	Original <i>ms</i> ✓	15.00
	L/F HEADLAMP	GJE8510L0D	Original <i>bro</i> ✓	460.00
	L/F LWR CONTROL ARM	G46C34350J	Original <i>?</i>	230.00
3	L/F LWR WING BRACKET	GHP956115B	Original <i>bt</i> ✓	15.00
45	L/FOG LAMP BRACKET	GHR451694A	Original <i>ca</i> ✓	25.00
77	L/FR SHOCK ABSORBER	GML834900A	Original <i>?</i>	190.00
201	L/FR WHEEL	9965077570CN	Original <i>scz</i> ✓	820.00
4611	L/F S/AIRBAG SENSOR	G46C57KC0A	Original <i>na</i> ✓	75.00
4661	L/F SEAT BELT	GJE857L9002	Original <i>ms</i> ✓	1,080.00
7271	L/F STABILISER ROD	KD3534170	Original <i>?</i>	50.00
1661	L/F UPP DOOR MLDG	GHP950650F	Original <i>de</i> ✓	85.00
1643	L/F UPP DOOR STRIPE	GHP950985G	Original <i>X</i>	75.00
4885	L/F UPP WING INSULAT	GHP956916B	Original <i>na</i> ✓	30.00
0841	L/F WHEELHOUSE COVER	GHP956140J	Original <i>Turn</i> ✓	55.00
7131	L/F WHEEL HUB	KD353304XF	Original <i>?</i>	235.00
1131	L/F W-HOUSE SUPPORT	GHP954140	Original <i>bt</i> ✓	70.00
0741	L/F WING	GHP952211A	Original <i>bro</i> ✓	160.00
0791	L/F WING BRACKET	GHP952240D	Original <i>bt</i> ✓	35.00
4631	L/HEAD AIRBAG	GBJD57KN0B	Original <i>ms</i> ✓	1,380.00
0555	L/HEADLAMP W-HARNESS	GJT1510K6	Original <i>?</i>	145.00
4949	L/LWR B-PILLAR TRIM	GHP968230B02	Original <i>de</i> ✓	75.00
1399	L/LWR COWL TRIM	GHP951PC1A	Original <i>scz</i> ✓	20.00
9315	L/R CONTROL ARM	GBFN28C10	Original <i>?</i>	115.00
9385	L/R CONTROL ARM	GHP928500	Original <i>?</i>	84.00
1781	L/R DOOR	GHY17302XB	Original <i>bt</i> ✓	580.00
1959	L/R DOOR FRONT STRIP	GHP950M40D	Original <i>X</i>	60.00
1877	L/R DOOR LOCK	GHK373310A	Original <i>?</i>	255.00
1963	L/R DOOR REAR STRIP	GHK150M60A	Original <i>X</i>	55.00
1795	L/R LOWER DOOR HINGE	KD5373240A	Original <i>bt</i> ✓	30.00
9551	L/RR WHEEL	9965077570CN	Original <i>bro</i> ✓	820.00
4613	L/R S/AIRBAG SENSOR	KD4557KC0A	Original <i>na</i> ✓	75.00
9113	L/R STRG KNUCKLE	GHR12612XB	Original <i>?</i>	300.00
1961	L/R UPP DOOR MLDG	GHK150670E	Original <i>X</i>	55.00
1813	L/R UPP DOOR STRIPE	GHK150995H	Original <i>X</i>	0.00
1787	L/R UPPER DOOR HINGE	KD5373210A	Original <i>bt</i> ✓	30.00
9181	L/R WHEEL HUB/BRG	KD312615XB	Original <i>?</i>	235.00
4607	L/SIDE AIRBAG	GMA457KB0	Original <i>ms</i> ✓	1,260.00
7081	L/STEERING KNUCKLE	GHP933031A	Original <i>?</i>	180.00
7091	L/SUPPORT BEARING	KD3534380C	Original <i>?</i>	45.00
9325	L/TRAILING ARM	G46E28250D	Original <i>?</i>	120.00
4951	L/UPP B-PILLAR TRIM	GHP968210A75	Original <i>?</i>	265.00
1481	LEFT FRONT DOOR	GHY05902XJ	Original <i>bt</i> ✓	460.00
0797	LEFT RETAINER	B45A56146A	Original <i>ca</i> ✓	60.00
9663	MODULE BOX COVER	KD456676YF	Original <i>de</i> ✓	60.00
0476	R/BONNET HINGE	GHP952410B	Original <i>bt</i> ✓	30.00
4612	R/F S/AIRBAG SENSOR	G46C57KC0A	Original <i>na</i> ✓	75.00
4662	R/F SEAT BELT	GJE857L3002	Original <i>?</i>	1,020.00
4614	R/R S/AIRBAG SENSOR	KD4557KC0A	Original <i>?</i>	75.00
1021	RADIATOR	G46L53150	Original <i>?</i>	115.00
	CROSSMEMBER			
0415	UPP RAD GRILLE COVER	GHP950033C64	Original <i>de</i> ✓	170.00
1401	WINDSCREEN	GRR5639009D	Original <i>ca</i> ✓	780.00
1411	WINDSCREEN BOND KIT	KNGKWI2		0.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	31,494.00
Total	31,494.00

Extras

Code	Description	Price SGD
1000	BUMPER CLIPS FRONT	30 50.00*
1001	WHEEL TYRE LH FRONT	70% 210 300.00*
1002	WHEEL TYRE LH REAR	70% 210 300.00*
1003	WINDSCREEN SEALANT FRONT	40 60.00*
1004	WHEEL TYRE VALVE LH FRONT	10 20.00*
1005	WHEEL TYRE VALVE LH REAR	10 20.00*
1006	FDR INR SHIELD CLIPS FRONT	10 20.00*
1007	AIR CON GAS FRONT	40 60.00*
1008	RADIATOR COOLANT FRONT	30 50.00*
1009	CTR BODY SEALANT LH SIDE	40 60.00*
Total Extras		940.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	31,494.00	31,494.00
Labour Time Base 10 WU/h		
Total 492.0 WU X 42.00 SGD/h	2,066.40	
Alignment		
Measuring Work	50.40	
Total of Labour		2,116.80
Total Of Extras		940.00
Paint Work Time Base 10 WU/h		
Labour Cost 209.0 WU X 42.00 SGD/h	877.80	
Material Cost	405.49	
Total Paint Including Material		1,283.29
Repair Cost Excludes GST		35,834.09
GST (+7.00%)		2,508.39
Repair Cost Included GST		38,342.48
Deductions (Excludes GST)		
Deduction For Excess	-600.00	
Total Of Deductions (Excludes GST)		-600.00
Grand Total Excludes GST		35,234.09
GST (+7.00%)		2,466.39
Grand Total Included GST		37,700.48

omments

- USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Resul

Hp 90010068

14 days

L/S

26/01/22 @ 1440

EXCERS: TBA

REVERT

Regy after repair

221J0001 / Auto Insure Pte Ltd [739145]
DATE & TIME: 19/01/2022 16:23 (SGT)
SUBMITTED BY: NGIAW JIE LING
VERSION: 1 (19/01/2022 16:23 (SGT))

Your NCD will be affected due to late reporting

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 19/01/2022 16:23 (SGT)
Date of Accident 13/01/2022 19:00 (SGT)
Exact Location of Accident PIE, Singapore
Additional Location Information PIE TWDS JURONG AFTER BKE FLYOVER
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLL4483H

INSURED/POLICYHOLDER

Is company? Yes
Name Of Registered Owner SHENG KHOON MOTOR SERVICE
Company Reg No 5XXXX616D
Email Address skm939@gmail.com
Mobile Phone No (Phone) +65-96311939
Alternative Phone No +65-96311939

VEHICLE PARTICULARS

Manufacturer Mazda
Model 6
Variant -
Exact purpose for which vehicle was being used at time of accident -
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 1998

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Type of Coverage Comprehensive
Fleet Policy No
Policy Number DMPCSNW00174222000
Cover Note Number -

DRIVER

Date of Birth	12/10/1970
Place of Birth	Indoor
Date of Driving Pass	26/02/1991
Driving experience	30 YEARS AND 11 MONTHS
Gender	Male
Mobile Number	(Phone) +65-96311939
Alt. Phone Number	-
Email Address	skm939@gmail.com
Address	BLK 717 JURONG WEST ST 71 #08-113
Address complement	-
Postcode	640717
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Change/cross lane
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No

PASSENGER 1

Name	NA
Gender	Male

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Choa Chu Kang Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18007659999
Alt. Police Station Phone No	(Fax) +65-67644104
Police Station Address	No 20 Choa Chu Kang Street 52 #01-02 Singapore 689286
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No
Was there any audio recorded?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Model	-
Variant	-
Colour	-
Category	NA / Unknown
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-



SINGAPORE POLICE FORCE



T/20220114/2026

Police Station Of Origin:
Choa Chu Kang N.P.C
20 Choa Chu Kang Street 52 #01-02
SINGAPORE 689286
Tel No: 1800-7659999

1 of 3

Report No: T/20220114/2026

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 14/01/2022 12:26		Vide Report No.:		Station Diary No.: 40	
Informant's Particulars					
Name of Informant: AW WENG HUAT			Address: APT BLK 717 JURONG WEST STREET 71 #08-113 SINGAPORE 640717		
ID Type / ID No.: NRIC NO / S70360201			Contact No.: Home/Office: Mobile: 96311939		
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 51	Date of Birth: 12/10/1970	Type of Informant: Driver		
Race: Chinese			Language: English		Institution / School Name:
Occupation: SUPERVISOR			Driving Licence Information: Class: 3,4,5		Date of Expiry:

General Information of the Accident

Type of Accident:	Non-Injury	Drink Drive: No	Date/Time of Accident: 13/01/2022 19:00	Type of Location: Bend
Location: PAN-ISLAND EXPRESSWAY				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Heavy
Type of Collision: Moving Vehicle Against - Others				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SL14483H	Car				Slightly Damaged	1



**SINGAPORE
POLICE FORCE**



T/20220114/2026

Police Station Of Origin:
Choa Chu Kang N.P.C
20 Choa Chu Kang Street 52 #01-02
SINGAPORE 689286
Tel No: 1800-7659999

2 of 3

Report No. T/20220114/2026

CONTINUATION OF REPORT

Brief Details.

On 13/01/2022 at about 1900hrs, I was driving my car, SLL4483H, along PIE (towards Jurong direction). While I was driving, I blacked out and hit a lorry. I could not remember the lorry registration number. There was a passerby who came to assist me to bring me to my office to get my medication as I was feeling unwell. My car sustained some damages on the front left side of my bumper.



**SINGAPORE
POLICE FORCE**



T/20220114/2026

Police Station Of Origin:
Choa Chu Kang N.P.C
20 Choa Chu Kang Street 52 #01-02
SINGAPORE 689286
Tel No: 1800-7659999

3 of 3

Report No. T/20220114/2026

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature of Officer Recording The Report
J /
Sgt 2 KAM YAN MIN, REUBEN *R*

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / GIA /
DSP (2) YIP YEW SENG NELSON
Contact No.: 65476182

Authentication Stamp
NP168



**SINGAPORE
POLICE FORCE**
SAFETY AND SECURITY

Signature Of Informant:

Date/Time:
14/01/2022 12:26

Classification Of Case:

R

Apply for PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Business

Owner ID: 616D

Vehicle Details

Vehicle No.: SLL4483H

Vehicle to be Exported: No

Intended Deregistration Date: 22 Jan 2022

Vehicle Make: MAZDA

Vehicle Model: MAZDA6 4-DOOR SEDAN 2.0L SP.6EAT

Primary Colour: Grey

Manufacturing Year: 2016

Engine No.: PE20840169

Chassis No.: JM6GL1071H0105377

Maximum Power Output: 121.0 kW (162 bhp)

Open Market Value: \$21,624.00

Original Registration Date: 27 Feb 2017

First Registration Date: 27 Feb 2017

Transfer Count: 1

Actual ARF Paid: \$22,274.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 26 Feb 2027

PARF Rebate Amount: \$16,705.00

Intended COE Rebate Details

COE Expiry Date: 26 Feb 2027

COE Category: B - Car above 1600cc or 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$50,621.00

COE Rebate Amount: \$25,792.00

Total Rebate Amount: \$42,497.00

The information contained herein is correct as at 22 Jan 2022

OK

Mazda 6 2.0A

Overview

Financial

Accessories

Similar

Research

Photos

Map

Price

\$65,888

Depreciation

\$10,950 /yr

[View models with similar depre](#)

Reg Date

26-Jan-2017

(4yrs 11mths 30days COE left)

Mileage

95,000 km (19k /yr)

Manufactured

2016

Road Tax

\$1,210 /yr

Transmission

Auto

Dereg Value

\$42,108 as of today ([change](#))

OMV

\$21,660

COE

\$53,001

ARF

\$22,324

Engine Cap

1,998 cc

Power

121.0 kW (162 bhp)

Curb Weight

1,472 kg

No. of Owners

2

Type of Vehicle

[Luxury Sedan](#)