

TAN CHONG MOTOR SALES PTE. LTD.
911, BUKIT TIMAH ROAD
SINGAPORE 589623

ESTIMATE : ACCIDENT/BODY REPAIRS
WORKSHOP : BUKIT TIMAH
CONTACT NO : 4694091
REFERENCE : INS/LC/LAW/0032/2022
DATE : 26-JAN-2022

26/01/2022

QBE INSURANCE (SINGAPORE) PTE LTD
1 RAFFLES QUAY
#29-10 SOUTH TOWER
S(048583)
TEL : 62246633
FAX : 65345356
ATTN:MS JENNY TOH/YEE PING

OWNER'S NAME : MRS CHEN HUEI MEI NEE HONG
ADDRESS : 9C YUAN CHING ROAD
#08-32
S(618645)
TELEPHONE NO : 62682292

TYPE OF CLAIM : DIRECT SETTLEMENT / THIRD PARTY CLAIM
POLICY NO : TP-GX3663H
VEHICLE NO : SCN8119E
MODEL CODE : CDGARSAN16EPA2-L--
MODEL/YEAR : SUNNY 1.6EX A/T S0407
ENGINE NO : QG16414168
CHASSIS NO : JN1CFAN16Z0102907
MILEAGE : 1 KM
DATE IN : 26/01/2022
LIABILITY : 0.00
EXCESS CLAUSE : 0.00
ESTIMATE BY : LAWRENCE
ACCIDENT DATE : 23/01/2022

DIRECT SETTLEMENT


OWNER CLAIMING LOSS OF USE / RENTAL

CAR IN WORKSHOP / CAR NOT IN WORKSHOP

KINDLY REVERT TO ME ASAP

EMAIL : lawrenceteo@tanchong.com

H / P : 94568832 FAX : 64697472

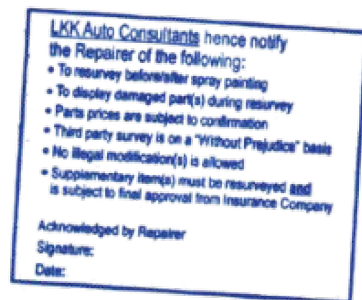

TAN CHONG MOTOR SALES PTE. LTD.
 BUKIT TIMAH W/SHOP
 SERVICE DEPARTMENT

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE REGN NO SCN8119E

S/NO	JOB CODE	NATURE OF JOB	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1	FHI	FOCUS & ADJUST H/LAMP, RESET HORIZONTAL & VERTICAL ALIGNMENT TO FACTORY SPECIFICATION	48.00	✓
2	RABS	RENEW AIR BAG MODULE, SENSOR, RESET SYSTEM USING NISSAN CONSULT	240.00	✓
3	RPI	PERFORM RUST PROOFING & TREATMENT FOR AFFECTED PANEL \$120/PANEL X 02	240.00	120 ✓
4	SEALI	APPLY SEALANT TO ALL AFFECTED PANEL JOINTS & RESEAL NECESSARY AREA \$100/PANEL X 03	300.00	100
5	SFW	INSTALL ULTRAMAX SOLAR FILM - FRT W/SCREEN WITH ANTI GLARE	150.00	✓
6	UG10	RENEW FRONT WINDSHIELD GLASS ASSY.	150.00	✓
7	WD42	CHECK WHEEL ALIGNMENT, ADJUST WHERE NECESSARY AND TEST DRIVE VEHICLE	108.00	✓
8	ZZ/001	REPAIR LH FRONT DOOR, LH FRONT WHEELHOUSE AND RENEW BONNET, LH FRONT FENDER, SUPPORT PANEL, FRONT BUMER	2730.00	1560 ✓
9	ZZ/002	S/PAINT FRONT BUMPER, LH FRONT FENDER, DOOR, SUPPORT PANEL, BONNET, WHEELHOUSE	1750.00	1500 ✓
10	ZZ/003	DISCHARGE/CHARGE A/CON GAD AND RENEW CONDENSER	240.00	✓
11	ZZ/004	RENEW RADIATOR	120.00	✓
TOTAL LABOUR CHARGES			6076.00	

TAN CHONG MOTOR SALES PTE. LTD.
BUKIT TIMAH W/SHOP
SERVICE DEPARTMENT

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SCN8119E

		DAMAGED PARTS & PRICES		
S/NO	PARTS DESCRIPTION	PARTS NUMBER	NETT	LIST S/NETT REMARKS
1	WIRE-STEERING AIGBAG	B5554-4M426		238.40 / nec
2	MIRROR ASSY CENTER VIEW	96321-CR920	153.40	/ BR
3	EMBLEM RAD GRIL	62890-8N700	60.60	/ nec
4	CLIP ENGINE COVER \$1.40 EA X 08	01553-09321	11.20	/ nec
5	COVER-FR UNDER LH LOWER	75894-4M420	89.40	X NN
6	SEALANT - FRONT W/SCREEN GLASS	SEALANT - 2		80.00 / nec
7	IU BRACKET	IU		26.00 / nec
8	RUBBER-DUM	G2716-89900	63.80	/ nec
9	MLDG ASSY-FR PL	72760-4M700	64.30	/ nec
10	MLDG ASSY-FR PL	72761-4M700	64.30	/ nec
11	MLDG WS UPPER	72752-4M715	85.70	/ nec
12	GLASS-FR WIND	72700-8N701	1068.50	/ BR
13	MALE ASSY-HOOD	65601-8M100	50.60	X nn
14	HOOD	F5100-4M5MM	1085.50	/ DD
15	STAY-FR FENDER LH BRACKET	63183-6N600	37.60	X nn
16	CLIP FENDER \$1.30 EA X 07	01553-05323	9.10	/ nec
17	CANOE RIVET FENDER \$7.80 EA X 02	63848-4M500	15.60	/ nec
18	CANOE RIVET FENDER \$7.10 EA X 02	76882-0M000	14.20	/ nec
19	PROTECTOR-FR, LH FENDER	63841-6N600	129.30	/ MIS
20	FENDER-FRONT LH	63101-6N530	593.30	/ DD
21	CLIP RADIATOR GRILLE \$3.40 EA X 04	11296-AG000		13.60 / nec
22	GRILLE-RADIATOR	62310-8N700	245.60	/ CR
23	STAY-BUMPER LH	62211-6N600	106.50	/ DD
24	RETAINER BUMPER	62290-6N600	200.30	/ DD
25	REINFORCE-BUMPE	62032-6N000	354.10	/ DD

TAN CHONG MOTOR SALES PTE. LTD.
 BUKIT TIMAH W/SHOP
 SERVICE DEPARTMENT

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SCN8119E

		DAMAGED PARTS & PRICES		
S/NO	PARTS DESCRIPTION	PARTS NUMBER	NETT	LIST S/NETT REMARKS
26	BRKT-BPR SIDE,LH	62223-6N600	28.30	/ BR
27	FINISHER-FR,LH FOG	62257-6N604	153.50	/ MIS
28	MOULE-BUMPER CHROME	62072-6N600	215.60	/ BR
29	BUMPER SET FR	62022-6N625	474.10	/ BR
30	MODULE ASSY AIRBAG	Y8510-6N612	2316.40	/ nec
31	WHEEL ASSY-STEE	48430-6N602		695.00 X nn
32	CLIP HEADLAMP	26398-4M400		3.80 / BR
33	LAMP ASSY-LH	26060-6N625	586.40	/ BR
34	SENSOR & UNIT-AIR BAG	B8556-7M52E		822.30 / BR
35	RESONATOR ASSY	16585-6N00A		136.90 / MIS
36	NISSAN SILL COOLANT \$9.50 EA X 02	NC-01		19.00 / nec
37	SUNDRIES	NPN		100.00 30/
SUB TOTAL			8277.20	0.00 2135.00
LESS DISCOUNT (NETT-20.00%, LIST-30.00%, S/NETT-.00%)			1655.44	0.00 0.00
GRAND TOTAL			6621.76	0.00 2135.00
OVERALL TOTAL			8756.76	

LEGEND: REMARKS(OK) = APPROVED, REMARKS(X) = NOT APPROVED

TAN CHONG MOTOR SALES PTE. LTD.
BUKIT TIMAH W/SHOP
SERVICE DEPARTMENT

SUMMARY OF ESTIMATE FOR VEHICLE REGN NO SCN8119E

TOTAL LABOUR CHARGES	6076.00
TOTAL SPARE PARTS CHARGES	8756.76

GRAND TOTAL	14832.76 *

* All charges do2 not include GST.

SURVEYOR'S PARTICULARS

NAME	:	Steve (LKK)	W/P
SURVEYED DATE	:	25/1/22	L/S
AUTHORIZED DATE	:		Resumy After Spray
EXCESS CLAUSE	:	0.00	7 days
LIABILITY	:	0.00	
REMARKS	:		

PLS NOTE : This estimate is based on visual inspection of the
affected vehicle. Should we require further labour
charges & spare parts in the process of repairs, we
shall inform you accordingly.