

ASS. REC. BY:

REF:

012 / 22 0011621/K

C

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

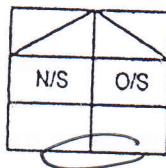

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

2 1/2 days

Res.: Yes or No

Lum Sum:

1-B1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMY 582B

Yr Regn:

02 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Toy Prius

c.c

1798

Colour

Inf. white

A/C:

Insured / Std / NI / NA

Sp. Reading

885184

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDK33FU 9030 9288

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

Pailun

195/65R15

R:

Fina 29

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Pailun

Front

Rear

R/Bal.

9

mm

R/Bal.

7

mm

L/Bal.

9

mm

L/Bal.

7

mm

D.O.A.

30/1/22

D.O.I.

7/2/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

9/2 82213.53 Cahr

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation:

S + RS. SI

Fines

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SMY582B**LAD2202-003***Not Notation**Rehmy B4paint**82213.53*

Vehicle No.:

Chassis No.:

Co UEN:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

07 FEB 2022**SMY582B**

JTDKB3FU903092898

201603575K

TOYOTA

PRIUS GEN 4

30/01/2022

SLC1494T/CHINA

10/02/2021

PART

- 1 COVER, REAR BUMPER
- 1 REINFORCEMENT SUB-ASSY, REAR BUMPER
- 1 COVER, REAR BUMPER, LOWER
- 1 GUARD, REAR BUMPER, CENTER
- 1 RETAINER, REAR BUMPER SIDE, LH
- 1 RETAINER, REAR BUMPER SIDE, RH
- 1 REFLECTOR ASSY, REFLEX, RH
- 1 COVER, FLOOR UNDER, NO.1 LH
- 1 COVER, FLOOR UNDER, NO.2 RH
- 1 COVER, REAR FLOOR CTR
- 1 COVER, DECK TRIM, REAR
- 1 PANEL SUB-ASSY, BODY LOWER BACK

LIST

\$	<i>Bu</i>	485.60	<i>✓</i>
\$	<i>Bu</i>	332.70	<i>✓</i>
\$	<i>Net</i>	22.00	<i>✓</i>
\$	<i>Bu</i>	374.50	<i>✓</i>
\$	<i>Sn</i>	132.60	<i>X</i>
\$	<i>Sn</i>	132.60	<i>X</i>
\$	<i>Sn</i>	39.00	<i>X</i>
\$	<i>Sn</i>	175.10	<i>X</i>
\$	<i>Sn</i>	241.90	<i>X</i>
\$	<i>Dis/CM</i>	229.90	<i>✓</i>
\$	<i>Sn</i>	126.70	<i>X</i>
\$	<i>Sn</i>	651.00	<i>X</i>
TOTAL	\$	2,943.60	
25%	\$	735.90	
	\$	2,207.70	

Special Nett

- 1SET PARKING AID
- 1SET REAR BUMPER CLIP
- 2 WINDSCREEN SEALANT
- 1 WINDSCREEN MOULDING
- 1 WINDSCREEN INNER SPONGE SEAL
- 1 REAR BUMPER PROTECTOR
- 1SET REAR BUMPER RETAINER CLIP
- 1 END PANEL TRIM CLIP
- 1SET BUMPER CLIP FRT
- 1 REAR NUMBER PLATE WITH MOULDING

\$	<i>Phot</i>	700.00	<i>2000</i>
\$	<i>na</i>	95.00	<i>6500</i>
\$	<i>na</i>	150.00	<i>X</i>
\$	<i>na</i>	200.00	
\$	<i>na</i>	130.00	
\$	<i>na</i>	180.00	
\$	<i>na</i>	85.00	
\$	<i>na</i>	65.00	
\$	<i>na</i>	95.00	
\$	<i>Sn</i>	200.00	

Trans-cab Auto Services Pte Ltd

LAD2202-003

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SMY582B

TOTAL \$ 1,900.00**TOTAL PARTS \$ 4,107.70****LABOUR**

To remove and refit interior fittings, trimmings, garnish, fittings and other, to enable repair.

\$ *nn* 380.00 X

Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same

\$ 2,200.00 *2001*

To transfer of rear end panel fittings, attachment and perform water seepage test.

\$ *nn* 380.00 X

To transfer of Tailgate fittings, attachments and perform water seepage test.

\$ *nn* 180.00 X

To remove and refit electrical wiring, battery and other necessary items to facilitate bodywork repair.

\$ *nn* 480.00 X

Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.

\$ *nn* 380.00 X

To check steering geometry and computer wheel alignment

\$ *nn* 220.00 X

To Rust-Proofing and apply undercoat Of The Affected Areas.

\$ *nn* 250.00 X

Towing Fees

\$ *nn* 150.00 X

Putty And Spray Painting Of The Affected Portion.

\$ 2,200.00 *6001*

To reinstall rear bumper parking sensor.

\$ 170.00 *501*

To Check Electrical Lighting Concerned.

\$ 170.00 *131*

Trans-cab Auto Services Pte Ltd**LAD2202-003**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SMY582B

To transfer of luggage floor panel fittings, attachment and perform water seepage test.

\$ *nn* 380.00 X

To conduct and perform a comprehensive vehicle diagnostic check and reset vehicle warning indicators.

\$ *nn* 380.00 X**TOTAL** \$ **7,920.00****Over All Total** \$ **12,027.70****(PART-BY-PART) Repair Days****25 DAYS***2 1/2 days*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: