ASSIGNMENT

From: Ciale.	Veli No: 6BL 1784C Yr Rogn: 30/3 /2/
Estimated Cost:	Type: M.Car / M.Cycler/ Bus / Van / Lorry / Taxl / Prime Mover /
ODITP/WS/TP RES/ OD RES/ EVA/INV/ MV	Truck / Tralles or
To Inspect Vehicle No:	Mako: Citroen Berlingo 1.5 c.c 1499
Ul Workshop m/s	Mako: <u>Citroen Berlingo 1.5</u> c.c 1499 Colour White NC: Insured/SId/NI/NA
(d	Sp. Reading Not Guail T/Radio: Insured / Sid / NI / NA
Insured:	Eng/No:
Policy No	CINO: VR7EFYHZRMJ542597
Claims No. 2022 22004083/SL	Gen. Cond: Good Fair / Poor / Burnt
Sum Insured: Excess:	Sicering: Inorder / Jammed / Leaked / Burnt or
(Client's Record)	Brako: Inorder I Janimod / Leaked / Burnt or
Make of Veh:	Modi: NII / TRIM / STD A/RIM or .
	Tyro Size: F: 705/60116
(Policy Condillon)	R: 705160116
Remark: The veh had commenced its N/S O/S	BS / DUN / EXNOVA / GY / FS / LIZA / (AC) OHTSU / PIR / SUMI /
repair at the time of inspection.	TOYO/YOKO or
Bal. or Market Value: 83K	Eroni Roar
IDAC Accident Rport Consistent? : Yes or No	R/Bal. + mm - R/Bal 7 mm
GIA / PR Seen: Consistent? ; Yes or No	L/Bal. 7 mm L/Bal. 7 mm
Est. Repairs. 6 days Res.: Yos or No	0.0.A. 17/1/72 0.0.1. 10/2/22 0943
Lum Sum: % 3 Val.: Yos or No	Survey held al LH neshtop Survey
CA [REV / REP. / 24 HRS	Des. of Damagos: (T) Repr / O/S / N/S / U/C / Rooflop or
Vehicle: IN / OUT Date. Person Contacted:	The U/C / Chassis frame / Body Structure affected due to collision.
Date / Tline Action / Instruction	The O/C / Chassis frame / Body Structure and the comment
mv: 83k	
rebate: 36162	
nv. (16838	
BI	
	ays Of Ropalr;
	osurvoy No. of Trlp: Survey Fee:
: Final Roport R	Trensportation:
Add Fee:	; Site Insp (\$)s+Rs\$i;
<u>3.</u>	: Interview (\$) Finhs
ुः भुक्ताः स्थाप्तरः । इन्द्राक्ताः स्थाप्तरः ।	Tech, Inva (8) Obser
Livery STURITED : 12	: Weel end 18
	7/7 4).

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	5 2 200000° 5 9 40A
Owner ID Type:	Company
Owner ID;	308G
Vehicle Details	
Vehicle No.:	GBL1784C
Vehicle to be Exported:	No
Intended Deregistration Date:	10 Feb 2022
Vehicle Make:	CITROEN
Vehicle Model:	BERLINGO VAN 1.5 BLUEHDI EAT8 L2
Primary Colour:	White
Manufacturing Year:	2021
Engine No.:	10Q4DR0030181
Chassis No.:	VR7EFYHZRMJ542597
Maximum Power Output:	
Open Market Value:	\$23,846.00
Original Registration Date:	30 Mar 2021
First Registration Date:	30 Mar 2021
Transfer Count:	1
Actual ARF Paid:	\$1,193.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	·
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	A TO THE THE PROPERTY OF THE PARTY OF THE PA
COE Expiry Date:	29 Mar 2031
COE Category:	C - Goods Vehicle & Bus
COE Perìod(Years):	10
QP Paid:	\$39,589.00
COE Rebate Amount:	\$36,162.00
Total Rebate Amount:	\$36,162.00

The information contained herein is correct as at 10 Feb 2022

ОК



Berlingo 1.6A BlueHDi Used Vehicle List (7 vehicles)

Car Model Price Depreciation Reg Date Eng Cap Mileage Company Availability Citroen Berlingo 1.6A \$44,800 \$7,200 /yr 02-May-2018 1,560 cc COE Auto Trading Available BlueHDi (Diesel)

Auto Transmission, Class 3A Can Drive, One Actual Owner, Double Transfer Unit. New Grey Paintwork, No Repair Needed. Powerful Diesel 1600cc Turbo Engine, Long Wheel Base Model For A Bigger Cargo Area....

Office No. - 64589833 / 64571902

Mr Liauw - 96718933 | Kenny - 90115590

Citroen Berlingo L2 1.6A BlueHDi (Diesel)

\$35,800

\$7,010 /yr

21-Mar-2017

1.560 cc Bell Auto Pte Ltd Available

General Multi Purpose Auto Diesel Van, Good Condition, Ideal For Delivery Or Servicing Industry, Cheapest In The Market, Please Call For Viewing.

Office No. - 67457076

Sky - 82239296

Citroen Berlingo 1.6A BlueHDi (Diesel)

\$36,800

\$7,160 /yr

03-Apr-2017

1.560 cc

COE Auto Trading

Available

Auto Van, Class 3A Can Drive. Driven By 1 Fussy Owner Since Brand New. Full Servicing Record With Agent. Most Expensive Component, The Clutch Set Has Been Replaced By C&C Workshop Worth \$1200. Tip-Top...

Office No. - 64589833 / 64571902

Kenny - 90115590 | Mr Liauw - 96718933

Citroen Berlingo L2 1.6A BlueHDi (Dicsel)

\$42,888

\$7,590 /yr

05-Oct-2017

1,560 cc

Net Link Partners Pte Ltd

Available

One Owner, New Paintwork, No Repair Needed, Auto Transmission Powerful Diesel Turbo Engine. High Loan Available, Trade In Welcome. See To Believe, Call Us Now To Arrange Door Step Viewing.

Office No. - 67531661

Teo - 92967266 | Peter - 84898866 | Jeremy - 83215291

Citroen Berlingo L2 1.6A BlueHDi (Diesel)

\$39,800

\$7,280 /yr

31-Jul-2017

1,560 cc

75,898 km

A M T Automobile

Available

100% Full Loan.

Office No. - 62620653

Alan - 96261140

Citroen Berlingo L2 1.6A BlueHDi (Diesel)

\$46,800

\$7,290 /yr

11-Jul-2018

1,560 cc

Efizzig Motor Traders

Available

Efizzig Motor Traders. Easy Loan, Immediate Approval! 100% No Repairs Needed. Silent Undercarriage, Wear And Tear Parts Replaced, Excellent Condition! All Trade-In Are Welcome. Act Now! Call Us Now Fo...

Office No. - -

Jack Lim - 83333038 | Andra - 92316161 | Faisal Jasni - 96876659

Citroen Berlingo L2 1.6A

\$36,888

\$7,180 /yr

31-Mar-2017 1,560 cc 68,899 km

Doex Motor Pte Ltd

Available

14. ...

The second of th

\$720 Monthly! Easy Approval For 100% Loan From Bank Or In House Financing Available And High Trade In! Contact Us For A No Obligation Viewing!

Office No. - -

BlueHDi (Diesel)

Leroy - 98453344 | James - 84446488 | David - 98806776

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, even for COE cars, OPC cars, vans, trucks, hybrid cars, sports cars or stationwagons. You can also buy from a car auction, look up car loans, financial services, low mileage cars, car brands, carpark rates & car insurance. We have new car dealers comprising parallel importers, authorised car dealers, and used car dealers on our site. Find new car price lists, new car launches and new car promotions, and also motoring advice, car reviews & car news on the latest models. Find the right Rental Car for you - get short term rental, long term lease, private hire cars, wedding cars to cars for p-plate probation drivers. Visit our partner sites for job openings for Singapore jobs, real estate, mover, car performance parts, car discussion, forum discussion, commercial vehicle leasing & COE results.

© 2004-2022 sgCarMart. All rights reserved.

SS1Z221L0003 / Success United Pte Ltd ENTRY DATE & TIME: 21/01/2022 18:08 (SGT) SUBMITTED BY: Emilaine VERSION: 1 (28/01/2022 14:04 (SGT))

SINGAPORE ACCIDENT STATEMENT

1. Please report correctly the details of the accident to speed up the claims process.

2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy liability.

4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.

5. Any false reporting may be referred to the Police for Investigation.

6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.

7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission Date of Accident Exact Location of Accident Additional Location Information Country/State of Loss

21/01/2022 18:08 (SGT) 17/01/2022 18:40 (SGT) Near 185D Upper Thomson Rd, Singapore 574334 Upper Thomson Road

Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number

GBL1784C

INSURED/POLICYHOLDER

Is company? Name Of Registered Owner Company Reg No Email Address Mobile Phone No Alternative Phone No

Fulco Leasing Pte Ltd 201021308Ģ johnson.poon@fulcoleasing.com.sg (Phone) +65-98387928

Landa Andria

(Office) +65-67436266

VEHICLE PARTICULARS

Manufacturer Model Variant Exact purpose for which vehicle was being used at time of Citroen Berlingo

VAN 1.5 BLUEHDI EAT8 L2

Are you claiming under your own insurance policy for repair to

your vehicle? A CONTRACTOR OF THE PROPERTY O Vehicle Category

Yes Commercial vehicle

Transmission

Manual 1499

Employment

INSURANCE COMPANY

Name of Insurance Company Type of Coverage Fleet Policy Policy Number Cover Note Number

Allianz Insurance Singapore Pte. Ltd. Comprehensive Yes

AIS/AG/2021/SBR2328Z

DRIVER

CC

Para de la constanta de la con	
Date Of Birth	20/11/1977
Occupation	Indoor
Date Of Driving Pass	28/06/2021
Driving experience	7 MONTHS
Gender	Male
Mobile Number	(Phone) +65-83217095
Alt. Phone Number	(Holls) - 05-052 (7055
Email Address	shine.ni.info@gmail.com
Address	43 Bright Hill Drive #14-14
Address complement	Singapore
Postcode	573894
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Loasoo
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	
Industrance Commons of Other Williams	
Insurance Company of Other Vehicle Owned by Driver	
GENERAL INFORMATION OF THE ACCIDENT	
Type of Academy	
Type of Accident	Collision - Change/cross lane
Weather Conditions	Clear
Road Surface	Dry
OTHER INFORMATION	
Was any foreign vehicle involved in the accident?	N
Nicoshan of cold-last and the last at the	No
The state of the s	2
Was anybody injured in the Accident? Was any injured conveyed to hospital by ambulance?	Yes
Was any other vehicle or property damaged?	Yes
11 1 15	Yes
Number of Passengers (Including Driver) Has the driver been approached by unknown person(s)	2
soliciting/offering accident claims assistance?	No
PASSENGER 1	
PASSENGER	
Name	Oh Myoung Suk
Gender	
DETAILS OF POLICE ACTION	
Was the accident reported to the police?	Yes
Police Station Name	Bishan Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18005529999
Alt. Police Station Phone No	(Fax) +65-65561905
Police Station Address	20 Bishan Street 23 Singapore 579757
Was notice of intended Prosecution given?	No
If yes, against whom?	•
5 00	
CIRCUMSTANCES OF ACCIDENT	
CIRCUMSTANCES OF ACCIDENT	
Refer to Sketch Plan and Police Report No.T/20220117/2111.	
Holor to ortotory fair and a close respect to the contract of	
ATTACHMENT(S)	50 See See See See See See See See See Se
ATTACHMENT(0)	
Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	SD Card is with Traffic Police.
Was there any audio recorded?	No
True dividedity dudie recorded	

Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	
Vehicle Colour	
Vehicle Category	NA / Unknown
Name of Driver	1 - 1
Contact Number	
Address	2 (*)
Address complement	
Postcode	
Insurance Company Name	
Nature Of Damage	
Details of property damaged in accident	
No. Of Passenger (Including Driver)	

INJURED PERSONS DETAILS

INJURED 1

Name of injured person Oh Myoung Suk Gender Female Phone No (Phone) +65-91736370 Address Address Complement Post Code Approximate Age Years Old Injuries Sustained GBL1784C Injured person in which vehicle? Were seat belts worn? Was this injured conveyed to hospital by ambulance? Yes

SKETCH PLAN

IMPORTANT NOTICE


- 1. Please report correctly that details of this accident to speed up the claims process.
- 2. This Forminust by completed by the Policyholder and/or the Authorised Driver.
- 3. information provided must be as truthful and accurate as possible. Any wilful insurgeresentation or withholding of material facts may allow insurance companies to reguidate policy liability.
- The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for Investigation.
- 6. The report will be forwarded by the resurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that econes of this report will for a fee be made available upon application by interested parties.
- 7. By the ledgement of this report to the insurers, you hereby consent to the archiving of this report at the control and to copies of the report being made available aforested.
- 8. Consent under the Personal Data Protection Act (PDPA)

Lunderstand, acknowledge, agree and consent that:

- (a) My insurer , my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' tawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
- (i) processing, handling and/or bealing with my cleans including the sottlement of the claims and any necessary investigations relating to free claims.
- (ii) investigating the accident and/or my claims,
- (b) carrying out and/or dealing with my instructions or responding to any onquirios by mo:
- (iv) administering my claims (including the mailing of correspondence, statements, involces, reports or notices to me, which could involve discissure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

- (b) at insurer(s) who have insured vehicle(s) involved in this accident and the insurers' law yers/law firms, may/are permitted to collect, use, disclose and/or process my Personal information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their law yers/law tirms), which may be sited outside of Singapore, for one or more of the above Purposes.

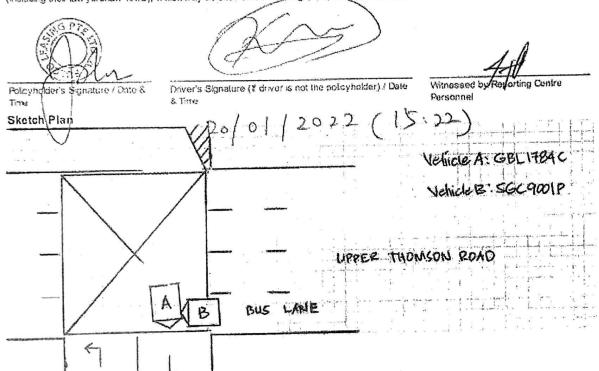

Describe Circumstances of t	he Accident
en e	
un until processo (Magaing Magaing Control of Control of the State of	1 THE A WAY OF THE PROPRIES OF
	A CONTRACTOR OF THE PROPERTY O
	Special Paralleles (Annual Control of Contro
	profession destruction active television with the distribution of
	1 1 2 - 2 0 0 1 2 2 1
- REFER TO 114	FOLICE REPORT # 1/20220117/2111-
	A CONTRACTOR OF THE CONTRACTOR
Declaration	
	And the second second
PWe declare the foregoing particula	is are true in every respect.
CONG S	
13/3/	
(\(\int_{\int}(\lambda \))=1	1.0
168 13	THE
	Direct's Signature (f driver is not the policyholder) / Date Witnessed by Reporting Centre

20/01/2022 (15:22)





1013

Report No. 1720220137/2111

Police Station Of Origin Bishan N.P.C 20 Bishan Street 23 SINGAPORE 579757 Tel No: 1800-5529999

REPORT OF	A TRAFF	IG ACCIDENT	e a, ng autopropipation day	on temporately \$ 40-do to the first of about you	ga e - prijus kiligar variodijade in variojade proda	معهوده والشكاء مرادي حوارق المسوريون الود		Station Diary No.
Date/Time	Report	Made:	Vide Report No.: E/20220117/0104					34
17/01/202	and the second second	Francis properties in the market and a substitution of the first properties of the contract of	AND ASSESSMENT OF THE PROPERTY			yan diyanda da d	CANAL PROPERTY.	Contraction of the second second per per second
Informant			Addre	namen and an Assault and Assau	militi ete inderimi minimi di di di dimiti	rangamummais ad s	ndi di ipenelele	in distinsi dagir finis eti ezanti i perintesian en encentrario en en en el
Name of Ir	UN YOU	ING L	APT	BLK 23 JALA APORE 329	N RAJA UD	ANG #10	-11 T	HE ARTE
ID Type / I	D No.: 353593	10Q	Home	rct No.: rOffice:	and the same of th	Mobile:	8321	7095
Nationality KOREAN.	*		Email				g degants you controlled to	
Sex. Male	Ago: 44	Date of Birth: 20/11/1977	Driver	The state of the s		Louine	W/C	chool Name
Race: Korean			Englis	English		Insulan	ion / School Name:	
Occupatio				g Licence In 2B,3C	ormation:	Date of	Expir	у:
от на при на	to Spelling States, menturing		amplement des subsentation des states and	and the control of th	مددود معامل المعامل ال	1107 38		
General In		on of the Accident		an management of the second of	Opte/Tim	in and manuscriptorist		Type of Location:
Type of Accident.	nie de de dicembre	Injury Conveyed By Amb	ulance	Orink Orive: No	Accident		approximent.	Straight Road
Location	1	The second secon	scompliantikeli ville	the Hoperte Springers and creament		1		
UPPER T	HOMSO	N ROAD				f	311 3 9 35	
Weather:		and the second s	Road	Surface:	-		Road	Speed Limit
Traffic Flow			Traffi	Treffic Control:			Traffic Volume. Heavy	
One Way Type of Co	oillsion:	. १९८८ मा स्थापना स्थापना हेन प्रमान्त्र के स्थापना स्थापना स्थापना स्थापना स्थापना स्थापना स्थापना स्थापना स्	A. C.	non an an ann ann an an an an an an an an	ng kasasan hungapan jiramun sa nakadi sada ka	and Annual Section Section 2018		ne conveyed by ulance:

Details of V		Make	Mods)	Color	Desire the same the same with the same	No of Passenge
GBL1784C	Van	CITROEN	BERLINGO VAN 1.5 BLUEHDI EAT8 L2	White	Slightly Damaged	1
SGC9001P	Car	JAGUAR	XF 2.2 I40 AUTO ABS D/AB 2WD 4DR HIO TO	Green	Slightly Damaged	U



2013

Report No. 17/20220117/2111

Police Station Of Origin: Bishan N.P.C 20 Bishan Street 23 SINGAPORE 579757 Tel No: 1800-5529999

CONTINUATION OF REPORT

A Ph. da shares les	n Involved					
Any Podestnan Ir		many empires - a - construction of the sales and	Use of Poo	destrian	Cross	ing: NA
No. of Pedestrian	S HIGHER INIL			-		
Driver Name	KWAK HYUN YOUN	IG	a desirab de montre en constituir de manda de m	ID No.		G5359350Q
Related Vehicle	GBL 1784C (Van)			Contact No.		83217095
Hospital/Clinic	NIL.			Class of Driving Licence & Expiry Date		Class: 28,3C Date of Expiry: 24/07/2026
Date Treatment	NIL led Medical Leave	INIL	Date Disc	harge Injury	NIL.	
Passenger			E		and the second section of the second	the straightful state of
Name	OH MYOUNGSUK			ID No.		G5313063T
Related Vehicle	GBL1784C (Van)			Contact No.		91736370
Hospital/Clinic	TAN TOCK SENG HOSPITAL			Class Drivin Licent Expiry	g	Class: NIL Date of Expiry: NIL
Date Treatment	17/01/2022 Date D				NIL	
No. of Days gran	ted Medical Leave	NIL.	Degree o	finjury	NIL	and the second section of the section of

Brief Details.

On the above mentioned date and time, I was driving my vehicle GBL1784C along Upper Thomson Road, heading towards Lornie Road direction. The road was dry and the traffic was heavy at the point of time. At the time when I made my right lum towards Hai Lum Sua temple, I had ensured that It was safe and the troffic was halted due to the traffic signal being red. As I was making the turn, suddenly, another vehicle SGC9001P who was travelling along the bus lene collided onto the left of my vehicle, at the left passenger door area.

My wife who was seated at the left passenger seat at the time of accident, was seen bleeding on her left side of her head and she further informed that she felt pain and discomfort as such, ambulance was activated to scene. My wife was subsequently conveyed to Tan Tock Seng Hospital by the paramedics at scene and police came to scene. My in-car camera SD card had been handed over to the police officer at scene and was advised to lodge the police report. I believe that there was no attempt by the driver of SGC9001P to stop the vehicle as there was no braking marks seen on the road.





Police Station Of Origin: Bishan N.P.C 20 Bishan Street 23 SINGAPORE 579757 Tel No: 1800-5529999

Report No. 1/20220117/2111

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature of Officer Reco E / Sgt 2 PUA JIAN YAN, JE		Signature Of Informant:	
Signature Of Interpreter: Not applicable		Date/Time: 17/01/2022 20:59	19
Officer in Charge Of Cast TP / GIT / Sr Staff Sgt MARIAH BIN	9	Classification Of Case:	
Contact No.: 65476433	LES SHUAPURE	SN 061	
Authentication Stamp NP168	K		
	SIGN	TURE	



IMPORTANT NOTE: Please submit the completed Addendum form to the same Accident Reporting Centre with whom you submitted the Original Report.

_	
	ADDENDUM
1	PARTICULARS OF PERSON MAKING THE AMENDMENTS:
	Original Report No: 551722110003 Vehicle Registration No: GBL 1784C
	Name (as shown in MRICH Fuko Leashing Ple Ltd NRIC/FIN/Passport No: 2010213086
	(*Vehicle Driver/Vehicle Owner) (*) Please delete as appropriate
	Address: 22 Ubi Road 4 Fulco Building Singapore (408647
	Contact (Tel): 67436266 Mobile No.: 98367928
	Email Address: Johnson. poon a fulcoleasing.com. sg
	Date of Accident: 17 01 2022 Time of Accident: 10:40
	Place of Accident: Upper Thomson Road
	Insurance Company: Allianz
)	ADDITIONAL INFORMATION /AMENDMENTS:
	I have made a report on the above-mentioned accident and would like to include additional information or
	make the following amendments:
	Amend to Own Dankge Claim (OD).
	\mathcal{A}
	Reporting Centre/Personnel's Signature
	Policyholder / Driver's Signature Pate: Reporting Centre/Personner's Signature Name:

NRIC/FIN No.: Date:



SINGAPORE POLICE FORCE

ACKNOWLEDGEMENT SLIP

Rel Report No: E/2022 0117 10104.
ma Translate thereid
 Burgison & North, Christel Mr. (1980) or Panagout to: 7 years; seen only
grattic Police
EST (A. Advance / Bridge) Reports (Reports) Reports
hereby antimostiledge receipt of the below murdiored items of.
thereby artinophologo records of the Decon tree grant of the South of
A service of the serv
The second secon
The same of the sa
A CONTRACT OF THE CONTRACT OF
The same are the same and the same are the s
The state of the s
9
10 10 10 10 10 10 10 10 10 10
trom Ewak Hyun Young G5359350Q HIP: 83217095 (Name, NEC or Passport No. / Rank and No.) 26 Sin Ming Lang \$103-125 S(573971) (Address / Police Sinten / NPC / NPP)
trom Knock Hyun Young G5359350Q HIP: 83217095 (Name, Note or Passeport No. / Rank and No.) 26 Six Wing Lane \$103-125 S(573971)
trom Ewak Hyun Young G5359350Q HIP: 83217095 (Name, NEC or Passport No. / Rank and No.) 10 26 Sin Ming Lang #03-125 S(573971) (Address / Police States / NPP) (1711/2022 at 1935 L. (Time) Witnessed by / Handed and by: Received by:
trom Ewak Hyun Young G5359350Q HIP: 83217095 (Name, NEC or Passport No. / Rank and No.) 26 Sin Ming Lane \$\(\delta\text{03} - 125\) \$\(\sigma\text{53971}\) (Address / Police Staten / NPC / NPP) (711/2022 at 1935 L. (Date)
trom Ewak Hyun Young G5359350Q HIP:83217095 (Name, NEC or Passport No. / Rank and No.) 1 26 Sin Ming Laue #03-125 S(573971) (Address / Police Staten / NPC / NPP) (1711/2022 at 1935 L. (Time) Witnessed by / Handed envel by: (Date: Toolate it applicable) Signature
Irom Ewak Hyun Young G53593SOQ HIP:83217095 (Name, NEC or Passport No. / Rank and No.) (Address / Police Station / NPC / NPP) (Address / Police Station / NPC / NPP) (Date) (Date) (Time) (Signature) (Signature) (Witnessed by / Handod engrity)
Inom Ewak Hyun Young G5359350Q HIP: 83217095 (Name, NEC or Passport No. / Rank and No.) (Address / Police Station / NFC / NFP) (Address / Police Station / NFC / NFP) (Passport No. / Rank and No.) (Time) (Signature) (Witnessed by / Handed engrity) (Passport No. / Rank and No.) (Signature) (Signature) (Witnessed by / Handed engrity) (Signature) (Signature) (Walk Hyung Young G53593503 (Name, Nithic of Passport No. / Rank and No.)
Irom Ewak Hyun Young G53593SOQ HIP:83217095 (Name, NEC or Passport No. / Rank and No.) (Address / Police Station / NPC / NPP) (Address / Police Station / NPC / NPP) (Date) (Date) (Time) (Signature) (Signature) (Witnessed by / Handod engrity)
Irom Level Hyun Young G5359350Q HIP: 83217095 II 26 Sin Ming Lake #03-125 S(573971) II (Address / Police Staten / NPC / NPP) (Address / Police Staten / NPC / NPP) (Police in application) (Coate)
Inom Ewak Hyun Young G5359350Q HIP:83217095 (Name, NRC or Passport No. / Rank and No.) (Address / Police Staten / NPC / NPP) (Address / Police Staten / NPC / NPP) (Address / Police Staten / NPC / NPP) (Date) (Date) (Time) (Received by: (Totale Hyun Young G5359350Q (Name, NHC of Passport No. / Rank and No.) (Other Flormatics: GBL 1784 C



COVER NOTE

In consideration of the insured having agreed to pay the agreed Premium in respect of the Motor Vehicle described in the Schedule below, the Insurance is hereby HELD COVERED in the terms of the Compony's usual form of Comprehensive / Third Party Fire & Theft / Third Party (whichever is applicable) Policy applicable thereto for and shall be valid for a period of THIRTY (30) days from date of issue. The Cover Note will be replaced with a Motor Certificate of Insurance / Policy.

Cover Note Number	AIS/AG/2021/ SBR2328Z
Insured	Fulco Leasing Pte Ltd
Usage	Leasing
Make & Model	Citroen Berlingo
Attachment	
Engine Capacity/Tonnage	0.8 ton
Engine Number	10Q4DR0030181
Chassis Number	VR7EFYH ZRMJ542597
Registration Number	GBL1784C
Estimated Value	Market Value at Time of Loss
Coverage	Comprehensive - Any Workshop
Deductible	\$1,800 (Sect I), \$100 (Windscreen)
Period of Insurance	1-Jan-22 to 31-Dec-22
Hire Purchase	Nil
Issued By	Agency Distribution on 30-Dec-21

We hereby certify that this Cover Note is issued in accordance with the provisions of MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (Chapter 189) MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960 ROAD THANSPORT ACT, 1987 (MALAYSIA) MOTOR VEHICLES (THIRD PARTY RISKS) RULES, 1959 (MALAYSIA)

Signed for and On Behalf of Allianz Insurance Singapore Pte Ltd

Authorised Signatory



CYCLE & CARRIAGE-FULCO MOTOR DEALER PTE LTD EUNOS LINK SERVICE CENTRE



330 Ubi Road 3 Singapore 408650 Tel: 67461000 Fax: 64875857

ESTIMATE

Invoice Name & Address		Owner Name & Vehicle Info
ALLIANZ INSURANCE SINGAPORE PTE LTD	Cust No/Name	/Cycle & Carriage.Fulco Motor De
79 ROBINSON ROAD #09-01	Reg No/Reg Date	
SINGAPORE 068897	Date In/Mileage	17/01/2022/ 6319
TEL:67143369	Chassis No	VR7EFYHZRMJ542597
S 5.50 P P P	Engine No	10Q4DR0030181
Contact No	Make/Model	CITCV/K9 BERLINGO L2 1.5 BLUEHDI 13
	Colour/Trim	WPP / GY

Account No	Terms	Date/Time Printed	CSE	Operator		WIP No		
F0000051	Credit	31/01/2022/ 08:49	OD	303 / Renemer		25421		216 52
		Description of Good	s / Services		Qty	Unit Price	Disc%	Amount
M C98004797		SPRING SHOCK	<-ABSORBE		1.00	106.00	0.00	106.00
M C16478571		LHF FRONT KI	NUCKLE ST		1.00	715.00	0.00	\$ 715.00
M C98150146		LHF LWR ARM	WISHBONE		1.00	489.00	0.00	489.00
M C98310888		LHF BALL JO			1.00	53.00	0.00	53.00
M C98339842		FRONT ANTI-			1.00	508.00	0.00	508.00
M C98315470		LHF ANTI-ROI			1.00	78.00	0.00	78.00
M C16759542		STEERING RAG			1.00	2422.00	0.00	^ 2422.00
M C96770718		FRONT SUBFRA	AME CROSS		1.00	1122.00	0.00	1122.00
M C16362758		OTR DASHBOAR			1.00	318.00	0.00	318.00
M C16362759		LH OTR DASH			1.00	109.00	0.00	109.00
M C98184542		CTR OTR MLDO			1.00	133.00	0.00	133.00
M C98253423		OTR UPR_CTR	MLDG LPAN	1500	75 7.00	153.00	0.00	152 00
4 C16841900	-	DASHBOARD 1	711		1.06-	3686.00	0.00	3686.00
M C98165533		LH STDE COV	ER-MIG L		(1 (4.60-	7 62.00	0.00	62.00
M C98194382		LH CTR COVE	R CONSOLE	The same total department	1.00	16.00	0.00	16.00
4 C98213489		LHF AIR DUC	T DASHBOA		1.00	95.00	0.00	^,95.00
1 098183807		INR GLOVE BO	OX FASCIA		1.00	229.00	0.00	.229.00
4 C98253883		MLDG GLOVE I	30X		1.00	140.00	0.00	^.140.00
4 C98253899	PVH	UPR GLOVE BO	OX FASCIA		1.00	449.00	0.00	^ 449.00
Z NOTES								2. 3 .
ACCIDENT	ON 17/01	1/2022 ALONG UPPER TI	HOMSON ROA	D			1	
OWNER CLA							1	
EXCESS A	ND AUTHOR	RIZATION WILL BE ADV	ISE BY THE	INSURANCE COMPANY	Y	W1.W1		
					Thuran	elthaut 235769 122 Og	D-10m	
		LKK Auto Co	nsultants her	nce notify	Meda	275269		
		the Repairer	of the followi	ng:	42	233101	11-1	**
		 To resurvey b 	efore/after spray	painting	[3]2	122 09	45	
		 To display da 	maged part(s) du	ring resurvey	05500	CTBC		
			re subject to con		CHES	STBC 6days w	_	
		 Third party su 	rvey is on a "Wit	hout Prejudice" basis	719	6days W	P	
	•1	No illegal mod	dification(s) is all	owed	1.4	3 . 7	į l	
				e resurveyed <u>and</u> n Insurance Company				
C				,	Parts			21,263.
Confirm & a	ccepted b	50 man	by Repairer		Labour			0.0
		Signature:			Standard M	Manu		0.0
		Date:			Specialist			15,520.0
					Others (Lul			0.0
					Sundry	J, E /		192.0
			2		Total (w/o	(TZ)		36,975.0
	cianaton	and company stamp			i o ca i (w/ o	431)		50,575.

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required.

Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.



CYCLE & CARRIAGE-FULCO MOTOR DEALER PTE LTD **EUNOS LINK SERVICE CENTRE**



330 Ubi Road 3 Singapore 408650 Tel: 67461000 Fax: 64875857

ESTIMATE

Invoice Name & Address	Owner Name & Vehicle Info				
ALLIANZ INSURANCE SINGAPORE PTE LTD	Cust No/Name	/Cycle & Carriage.Fulco Motor De			
79 ROBINSON ROAD #09-01	Reg No/Reg Date				
SINGAPORE 068897	Date In/Mileage	17/01/2022/ 6319			
TEL:67143369	Chassis No	VR7EFYHZRMJ542597			
122.0/143309	Engine No	10Q4DR0030181			
Contact No	Make/Model	CITCV/K9 BERLINGO L2 1.5 BLUEHDI 13			
	Colour/Trim	WPP / GY			

S MIPNTBBOOBB DIAGNOSTIC/SCANNING S MIPNTBBOOBB TO CHECK ALL LIGHTING/WIRING SYSTEM ON LHF ACCIDENT AFFECTED AREAS MIPNTBBOOBB TO REMOVE & RE-INSTALL ROOF LINING, TRIMMING & CARPETS TO FACILITATE REPAIR ON LHF ACCIDENT AFFECTED AREAS MIPNTBBOOBB TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS MIPNTBBOOBB TO REMOVE & REPLACE DASHBOARD ANDIOTHER RELATEDJPARTS MIPNTBBOOBB TO APPLY SEALANT KIT ON NEW & REPAIR PANELS MIPNTBBOOBB TO APPLY SEALANT KIT ON NEW & REPAIR PANELS MIPNTBBOOBB TO REPLACE LH HEADLAMP, FRONT BUMPER, LH FENDER, LHF DOOR, ETC TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) MIPNTBBOOBB TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS MIPNTBBOOBB TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT MIPNTBBOOBB TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT MIPNTBBOOBB WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 520 M C9816765680 LWR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 550	Account No	Terms	Date/Time Pr	inted	CSE	Operator	% 38	WIP No	E 200	
S MIPHTBBOOBB DIAGNOSTIC/SCANNING S MIPHTBBOOBB TO CHECK ALL LIGHTING/WIRING SYSTEM ON LHF ACCIDENT AFFECTED AREAS IO CHECK ALL LIGHTING/WIRING SYSTEM ON LHF ACCIDENT AFFECTED AREAS IO REMOVE & RE-INSTALL ROOF LINING, TRIMMING & CARPETS TO FACILITATE REPAIR ON LHHF ACCIDENT AFFECTED AREAS MIPHTBBOOBB TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS MIPHTBBOOBB TO REMOVE & REPLACE DASHBOARD ANDIOTHER RELATEDIPARTS MIPHTBBOOBB TO APPLY SEALANT KIT ON NEW & REPAIR PAWELS MIPHTBBOOBB TO APPLY SEALANT KIT ON NEW & REPAIR PAWELS STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS MIPHTBBOOBB SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS MIPHTBBOOBB TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS MIPHTBBOOBB TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT MIPHTBBOOBB WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM MINDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C9816765680 LWR FRONT BUMPER 1.00 580.00 0.00 586 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 550	F0000051	Credit	31/01/2022/	08:49	OD	303 / Renem	er	25421		
DIAGNOSTIC/SCANNING MIPNTB8088 TO CHECK ALL LIGHTING/WIRING SYSTEM ON LHF ACCIDENT AFFECTED AREAS MIPNTB8088 TO REMOVE & RE-INSTALL ROOF LINING, TRIMMING & CARPETS TO FACILITATE REPAIR ON LHF ACCIDENT AFFECTED AREAS MIPNTB8088 TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS MIPNTB8088 TO REMOVE & REPLACE DASHBOARD_ANDTOTHER RELATEDTARTS MIPNTB8088 TO APPLY SEALANT KIT ON NEW & REPAIR PANELS MIPNTB8088 TO REPLACE LH HEADLAMP, FRONT BUMMER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) MIPNTB8088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT MIPNTB8088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM MINDRY 205/60 R16 TYRE M SUNDRY 205/60 R16 TYRE M SUNDRY 205/60 R16 TYRE M C1632656780 UPR FRONT BUMPER 1.00 622.00 0.00 622 Confirm & accepted by 640 550 Confirm & accepted by 640 550			Description	of Good	s / Service	és	Qty	Unit Price	Disc%	Amount
S MIPNTBBOBB TO CHECK ALL LIGHTING/WIRING SYSTEM ON LHF ACCIDENT AFFECTED AREAS S MIPNTBBOBB TO REMOVE & RE-INSTALL ROOF LINING, TRIMMING & CARPETS TO FACILITATE REPAIR ON LHF ACCIDENT AFFECTED AREAS S MIPNTBBOBB TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS S MIPNTBBOBB TO REMOVE & REPLACE DASHBOARD AND OTHER RELATEDIPARTS S MIPNTBBOBB TO APPLY SEALANT KIT ON NEW & REPAIR PANELS S MIPNTBBOBB TO REPLACE LH HEADLAMP, FRONT BUMPER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS S MIPNTBBOBB SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) MIPNTBBOBB TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS MIPNTBBOBB TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNTBBOBB WHEEL BALLANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 Confirm & accepted by Confirm & accepted by Confirm & accepted by Confirm & accepted by						7		-		250.00
TO CHECK ALL LIGHTING/WIRING SYSTEM ON LHF ACCIDENT AFFECTED AREAS 1280 S MIPNT88008 TO REMOVE & RE-INSTALL ROOF LINING, TRIMMING & CARPETS TO FACILITATE REPAIR ON LHF ACCIDENT AFFECTED AREAS 5 MIPNT88008 TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS 5 MIPNT88008 TO REMOVE & REPLACE DASHBOARD AND DOTHER RELATEDIPARTS 5 MIPNT88008 TO APPLY SEALANT KIT ON NEW & REPAIR PANELS TO CUT & WELD LH A PILLAR POST - TO REPAIR INF FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) 5 MIPNT88088 TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS 5 MIPNT88088 TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS 5 MIPNT88088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT 5 MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY COMPANY STICKER M SUNDRY COMPANY STICKER M C981624180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 CONFITM & accepted by 640 550 CONFITM & accepted by 640 550		,	ING						- 1	/
S MIPNTBOODS TO REMOVE & RE-INSTALL ROOF LINING, TRIMMING & CARPETS TO FACILITATE REPAIR ON LHF ACCIDENT AFFECTED AREAS MIPNTBOODS TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS MIPNTBOODS TO REMOVE & REPLACE DASHBOARD_ANDTOTHER RELATED]PARTS MIPNTBOODS TO APPLY SEALANT KIT ON NEW & REPAIR PANELS TO APPLY SEALANT KIT ON NEW & REPAIR PANELS TO REPLACE LH HEADLAMP, FRONT BUMPER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS MIPNTBOODS SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) MIPNTBOODS TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS MIPNTBOODS TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT MIPNTBOODS TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT MINDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9916824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 522 CONFITM & accepted by			HTTHE /HTETHE	CVOTEN	O					100.00
TO REMOVE & RE-INSTALL ROOF LINING, TRIMMING & CARPETS TO FACILITATE REPAIR ON LHF ACCIDENT AFFECTED AREAS MIPNTB808B TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS MIPNTB808B TO REMOVE & REPLACE DASHBOARD_ANDTOTHER RELATEDJPARTS MIPNTB808B TO APPLY SEALANT KIT ON NEW BERPAIR PANELS TO REPLACE LH HEADLAMP, FRONT BUMPER, LH FENDER, LHF DOOR, ETC TO CUT & WELD LH A PILLAR POST - TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS MIPNTB808B SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS MIPNTB808B TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS MIPNTB808B TO REPLACE TO SHORT TO S	S MIDNITER	ALL LIG	HIING/WIRING	SYSTEM	ON LHF AC	CCIDENT AFFECTED	AREAS		1	1000 00
REPAIR ON LHF ACCIDENT AFFECTED AREAS MIPNTB808B TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS MIPNTB808B TO REMOVE & REPLACE DASHBOARD ANDTOTHER RELATEDIPARTS MIPNTB808B TO APPLY SEALANT KIT ON NEW & REPAIR PANELS TO APPLY SEALANT KIT ON NEW & REPAIR PANELS TO REPLACE LH HEADLAMP, FRONT BUMPER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS MIPNTB808B SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) MIPNTB808B TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT MIPNTB808B WHELL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 632 Confirm & accepted by			NSTALL DOOF I	THING T	DIMMING .	CADDETS TO FAC	11 1TATE		1	1280.00
S MIPNTB808B TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS S MIPNTB808B TO REMOVE & REPLACE DASHBOARD AND OTHER RELATED]PARTS S MIPNTB808B TO APPLY SEALANT KIT ON NEW & FREPAIR PANELS	REPAIR	N I HE AC	CIDENT AFFECT	ED AREA	S SMITHILLY	CARPETS TO FAC	ILITATE		- 1	
TO TRANSFER LHF DOOR COMPONENTS & MECHANISM PARTS S MIPNT88088 TO REMOVE & REPLACE DASHBOARD ANDTOTHER RELATEDIPARTS S MIPNT88088 TO APPLY SEALANT KIT ON NEW & REPAIR ANDLS 1280 S MIPNT88088 TO REPLACE LH HEADLAMP, FRONT BUMPER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS S MIPNT98088 SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) S MIPNT88088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNT88088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 CONFITM & accepted by			CIDENT ATTECT	LU MILA	3				1	640.00
S MIPNTB808B TO REMOVE & REPLACE DASHBOARD AND TOTHER RELATED PARTS MIPNTB808B TO APPLY SEALANT KIT ON NEW & REPAIR PANELS			DOOR COMPONEN	ITS & ME	CHANISM P	PARTS				040.00
TO REMOVE & REPLACE DASHBOARD_AND_OTHER RELATED_PARTS MIPNT88088 TO APPLY SEALANT KIT ON NEW & REPAIR PANELS					011111111111111111111111111111111111111	111110			1	1280.00
S MIPNTB8088 TO APPLY SEALANT KIT ON NEW & REPAIR PANELS TO APPLY SEALANT KIT ON NEW & REPAIR PANELS TO REPLACE LH HEADLAMP, FRONT BUMPER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS S MIPNTB8088 SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) MIPNTB8088 TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS MIPNTB8088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNTB8088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613	TO REMOV	E & REPL	ACE DASHBOARD	ANDOT	HER RELAT	ED]PARTS	m			/
TO REPLACE LH HEADLAMP, FRONT BUMMER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS S MIPNT98088 SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) 5 MIPNT88088 TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS 5 MIPNT88088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT 5 MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 550	S MIPNT880	88	i	L /	375	1000	050)	1	300.00
TO REPLACE LH HEADLAMP, FRONT BUMMER, LH FENDER, LHF DOOR, ETC -TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS S MIPNT98088 SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) S MIPNT88088 TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS S MIPNT88088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 S50			KIT ON NEW &	REPAIR	PANELS		6111=			
-TO CUT & WELD LH A PILLAR POST -TO REPAIR INR FRAME AND SIDE SILL STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS MIPNT98088 SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) 5 MIPNT88088 TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS 5 MIPNT88088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT 5 MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 586 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640			1		276	T T T T T 1	9000	フ	ĺ	5120.00
STRAIGHTEN, REFORM, ALIGN ON LHF ACCIDENT AFFECTED AREAS 4400							חר כזוו		1	2560
\$\text{SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS} \(\text{(FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME)} \) \$\text{SMIPNT8808B} \\							DE 21LÉ		ł	*
SPRAY PAINTING ON LHF ACCIDENT AFFECTED AREAS (FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) 1920			M, ALIGN ON LA	r ACCID	ENI AFFEC	TED AKEAS			i	4400.00
(FRONT BUMER, LHF FENDER, LHF DOOR, LH A PILLAR, SIDE SILL & INR FRAME) S MIPNT88088			N THE ACCIDEN	T AFFEC	TED AREAS					2750
S MIPNT88088 TO REPLACE CROSSMEMBER AND OTHER SUSPENSION PARTS S MIPNT8808B TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNT8808B WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 \$50							FRAME)		1	
S MIPNT88088 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640				•	10 100000000000000000000000000000000000				1	1920.00
TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT S MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL M C1632656780 UPR FRONT BUMPER M C9816765680 LWR FRONT BUMPER M C9816765680 LWR FRONT BUMPER M C9816765680 LWR FRONT BUMPER M C9816765680 SS50	TO REPLA	CE CROSSI	MEMBER AND OT	HER SUS	PENSION P	ARTS			1	-
S MIPNT88088 WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL M C1632656780 UPR FRONT BUMPER M C9816765680 LWR FRONT BUMPER D CONfirm & accepted by 640 550									- 1	180.00
WHEEL BALANCING (TO REPLACE 1 PC TYRE & RIM M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 6∜0 550			TERIZED WHEEL	ALIGNM	ENT				ļ	50.00
M SUNDRY 205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 \$550			/TO DEDI ACE 1	DC TVD	C 0 DIM				ŀ	50.00
205/60 R16 TYRE M SUNDRY COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 550		LANCING	(10 REPLACE 1	PC TYR	E & RIM				l	142.00
M SUNDRY COMPANY STICKER M C9816824180		16 TVDF							1	142.00
COMPANY STICKER M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 550	,	ITO TINE							ł	50.00
M C9816824180 LH HEADLIGHT ASSEMBL 1.00 622.00 0.00 622 M C1632656780 UPR FRONT BUMPER 1.00 580.00 0.00 580 M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 M C9816765680 S50 640 550 613 640 640 640 640 640 640 640 640 640 640		STICKER							1	•
M C9816765680 LWR FRONT BUMPER 1.00 613.00 0.00 613 Confirm & accepted by 640 550			LH H	EADLIGH	T ASSEMBL		1.00		E-12.201.510.510	622.00
Confirm & accepted by 640 550	M C1632656	780	UPR	FRONT B	UMPER					580.00
<i>55</i> 0	M C9816765	680	LWR	FRONT B	UMPER		1.00	613.00	0.00	613.00
<i>55</i> 0							11-		y-1-	
	Confirm & a	iccepted b	ру							
						5	50			
						¥				
Authorized signatory and company stamp	Authorized	signatory	v and company	stamp						

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required. Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

Page 1 of 3



CYCLE & CARRIAGE-FULCO MOTOR DEALER PTE LTD EUNOS LINK SERVICE CENTRE



330 Ubi Road 3 Singapore 408650 Tel: 67461000 Fax: 64875857

ESTIMATE

Invoice Name & Address	Owner Name & Vehicle Info				
ALLIANZ INSURANCE SINGAPORE PTE LTD 79 ROBINSON ROAD #09-01 SINGAPORE 068897	Cust No/Name Reg No/Reg Date Date In/Mileage				
TEL:67143369	Chassis No	VR7EFYHZRMJ542597			
Contact No	Engine No	10Q4DR0030181			
Contact No	Make/Model	CITCV/K9 BERLINGO L2 1.5 BLUEHDI 13			
	Colour/Trim	WPP / GY			

	unt No	Terms	Date/Time Printed	CSE	Operator		WIP No		1.00
0000	0051	Credit	31/01/2022/ 08:49	OD	303 / Renemer		25421		
M C	00301030	0.0	Description of Goods			Qty 1	Jnit Price	Disc%	Amount
	98301005		FR BUMPER II			1.00	285.00	0.00	^, 285.00
	16326558		LH FRONT BUY			1.00	105.00	0.00	105.00
77.0			SET BUMPER I			1.00	147.00	0.00	147.00
	98305126		FRONT PANEL	CROSSMEM		1.00	201.00	0.00	^,201.00
	98305222		LH BRACKET (1.00	105.00	0.00	^.105.00
	98270558		LHF UNIT FAC			1.00	201.00	0.00	^,201.00
	98173974		LH COOL AIR			1.00	106.00	0.00	^. 106.00
	98164827		LHF FENDER I			1.00	434.00	0.00	434.00
	98177648		LHF FENDER S			1.00	189.00	0.00	189.00
	98176914	A A I	LH DRIP MOUL			1.00	87.00	0.00	87.00,
	6325G3	.00	LH SIDE BLAS		3	1.00	27.00	0.00	27.00
	98218686		LHE FENDER	REAR SEAU	11220	15 7.90	217.00	0.00	^,217.00
	98173985		TH MHEEL, HOI	JEING MUD	111116	1.00	170.00	0.00	^.170.00
	98164379		LH PASS COM			7 (7.00)	185.00	0.00	^,185.00
	98204233		LH FRONT DO			1.00	1462.00	0.00	1462.00
	98176963		LH DOOR PRO			1.00	336.00	0.00	336.00
	98206613		LH FR DOOR I			1.00	79.00	0.00	79.00
	98176832		LH RR DOOR I			1.00	93.00	0.00	93.00
	98257239		LH FR INR DO			1.00	124.00	0.00	124.00
	16064751	180	LH UPR HING			1.00	124.00	0.00	124.00
	9035AZ		LH LWR HING			1.00	124.00	0.00	124.00
	98169772		DOOR ARRESTI			1.00	111.00	0.00	111.00
	98167912		LH DOOR TRI			1.00	495.00	0.00	495.00
	98167928		LH DOOR TRI			1.00	39.00	0.00	39.00
	98195760		LH INR SEAL			1.00	50.00	0.00	50.00
	9827671		LH SIDE PASS			1.00	2233.00	0.00	°, 2233.00
	098173009		WINDOW WASH			1.00	232.00	0.00	232.00
	98166458		WASHER PIPE			1.00	57.00		57.00
	098046817		FUSE BOX SU			1.00	58.00		6.58.00
	098153116		STEEL WHEEL			1.00	195.00		195.00
	098083420		WHEEL CAP			1.00	56.00		56.00
	098333060		LHF SHOCK A			1.00	225.00		225.00
M C	09678782	580	ROD PROTECT	OR SHOCK		1.00	13.00	0.00	13.00

Confirm & accepted by

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required.

Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.