



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2207506

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 05/12/2022
Reference CC6/CTI22001304/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJF 282C
Insured Veh. SKC 1302B
Claim No. SNM22D200997/C02
Policy No. DMPCSNW00255302100
Accident Date 09/02/2022
Inspection Date 10/02/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22001304/Apa3q2 Date: 05/12/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKC 1302B	Veh. Inspected	SJF 282C	
Policy No.	DMPCSNW00255302100	Coverage (\$)	0.00	
Claim No.	SNM22D200997/C02	Excess (\$)	0.00	
Assign From		Assign Date	10/02/2022	
2. Vehicle Particulars & Condition				
Make & Model	MAZDA 3 HB	c.c	1998	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	JM6BM4478G0300499	Colour	RED	
Odometer	137800 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45 R18	GOODYEAR	6 mm	
L/H Front Tyre	225/45 R18	GOODYEAR	6 mm	
R/H Rear Tyre	225/45 R18	GOODYEAR	6 mm	
L/H Rear Tyre	225/45 R18	GOODYEAR	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY AND UNDERCARRIAGE. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	09/02/2022	Inspection Date	10/02/2022	
Survey held at	YSK AUTO WORKSHOP 1 KAKI BUKIT AVE 6 @ AUTOBAY #01-71 SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJF 282C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT LH DOOR	TO REPAIR SEE LABOUR	1,185.20	-
1	FRONT LH DOOR LOCK	NOT NECESSARY	359.40	-
1	REAR LH DOOR	DISTORTED	1,198.90	1,198.90
1	REAR LH DOOR LOCK	DAMAGED	378.10	378.10
1	REAR LH DOOR WEATHERSTRIPE	NECESSARY	136.90	136.90
1	REAR LH DOOR INNER TRIM BOARD	CRACKED	745.20	745.20
1	REAR LH DOOR GLASS REGULATOR GEAR	DAMAGED	254.20	254.20
1	REAR LH DOOR GLASS REGULATOR MOTOR	DAMAGED	294.20	294.20
1	REAR LH FENDER	BUCKLED	1,274.20	1,274.20
1	REAR LH FENDER INNER SHIELD	NOT NECESSARY	268.20	-
1	ROCKER PANEL LH	DISTORTED	988.60	659.00
1	REAR LH LOWER ARM	BENT	303.40	303.40
1	REAR LH KNUCKLE ARM	DAMAGED	557.00	557.00
1	REAR LH SHOCK ABSORBER	DAMAGED	329.70	329.70
1	REAR LH WHEEL HUB C/W BEARING	DAMAGED	245.10	245.10
1	REAR LH COIL SPRING	NOT NECESSARY	201.40	-
1	REAR LH UPPER ARM	BENT	181.80	181.80
1	REAR LH TRAILING ARM	BENT	294.10	294.10
1	REAR LH STAY ARM	BENT	162.10	162.10
1	REAR CROSS MEMBER	NOT NECESSARY	1,042.60	-
1	REAR LH STEP GARNISH	NECESSARY	169.20	98.00
	LESS 20% DISCOUNT		-	-1,422.38
			10,569.50	5,689.52
<u>SPECIAL NETT ITEMS</u>				
1	FRONT LH DOOR BLACK TAPE (SN)	NOT NECESSARY	60.00	-
1	REAR LH DOOR BLACK TAPE (SN)	NECESSARY	60.00	60.00
1	REAR LH DOOR INNER TRIM BOARD CLIPS (SN)	NECESSARY	30.00	30.00
1	REAR LH FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	30.00	-
1	ROCKER PANEL OUTER SIDE SKIRTING LH (SN)	DEFORMED	1,000.00	800.00
1	ROCKER PANEL OUTER SIDE SKIRTING SEALANT (SN)	NECESSARY	40.00	40.00

Report Ref No. CC6/CTI22001304/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR LH WHEEL RIM (SN)	CRACKED	1,101.70	780.00
1	REAR LH TYRE (SN)	CUT	250.00	180.00
			2,571.70	1,890.00
	LABOUR			
	PANEL BEATING. INCLUSIVE OF THE REPAIR OF FRONT LH DOOR.		1,600.00	1,200.00
	SPRAY PAINTING.		1,400.00	1,200.00
	WIRING.		50.00	30.00
	TO REMOVE UPHOLSTERY AND REAR SEAT.		200.00	120.00
	TO TRANSFER FRONT AND REAR DOOR FITTINGS.		300.00	80.00
	TO PERFORM WHEEL ALIGNMENT.		150.00	80.00
	TO DISMANTLE REAR UNDERCARRIAGE.		380.00	220.00
	TOWING FEES (KING ROLLER).		120.00	120.00
	TO SPRAY TUFF COAT.		150.00	100.00
			4,350.00	3,150.00
GRAND TOTAL			17,491.20	10,729.52
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,500.00

Report Ref No. CC6/CTI22001304/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJF 282C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

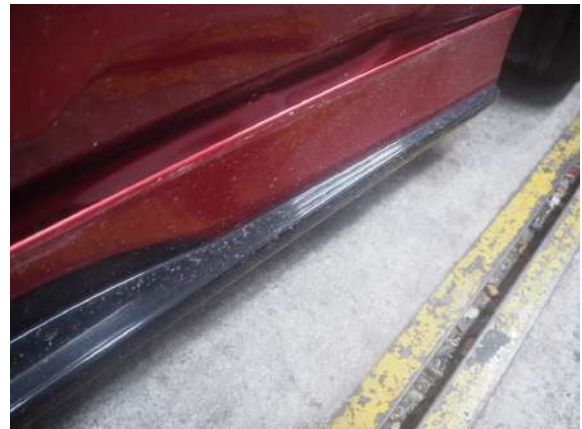





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

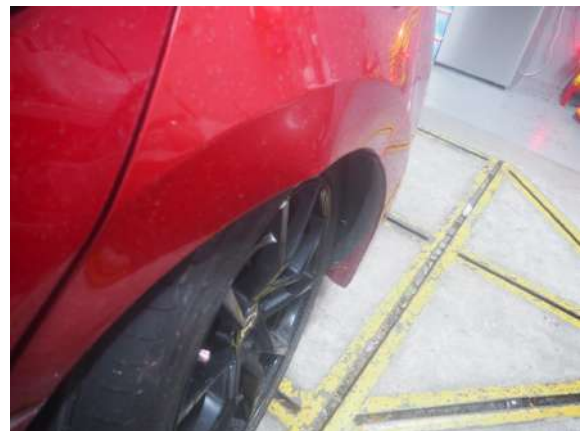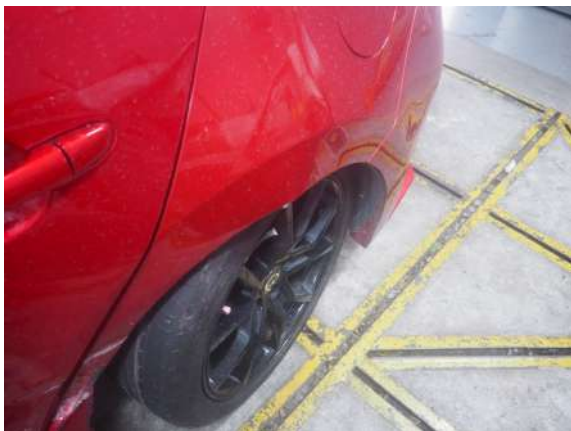





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

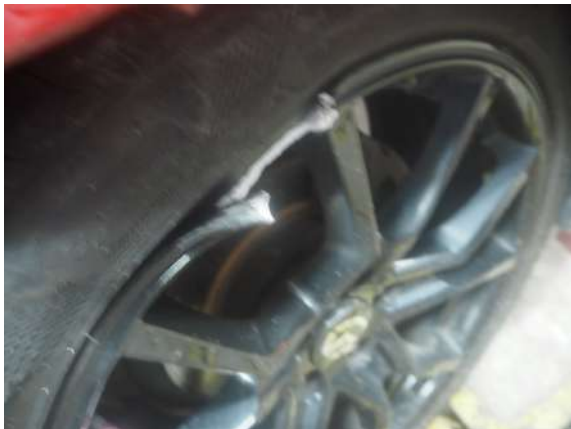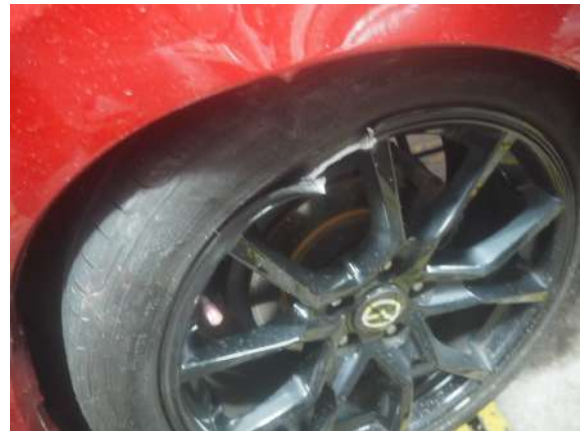







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

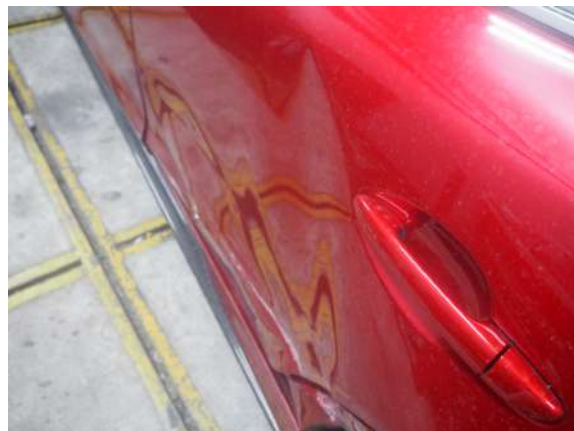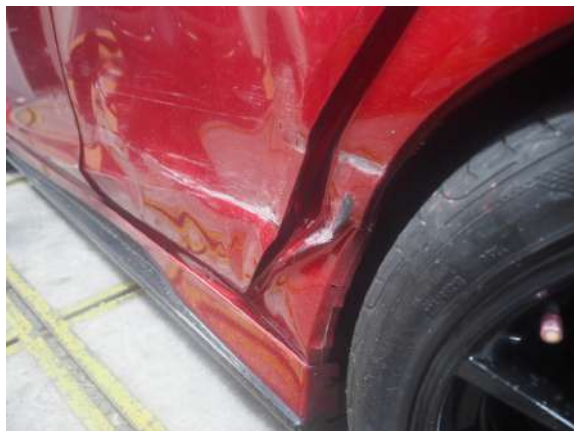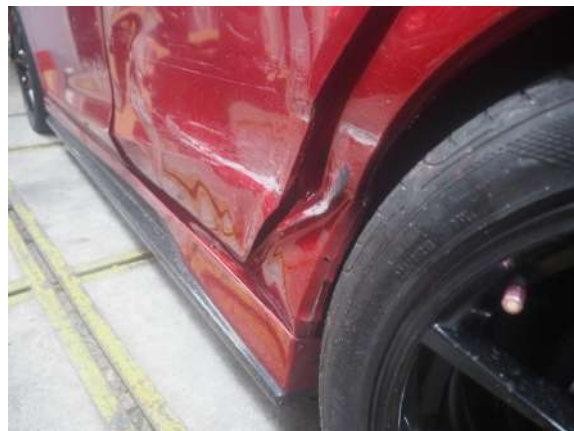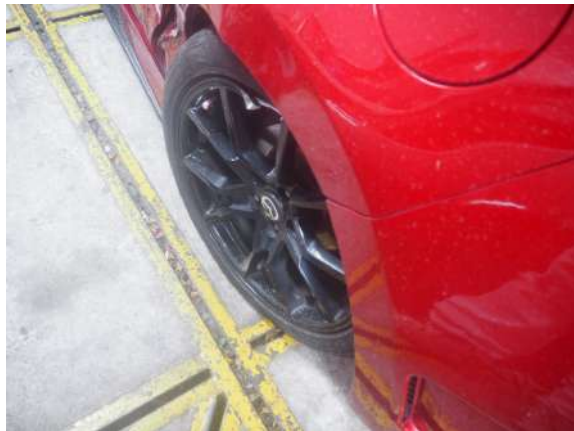






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

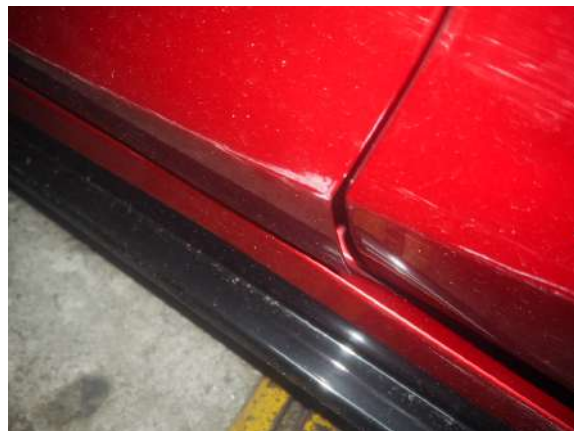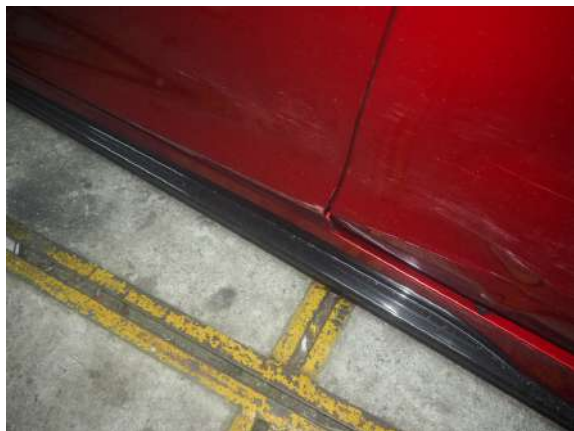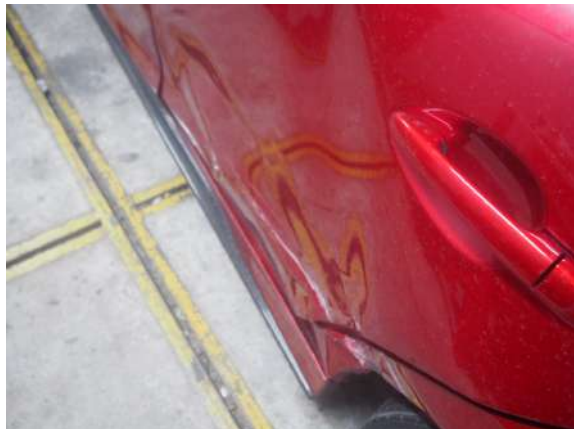




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

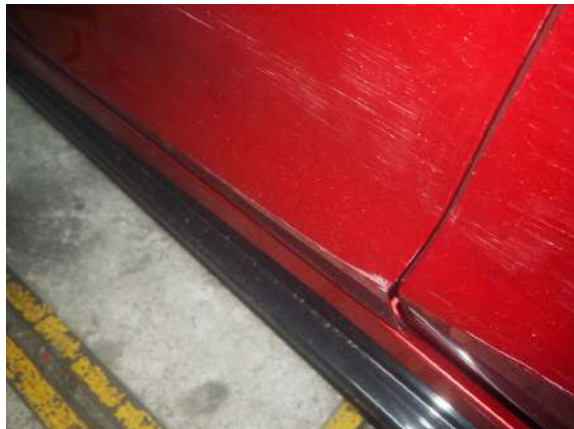



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJF 282C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

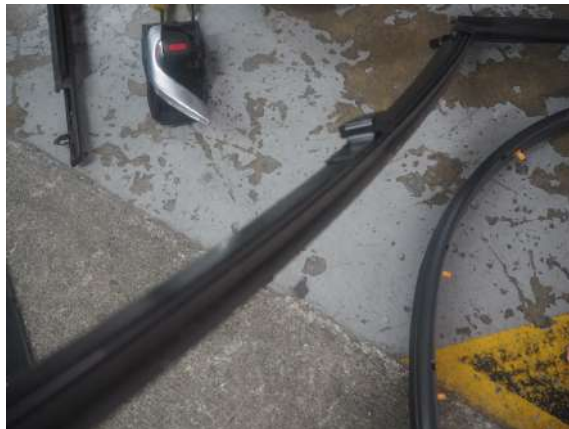



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

