

159 TICK HAI MOTOR
1 KAKI BUKIT AVE 6 #01-20 SINGAPORE 417883
TEL: 6842 9089 FAX: 6841 2869
REG NO : 53033608A

Vehicle Number: SKS5321K
Vehicle Model : Mitsubishi Lancer EX 1.6 AT LED Tail Lamp
Manufacturing Year : 2015
Chassis : JMYSRCY1AFU003996


LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

S/N.	Item Description	Amount
1	Front Bumper	\$ 1,264.74
2	Front Bumper Side Retainer (RH)	\$ 19.26
3	Front Bumper Clip x 1 set	\$ 64.20
4	Foglamp Cover (RH)	\$ 37.24
5	Front Bumper Lower Grille	\$ 95.60
6	Front Bumper Reinforcement	\$ 157.80
7	Front Support Panel (RH)	\$ 100.15
8	Front Wiper Tank	\$ 104.00
9	Front Wiper Tank Motor	\$ 98.60
10	Headlamp (RH)	\$ 1,016.93
11	Headlamp Lower Retainer (RH)	\$ 23.11
12	Front Fender (RH)	\$ 754.99
14	Front Fender Inner Garnish (RH)	\$ 132.25
15	Front Fender Inner Garnish Clip x 1 set	\$ 35.00
16	Front Shock Absorber (RH)	\$ 570.10
17	Front Knuckle (RH)	\$ 412.16
18	Front Knuckle Bearing (RH)	\$ 183.61
19	Front Lower Arm (RH)	\$ 390.34
Total :		\$ 5,460.08
Less 10% :		\$ 546.01
Amount :		\$ 4,914.08

Labour	Amount (\$)
To conduct 4-wheel alignment	\$ 120.00
To check front electrical wiring system and focus lamp	\$ 180.00
To remove & install front RH undercarriages	\$ 280.00
Labour to remove, cut, change & panel beating	\$ 800.00
To putty and respray affected areas	\$ 750.00
Taufik 97495749/62563561	
WP 15/2/22 R	
Lumpsum, Resurvey after repair.	Labour Total : \$ 2,130.00
4 days.	Total (Parts & Labour) \$ 7,044.08

Taufik 99495749 / 62563561
wp 15/2/22 &
Lumpsum, Resurvey after repair
4 days
taufik@lkkauto.com

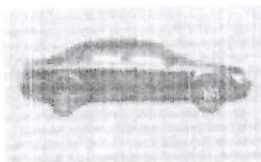

PEOPLES AUTO TRADING
BLK 3007 UBI ROAD 1 #01-400
TEL 6741 4646



COMPUTERIZED ALIGNMENT SPECIALISTS

CUSTOMER	TICK HAI	DATE	Feb 15, 2022 1:25:54 PM
FIRST NAME			
LICENSE NO.	SKS 5321 K		
MILEAGE	192473		
MAKE	CUSTOM	MODEL	MITSUBISHI LANCER CY
NOTES			

Front Wheel	SPECS				DIAGNOSIS				ADJUSTMEN			
	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.00	0.00	1.00			1.50				1.50		
PARTIAL TOE	-0.50	0.00	0.50		-0.70		2.20		-1.50		3.10	
SET BACK	---	---	---			-0°06"				-0°06"		
CAMBER	-0°44"	0°00"	0°44"		-0°04"		-1°02" 0°56"		-0°02"		-1°02" 1°00"	
CASTER	1°30"	2°30"	3°30"		2°42"		2°38" 0°02"		2°42"		2°38" 0°02"	
KING-PIN	---	---	---		13°04"		13°12" 0°06"		13°04"		13°12" 0°06"	
INCL ANGLE	---	---	---		13°00"		12°10"		13°02"		12°10"	
Toe-out on turns	---	---	---		---		---		---		---	
STEERING IN	---	---	---		---		---		---		---	
STEERING OUT	---	---	---		---		---		---		---	

Rear Wheel	SPECS				DIAGNOSIS				ADJUSTMEN			
	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.00	1.00	3.10			0.70				0.70		
PARTIAL TOE	-0.50	0.50	1.50		1.90		-1.10		1.90		-1.10	
SET BACK	---	---	---			0°06"				0°06"		
CAMBER	-1°44"	-1°00"	-0°14"		-0°56"		-1°18" 0°22"		-0°56"		-1°18" 0°22"	
THRUST ANGLE	-0°08"	0.00	0°08"			0°14"				0°14"		