



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2206728

INV Date 01/11/2022

Reference CC4/LPC22001467/Apa3q2

Code LPC2

### PROFESSIONAL SERVICE FEE

Vehicle No. GBC 3381R

Insured Veh. GBH 7803M

Claim No. 21/22/22/VC05/025464

Policy No. Z21VC05008726

Accident Date 14/02/2022

Inspection Date 16/02/2022

| Description                    | Total         |
|--------------------------------|---------------|
| Third Party Express Settlement | 400.00        |
| <b>Subtotal</b>                | <b>400.00</b> |
| <b>GST (7%)</b>                | <b>28.00</b>  |
| <b>Grand Total</b>             | <b>428.00</b> |

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                 |                                                                                                                                        |                                                                                                                |                                                               |            |
|-----------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------|------------|
| LONPAC INSURANCE BHD<br>300 BEACH ROAD<br>#17-04/07 THE CONCOURSESINGAPORE 199555 |                                                                                                                                        |                                                                                                                | Ref: CC4/LPC22001467/Apa3q2<br>Date: 01/11/2022<br>Code: LPC2 |            |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                 |                                                                                                                                        |                                                                                                                |                                                               |            |
|                                                                                   | Insured Veh.                                                                                                                           | GBH 7803M                                                                                                      | Veh. Inspected                                                | GBC 3381R  |
|                                                                                   | Policy No.                                                                                                                             | Z21VC05008726                                                                                                  | Coverage (\$)                                                 | 0.00       |
|                                                                                   | Claim No.                                                                                                                              | 21/22/22/VC05/025464                                                                                           | Excess (\$)                                                   | 0.00       |
|                                                                                   | Assign From                                                                                                                            | GERALD                                                                                                         | Assign Date                                                   | 15/02/2022 |
| <b>2. Vehicle Particulars &amp; Condition</b>                                     |                                                                                                                                        |                                                                                                                |                                                               |            |
|                                                                                   | Make & Model                                                                                                                           | HYUNDAI STAREX                                                                                                 | c.c                                                           | 2497       |
|                                                                                   | Engine No.                                                                                                                             | HIDDEN                                                                                                         | Year of Reg.                                                  | 2011       |
|                                                                                   | Chassis No.                                                                                                                            | KMFWBX7JLCU407955                                                                                              | Colour                                                        | BLACK      |
|                                                                                   | Odometer                                                                                                                               | 131878 KM                                                                                                      | Steering                                                      | IN ORDER   |
|                                                                                   | Brakes                                                                                                                                 | IN ORDER                                                                                                       | Modification                                                  | SPORTS RIM |
|                                                                                   | General                                                                                                                                | GOOD                                                                                                           |                                                               |            |
| <b>3. Conditions of Tyres</b>                                                     |                                                                                                                                        |                                                                                                                |                                                               |            |
|                                                                                   |                                                                                                                                        | Size                                                                                                           | Make                                                          | Balance    |
|                                                                                   | R/H Front Tyre                                                                                                                         | 215/70 R16                                                                                                     | HABILEAD                                                      | 6 mm       |
|                                                                                   | L/H Front Tyre                                                                                                                         | 215/70 R16                                                                                                     | HABILEAD                                                      | 6 mm       |
|                                                                                   | R/H Rear Tyre                                                                                                                          | 215/70 R16                                                                                                     | HABILEAD                                                      | 6 mm       |
|                                                                                   | L/H Rear Tyre                                                                                                                          | 215/70 R16                                                                                                     | HABILEAD                                                      | 6 mm       |
| <b>4. Description of Damages</b>                                                  |                                                                                                                                        |                                                                                                                |                                                               |            |
|                                                                                   | THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION.<br><br>DAMAGES SEE DETAILS.                                               |                                                                                                                |                                                               |            |
| <b>5. General Information</b>                                                     |                                                                                                                                        |                                                                                                                |                                                               |            |
|                                                                                   | Accident Date                                                                                                                          | 14/02/2022                                                                                                     | Inspection Date                                               | 16/02/2022 |
|                                                                                   | Survey held at                                                                                                                         | ADVANCE AUTO GARAGE<br>23 KAKI BUKIT AVENUE 4, #04-01 VICOM KAKI BUKIT INSPECTION CENTER,<br>SINGAPORE 415933. |                                                               |            |
| <b>5a. Remarks</b>                                                                |                                                                                                                                        |                                                                                                                |                                                               |            |
|                                                                                   | A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.<br>B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                                                                |                                                               |            |
| <b>5b. Estimate Days of Repair</b>                                                |                                                                                                                                        |                                                                                                                |                                                               |            |
|                                                                                   | ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                    |                                                                                                                | 10 Working Days                                               |            |



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBC 3381R

| Qty | Description of Parts               | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------|---------------|---------------------------|-------------------|
|     | <b><u>REPLACEMENT OF PARTS</u></b> |               |                           |                   |
| 1   | FRONT BUMPER                       | DEFORMED      | 424.00                    | 424.00            |
| 2   | FRONT BUMPER SIDE HOLDER @\$35.00  | NECESSARY     | 70.00                     | 70.00             |
| 1   | FRONT BUMPER LOWER GARNISH         | NOT NECESSARY | 394.00                    | -                 |
| 1   | FRONT BUMPER LOWER GRILLE          | CRACKED       | 422.00                    | 422.00            |
| 1   | FRONT BUMPER REINFORCEMENT         | NOT NECESSARY | 323.00                    | -                 |
| 1   | FRONT BUMPER SPONGE                | CRACKED       | 155.00                    | 155.00            |
| 1   | FRONT GRILLE                       | CRACKED       | 398.00                    | 398.00            |
| 1   | FRONT GRILLE LOGO                  | NECESSARY     | 52.00                     | 52.00             |
| 2   | HEADLAMP @\$621.00                 | CRACKED       | 1,242.00                  | 1,242.00          |
| 1   | FRONT SUPPORT PANEL TOP COVER      | NOT NECESSARY | 152.00                    | -                 |
| 1   | AIR CON FAN                        | CRACKED       | 462.00                    | 462.00            |
| 1   | AIR CON CONDENSER                  | NOT NECESSARY | 1,082.00                  | -                 |
| 1   | RADIATOR                           | NOT NECESSARY | 951.00                    | -                 |
| 1   | REAR BUMPER                        | DISTORTED     | 435.00                    | 435.00            |
| 2   | REAR BUMPER SIDE HOLDER @\$38.00   | NECESSARY     | 76.00                     | 76.00             |
| 1   | REAR BUMPER TOP GAENISH            | DEFORMED      | 98.00                     | 98.00             |
| 1   | REAR BUMPER REINFORCEMENT          | DISTORTED     | 347.00                    | 347.00            |
| 1   | REAR BUMPER SPONGE                 | CRACKED       | 114.00                    | 114.00            |
| 1   | REAR END PANEL                     | DISTORTED     | 586.00                    | 586.00            |
| 1   | REAR END PANEL TOP GARNISH         | DEFORMED      | 132.00                    | 132.00            |
| 2   | TAILLAMP @\$385.00                 | CRACKED       | 770.00                    | 770.00            |
| 2   | TAILLAMP LOWER APRON @\$95.00      | N/S TORN      | 190.00                    | 95.00             |
| 1   | TAILGATE                           | DISTORTED     | 2,318.00                  | 2,318.00          |
| 1   | TAILGATE LOCK                      | DAMAGED       | 214.00                    | 214.00            |
| 1   | TAILGATE WEATHERSTRIP              | CUT           | 195.00                    | 195.00            |
| 1   | TAILGATE OUTER GARNISH             | NOT NECESSARY | 242.00                    | -                 |
| 1   | TAILGATE INNER TRIM BOARD          | DEFORMED      | 253.00                    | 253.00            |
| 2   | TAILGATE DAMPER @\$290.00          | NOT NECESSARY | 580.00                    | -                 |
| 1   | TAILGATE GLASS MOULDING            | NECESSARY     | 286.00                    | 286.00            |
| 1   | HYUNDAI LOGO                       | NECESSARY     | 55.00                     | 55.00             |
| 1   | HYUNDAI WORDING                    | NECESSARY     | 48.00                     | 48.00             |

Report Ref No. CC4/LPC22001467/Apa3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

| Qty | Description of Parts                     | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|------------------------------------------|---------------|---------------------------|-------------------|
| 1   | H 1 EMBLEM                               | NECESSARY     | 58.00                     | 58.00             |
| 1   | REAR EXHAUST PIPE                        | NOT NECESSARY | 1,280.00                  | -                 |
| 1   | REAR EXHAUST PIPE MOUNTING               | NOT NECESSARY | 45.00                     | -                 |
| 1   | REAR EXHAUST PIPE GASKET                 | NOT NECESSARY | 38.00                     | -                 |
|     | LESS 20% DISCOUNT                        |               | -                         | -1,861.00         |
|     |                                          |               | 14,487.00                 | 7,444.00          |
|     | <b><u>SPECIAL NETT ITEMS</u></b>         |               |                           |                   |
| 1   | FRONT NUMBER PLATE (SN)                  | CRACKED       | 30.00                     | 30.00             |
| 1   | FRONT NUMBER PLATE HOLDER (SN)           | CRACKED       | 30.00                     | 30.00             |
| 1   | FRONT BUMPER CLIPS (SN)                  | NECESSARY     | 30.00                     | 30.00             |
| 1   | FRONT GRILLE CLIPS (SN)                  | NECESSARY     | 20.00                     | 20.00             |
| 1   | FRONT SUPPORT PANEL TOP COVER CLIPS (SN) | NOT NECESSARY | 20.00                     | -                 |
| 1   | REAR NUMBER PLATE (SN)                   | NOT NECESSARY | 30.00                     | -                 |
| 1   | REAR NUMBER PLATE HOLDER (SN)            | NOT NECESSARY | 30.00                     | -                 |
| 1   | REAR BUMPER CLIPS (SN)                   | NECESSARY     | 30.00                     | 30.00             |
| 1   | REVERSE SENSOR (SN)                      | DAMAGED       | 280.00                    | 200.00            |
| 1   | REAR END PANEL TOP GARNISH CLIPS (SN)    | NECESSARY     | 20.00                     | 20.00             |
| 1   | REAR END PANEL SEALANT (SN)              | NECESSARY     | 60.00                     | 60.00             |
| 1   | TAILGATE INNER TRIM BOARD CLIPS (SN)     | NECESSARY     | 30.00                     | 30.00             |
| 1   | TAILGATE GLASS SEALANT (SN)              | NECESSARY     | 60.00                     | 60.00             |
| 1   | 70KM/H STICKER (SN)                      | NECESSARY     | 10.00                     | 10.00             |
|     |                                          |               | 680.00                    | 520.00            |
|     | <b><u>LABOUR</u></b>                     |               |                           |                   |
|     | PANEL BEATING .                          |               | 2,000.00                  | 1,400.00          |
|     | SPRAY PAINTING.                          |               | 2,000.00                  | 1,700.00          |
|     | WIRING.                                  |               | 100.00                    | 60.00             |
|     | TO REMOVE REVERSE SENSOR .               |               | 100.00                    | 50.00             |
| 1   | TO SPRAY TUFF COAT.                      |               | 150.00                    | 60.00             |
|     | TO REMOVE UPHOLSTERY .                   |               | 150.00                    | 60.00             |
|     | TO REMOVE EXHAUST PIPE .                 | NOT NECESSARY | 150.00                    | -                 |
|     | TO REMOVE TAILGATE GLASS .               |               | 180.00                    | 120.00            |
|     | TO TRANSFER TAILGATE FITTINGS.           |               | 150.00                    | 80.00             |

Report Ref No. CC4/LPC22001467/Apa3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

| Qty         | Description of Parts                           | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-------------|------------------------------------------------|---------------|---------------------------|-------------------|
|             | TO REMOVE CONDENSER AND TO TOP UP AIR CON GAS. | NOT NECESSARY | 120.00                    | -                 |
|             | TO REMOVE RADIATOR AND TO TOP UP COOLANT.      | NOT NECESSARY | 120.00                    | -                 |
|             |                                                |               | 5,220.00                  | 3,530.00          |
| GRAND TOTAL |                                                |               | 20,387.00                 | 11,494.00         |

|                                                                         |  |  |  |          |
|-------------------------------------------------------------------------|--|--|--|----------|
| RECOMMENDED COST OF LUMP SUM REPAIRS<br>(TO ITS PRE-ACCIDENT CONDITION) |  |  |  | 9,200.00 |
|-------------------------------------------------------------------------|--|--|--|----------|

Report Ref No. CC4/LPC22001467/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. GBC 3381R

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

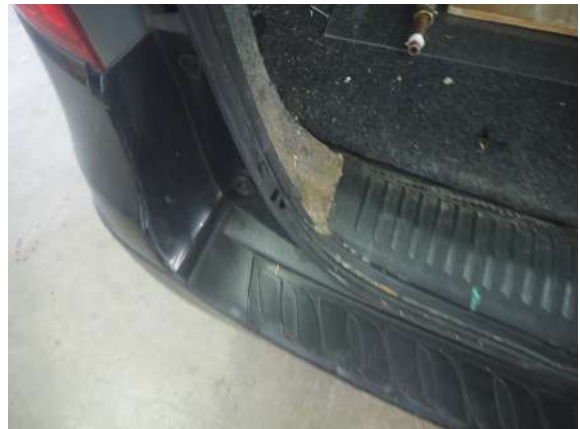





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

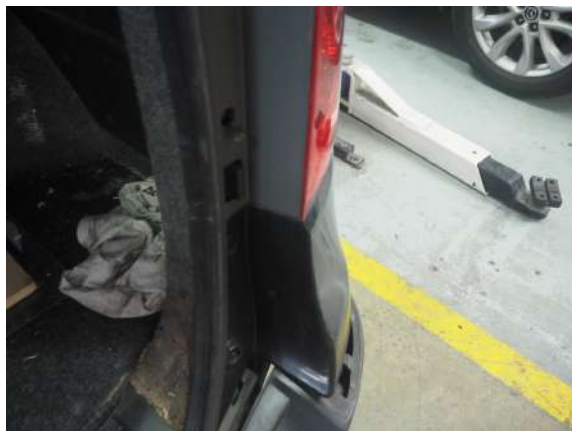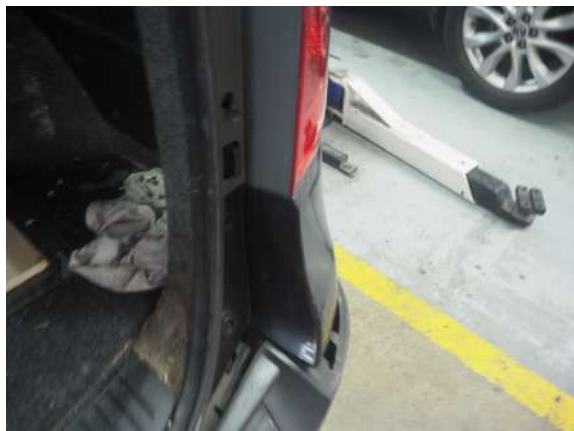



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

**PHOTOGRAPHS FOR VEHICLE NO. GBC 3381R**

**RE-INSPECTION**







## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

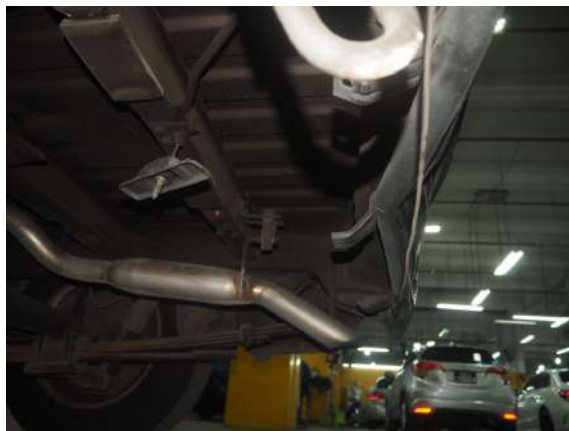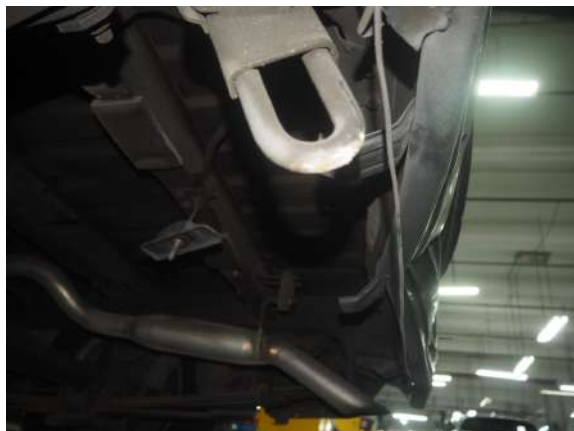



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

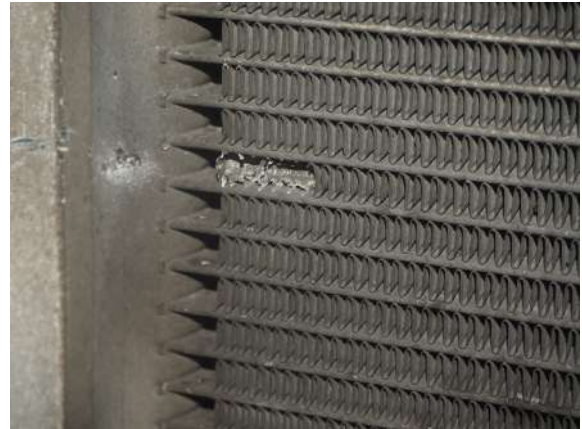



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

