



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2204668

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 28/07/2022
Reference CC4/LPC22001476/Rea3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKP 6889Z
Insured Veh. GBC 135E
Claim No. 22/22/22/VC05/025465
Policy No. Z22VC05010011
Accident Date 13/02/2022
Inspection Date 28/02/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22001476/Rea3q2 Date: 28/07/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBC 135E	Veh. Inspected	SKP 6889Z
	Policy No.	Z22VC05010011	Coverage (\$)	0.00
	Claim No.	22/22/22/VC05/025465	Excess (\$)	0.00
	Assign From	GERALD	Assign Date	15/02/2022
2. Vehicle Particulars & Condition				
	Make & Model	AUDI A3 SEDAN 1.4 TFSI	c.c	1395
	Engine No.	HIDDEN	Year of Reg.	2014
	Chassis No.	WAUZZZ8V6E1026618	Colour	WHITE
	Odometer	155369 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	235/35Z R19	GOODYEAR	6 mm
	L/H Front Tyre	235/35Z R19	GOODYEAR	6 mm
	R/H Rear Tyre	235/35Z R19	GOODYEAR	6 mm
	L/H Rear Tyre	235/35Z R19	GOODYEAR	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	13/02/2022	Inspection Date	28/02/2022
	Survey held at	CYS AUTOMOBILE SERVICES PTE LTD 38 WOODLANDS INDUSTRIAL PARK EAST 1 #07-17 ADMIRALTY INDUSTRIAL PARK SINGAPORE 757700		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKP 6889Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BONNET	TORN	2,330.00	2,330.00
2	BONNET HINGES @\$57.00	BENT	114.00	114.00
2	BONNET TOP LOCK CATCH @\$55.00	SERVICEABLE	110.00	-
1	BONNET LOWER LOCK RH	SERVICEABLE	158.00	-
1	HEADLAMP ASSY RH	BROKEN	1,670.00	1,670.00
1	FRONT BUMPER	CUT	1,550.00	1,550.00
2	FRONT BUMPER SIDE BRACKETS @\$42.00	O/S CRACKED / N/S NOT NECESSARY	84.00	42.00
1	FRONT FENDER RH	BUCKLED	690.00	690.00
1	FRONT FENDER INNER SHIELD RH	CUT	140.00	140.00
1	FRONT SUPPORT PANEL	CRACKED	690.00	690.00
	LESS 10% DISCOUNT		-753.60	-722.60
			6,782.40	6,503.40
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	SET FRONT FENDER INNER SHIELD CLIPS (SN)	NECESSARY	130.00	40.00
			180.00	70.00
<u>LABOUR</u>				
	TO REMOVE AIR-CON CONDENSER, PIPE, DRIER AND TOP-UP AIR-CON GAS.	NOT NECESSARY	120.00	-
	TO CHECK WIRING FUNCTION.		50.00	30.00
	TO APPLY RUST PROOFING ON REPLACED / REPAIRED PANEL.		80.00	40.00
	LABOUR CHARGES.		700.00	600.00
	TO PUTTY AND SPRAY PAINTING CHARGES.		900.00	800.00
			1,850.00	1,470.00
GRAND TOTAL			8,812.40	8,043.40



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,400.00
---	--	--	----------

Report Ref No. CC4/LPC22001476/Rea3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKP 6889Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

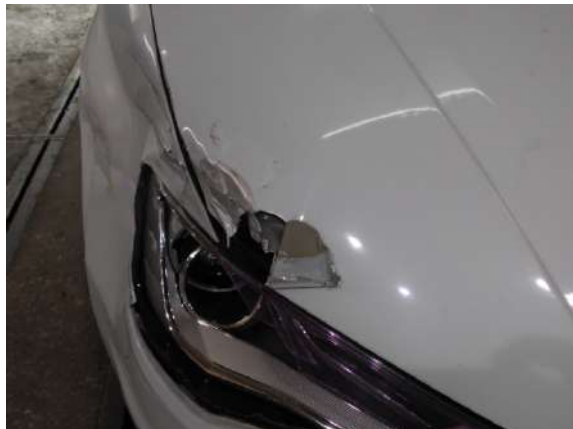




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

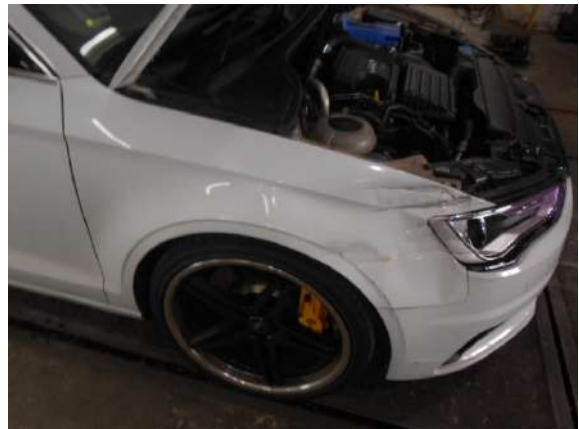



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

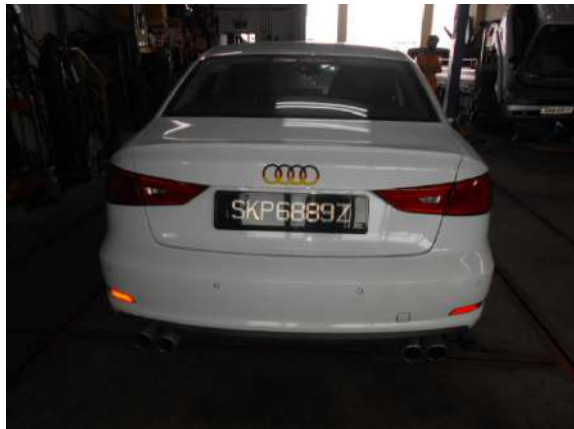



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKP 6889Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

