



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2206650

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 27/10/2022
Reference CC6/CTI22001576/Upa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBF 4156C
Insured Veh. GBB 7561S
Claim No. SNM22D201191/C02
Policy No. DMCVSNW00015852200
Accident Date 16/02/2022
Inspection Date 18/02/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22001576/Upa3q2 Date: 27/10/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBB 7561S	Veh. Inspected	GBF 4156C	
Policy No.	DMCVSNW00015852200	Coverage (\$)	0.00	
Claim No.	SNM22D201191/C02	Excess (\$)	0.00	
Assign From		Assign Date	18/02/2022	
2. Vehicle Particulars & Condition				
Make & Model	FIAT DOBLO CARGO (A)	c.c	1598	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	ZFA26300006D16931	Colour	WHITE	
Odometer	175950 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/60 R16	NEXEN	6 mm	
L/H Front Tyre	195/60 R16	NEXEN	6 mm	
R/H Rear Tyre	195/60 R16	NEXEN	6 mm	
L/H Rear Tyre	195/60 R16	NEXEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	16/02/2022	Inspection Date	18/02/2022	
Survey held at	LIU'S BROTHER AUTO ENGINEERING WORKSHOP 1 KAKI BUKIT AVENUE 6 #01-01 AUTOBAY @ KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBF 4156C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DISTORTED	745.00	589.00
1	SET REAR BUMPER CLIPS	NECESSARY	65.00	50.00
1	REAR BUMPER REINFORCEMENT	BENT	475.30	461.00
1	REAR RH TAILGATE	DENTED	1,895.90	1,895.90
1	REAR RH TAILGATE WEATHERSTRIP	NOT NECESSARY	297.00	-
1	REAR RH TAILGATE OUTER GARNISH	CRACKED	321.80	321.80
1	REAR RH TAILGATE 'FIAT' EMBLEM	SERVICEABLE	87.80	-
1	REAR RH TAILGATE 'PROFESSIONAL' EMBLEM	NECESSARY	163.50	145.00
1	REAR RH REFLECTOR	BROKEN	98.60	75.00
1	REAR RH TAILGATE GLASS	SHATTERED	540.00	485.00
1	REAR RH TAILGATE WIPER MOTOR	SERVICEABLE	428.00	-
1	REAR LH TAILGATE OUTER GARNISH	CRACKED	279.00	279.00
	LESS 10% DISCOUNT		-	-430.17
			5,396.90	3,871.53
<u>SPECIAL NETT ITEMS</u>				
1	REAR BUMPER REVERSE SENSOR (SN)	SHORTED	220.00	200.00
1	REAR RH TAILGATE '6 PAX' STICKER (SN)	NECESSARY	15.00	10.00
1	REAR RH TAILGATE GLASS SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR LH TAILGATE '70KM/H' STICKER (SN)	NECESSARY	15.00	10.00
1	REAR RH TAILGATE GLASS SEALANT (SN)	NOT NECESSARY	80.00	-
			410.00	260.00
<u>LABOUR</u>				
	LABOR FOR PANEL BEATING ,CUT,WELD STRAIGHTEN & REPLACING PARTS ETCS.		800.00	580.00
	TO PUTTY & SPRAY PAINTING & INCLUDING TOUCH UP PAINT ON ACCIDENT AFFECTED AREAS.		800.00	680.00
	REMOVE AND REFIX REAR RH & LH TAILGATE COMPONENTS & WIPER MECHANISM.		160.00	60.00
	REMOVE AND REFIX REAR REVERSE SENSOR .		100.00	50.00
	TO APPLY RUST PROOFING ,RESEAL TUFF-COATING TREATMENT ON ACCIDENT AREA.		80.00	40.00

Report Ref No. CC6/CTI22001576/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & INSTALL REAR RH & LH WINDSCREEN GLASS TO FACILITATE REPAIRS.		240.00	100.00
			2,180.00	1,510.00
GRAND TOTAL			7,986.90	5,641.53
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,500.00

Report Ref No. CC6/CTI22001576/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 4156C

INSPECTION

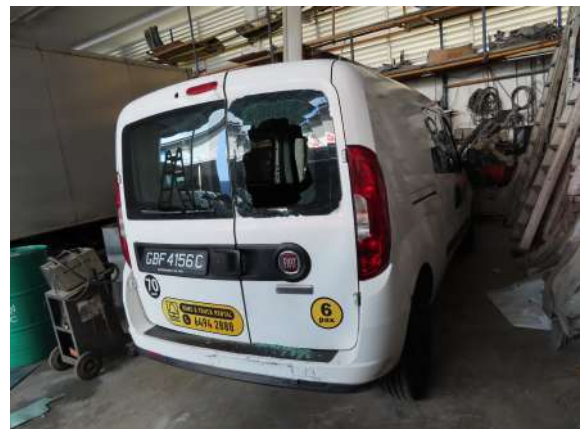



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

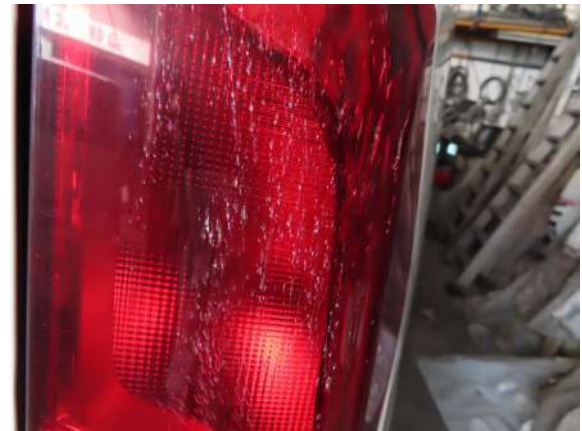




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

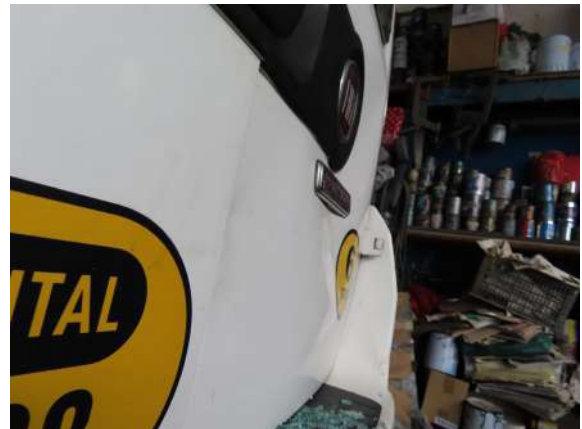




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

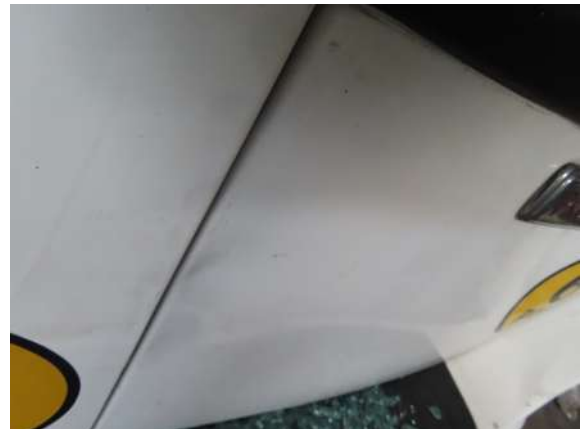



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 4156C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 4156C

RE-INSPECTION

