

ASS. REC. BY: TGLM

REF:

CS/CT/22001590/Bⁿy3offer
15K

Denise

ASSIGNMENT

From: _____ Date: 21/2/2022

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SC4H35

at Workshop m/s Bifrost Auto

of 8 Raki Bt Ave 4 Premier #01-49

Insured: _____

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

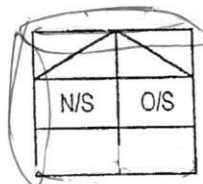Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: 174,000

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 12 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SC4H35 Yr Regn: 25/11/2016

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Porsche Macan PDK 4965 1984

Colour: White A/C: Insured / Std / NI / NA

Sp. Reading: 82997 T/Radio: Insured / Std / NI / NA

Eng/No: 041504

C/No: WP122295ZHLB05510

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 265/45/20

R: 295/40/20

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 5 mm R/Bal. 5 mm

L/Bal. 5 mm L/Bal. 5 mm

D.O.A. 12/2/2022 D.O.I. 21/2/2022

Survey held at Bifrost Auto

Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Range: 18,000/2 - 19,000/2

Lump Sum \$15000 and 12 days

Recommended COR: LS \$18,750.00

(Red, \$39926.42, 73%)

15K to YW 05/07/22.

MV 174,000/2

PV 84,523/2

NV 89,477/2

TGLM Mm

17/3/2022

Date/Time, File Pass to?

☐ : Preli. Report

1) 14/7/22

☐ : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 12

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS. \$

Photos

Others

TOTAL

Add Fee:

☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Rep. Format: TP - memmen

Lump Sum / L.B.I. : 15000

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	677A
Vehicle No.:	SGH3S
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Feb 2022
Vehicle Make:	PORSCHE
Vehicle Model:	MACAN PDK CYP E5
Primary Colour:	White
Manufacturing Year:	2016
Engine No.:	041504
Chassis No.:	WP1ZZZ95ZHLB05510
Maximum Power Output:	185.0 kW (248 bhp)
Open Market Value:	\$62,517.00
Original Registration Date:	25 Nov 2016
First Registration Date:	25 Nov 2016
Transfer Count:	2
Actual ARF Paid:	\$84,531.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	24 Nov 2026
PARF Rebate Amount:	\$59,171.00
COE Expiry Date:	24 Nov 2026
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$53,001.00
COE Rebate Amount:	\$25,352.00
Total Rebate Amount:	\$84,523.00

The information contained herein is correct as at 12 Feb 2022

OK

MV 174,000/2
PV 84,523/2
NV 89,477/2

TC Lim Min
17/3/2022

VEHICLE NO: 56478.

MAKE & MODEL: PORSCHE MACAN.

AUTO / MANUAL

DATE OF ACCIDENT	12 / 02 / 22.	*CC
TIME OF ACCIDENT	1305.	AM / PM
LOCATION OF ACCIDENT	MACKENZIE RD.	
EXACT PURPOSE USED AT TIME OF ACCIDENT	EMPLOYMENT / PRIVATE USE / PRIVATE HIRE	
NAME OF OWNER	HU JUNBIN (CW JUNBIN).	
EMAIL: MIKE@PTMALT.COM	Office:	MOBILE: 8758 5733
NRIC	58482677A.	
CLAIM TYPE	OD / THIRD PARTY / REPORTING ONLY	
FLEET POLICY:	YES / NO ?	
INSURANCE CO.	AKA	
TYPE OF COVERAGE	Comprehensive / Third Party / Third Party Fire & Theft	
POLICY NO.	GA 578369 / 1	
NAME OF DRIVER	AS ABOVE / IF NO.	
NRIC	"	
DATE OF BIRTH	10 / 10 / 84.	
ANY PASSENGER	YES / NO :	
NAME OF PASSENGER	-	
GENDER OF PASSENGER	MALE / FEMALE	
OCCUPATION	Outdoor / Indoor	
DATE OF DRIVING PASS	27 / 07 / 09	
GENDER	Male / Female	
CONTACT NO.	Mobile: " Office: Home:	
EMAIL:	"	
ADDRESS	13 YISHUN CLOVE #07-27 SC768010.	
DOES DRIVER OWN OTHER VEHICLES?	NO / If yes: Reg No.	INSURER -
RELATIONSHIP	Employee / If No: SELF.	
WEATHER CONDITION	Clear / Raining / Other:	
ROAD SURFACE	Dry / Wet / Other:	
ANY INJURIES	NO / If yes: Who?	
CONTACT NO.		
POLICE REPORT	NO / If yes: Where?	
NOTICE OF INTENDED PROSECUTION GIVEN?	NO / IF YES: WHO?	
VEHICLE B NO.	SG4 4961K.	Any Passenger:
NAME		
CONTACT NO.		
VEHICLE C NO.		Any Passenger:
VEHICLE D NO.		Any Passenger:
VEHICLE E NO.		Any Passenger:
VEHICLE F NO.		Any Passenger:
ANY WITNESS		
WITNESS CONTACT NO.		
WAS THERE ANY VIDEO CAPTURE?	YES / NO	
WAS THERE ANY AUDIO RECORDED?	YES / NO	
SCENE ACCIDENT PHOTOS TAKEN?	YES / NO	
**WORKSHOP:		

Have you been approach by unknown person soliciting?


Describe circumstances of the accident

ON THE STATED DATE AND TIME, I WAS TRAVELLING IN MY
OWN LANE.

OUT OF NOWHERE, VEH B SWITCHED LANES INTO MY LANE AND
HIT ONTO THE LEFT PORTION OF MY VEHICLE.

Declaration

We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date &
Time

Driver's Signature (if driver is not the policyholder) / Date
& Time

Witnessed by Reporting Centre
Personnel

BIFROST AUTO PTE LTD

8 KAKI BUKIT AVE 4, PREMIER @ KAKI BUKIT

#01-49 SINGAPORE 415875

Tel: +65 64524457

Fax: +65 64524584

Company Reg No: 201929175W

Repair Estimate

Vehicle number: SGH3S

Make & Model: Porsche Macan PDK CYP

Chassis number: WP1ZZZ95ZHLB05510

No.	Description of spare parts	Qty	Amount
1	Front bumper 1084.90	1	\$ 1,623.00
2	Front bumper LH side bracket ✓	1	\$ ✓ 244.00
3	Front LH fender "upper" ✓	1	\$ ✓ 1,121.00
4	Front LH fender "lower"	1	\$ -642.00
5	Front LH fender splash shield	1	\$ 231.00
6	Front LH sport rim ✓	1	\$ ✓ 2,462.00
7	Front LH shock absorber 895.00	1	\$ 1,632.00
8	Front LH lower arm 899.50	1	\$ 1,342.00
9	Front LH lower arm ball joint ✓	1	\$ ✓ 113.00
10	Front LH knuckle arm 1425.20	1	\$ 1,732.00
11	Front LH wheel bearing 420.00	1	\$ -441.00
12	Front LH upper arm 799.50	1	\$ 1,022.00
13	Front LH control arm 700.00	1	\$ 903.00
14	Front LH door 2027.20	1	\$ -3,321.00
15	Front LH door lower protector 217.00	1	\$ 299.00
16	Front LH weatherstrip ✓	1	\$ ✓ 393.00
17	Front LH door frame trim tape	1	\$ 178.00
18	LH side mirror assy	1	\$ 1,436.00
19	LH side rocker panel garnish 320.00	1	\$ 454.00
20	LH side rocker panel garnish sponge	2	\$ 121.00
21	Rear LH door 1989.40	1	\$ 3,482.00
22	Rear LH door lower protector 217.00	1	\$ 299.00
23	Rear LH door inner insulator	1	\$ -16.00
24	Rear LH door weatherstrip seal ✓	1	\$ ✓ 393.00
25	Rear LH door stone guard sticker ✓	1	\$ ✓ 147.00
26	Rear LH door frame trim tape	1	\$ 178.00
27	Rear LH sport rim	1	\$ 2,462.00
28	Rear LH lower arm	1	\$ -1,152.00
29	Rear LH shock absorber	1	\$ -1,347.00
30	Rear LH knuckle arm	1	\$ -1,608.00
31	Rear LH track control arm	1	\$ -932.00
32	Rear LH upper arm	1	\$ -731.00

2016

CUTV ✓
NECV ✓
DDV ✓
NSX
NDX
CUTV ✓
DDV ✓
BTU ✓
DDV ✓
DDV ✓
JMV ✓
BTU ✓
BTU ✓
DDV ✓
CUTV ✓
NECV ✓
NSX
NDX
DDV ✓
NSX
DDV ✓
CUTV ✓
NSX
NECV ✓
NECV ✓
NNX
NDX

8	Remove and replace rear LH door inner mechanism to new door	\$	180.00	RPTX
9	Remove and replace rear inner trims, carpet, roof lining, seats and boards to assist repair	\$	550.00	NNX
10	Remove and replace rear undercarriage parts to assist repair	\$	550.00	NNX
11	Remove and reinstall rear bumper reverse sensors to assist repair	\$	180.00	NNX
12	Reset and diagnose control unit and fault codes	\$	120.00 350.00	/
			2760.00	

Total: \$ 6,540.00

Survey
21/2/2022
1475
Touin

Resurvey
25/2/2022
1400hrs
Touin Min

Spare Parts: \$ 37,402.02
Special Nett: \$ 1,655.00
Labour: \$ 6,540.00

Total Amount: \$ 45,597.02

Kia Authorised Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Touin Min
17/3/2022

BIFROST AUTO PTE LTD

8 KAKI BUKIT AVE 4, PREMIER @ KAKI BUKIT

#01-49 SINGAPORE 415875

Tel: +65 64524457

Fax: +65 64524584

Company Reg No: 201929175W

Parts price revised and Supplementary

Vehicle number: SGH3S

Make & Model: Porsche Macan PDK CYP

No.	Description of spare parts	Qty	Amount
1	Headlamp garnish LH	1	\$ 286.00
2	Bonnet	1	\$ 2,455.00
3	LH front door inner trim board	1	\$ 1,321.00
		Total	\$ 4,062.00
		Less 10%	\$ 406.20
		Total	\$ 3,655.80

Total Amount**\$****3,655.80**

Resurvey

Lump sum repair

25/2/2022

Repair days 12

Total in

14 Hrs

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

BIFROST AUTO PTE LTD

8 KAKI BUKIT AVE 4, PREMIER @ KAKI BUKIT

#01-49 SINGAPORE 415875

Tel: +65 64524457

Fax: +65 64524584

Company Reg No: 201929175W

Supplementary estimate

Vehicle number: SGH3S

Make & Model: Porsche Macan PDK CYP

No.	Description of spare parts	Qty	Amount
1	LH headlamp assy	1	\$ 3245.80 6,304.00
		Total	\$ 6,304.00
		Less 10%	\$ 630.40
		Total	\$ 5,673.60

Total Amount**\$ 5,673.60**

Resurvey
25/2/22
1400hrs
T. Tan

54926.42

Huey Yon (LKKAUTO)

From: Claims Dept <claims_rar@bifrostauto.com>
Sent: Wednesday, 6 July 2022 3:18 PM
To: Huey Yon (LKKAUTO)
Cc: assessment_ral@bifrostauto.com; Joseph Koh; SUR
Subject: Re: VEHICLE FINALISATION

Without Prejudice

Dear Huey Yon,

May we please obtain your adjusted marked Estimate including the Supplementary so that we can tally the amounts for Vehicle Number: **SGH 3S**

Your help is greatly appreciated.

Thank you.

The contents of this document apply to vehicle damages only. All personal injuries and damages arising therefrom are excluded from the ambit and application of this document.

Best Regards,
Maefel
Motor Claims Department
BIFROST AUTO PTE. LTD

On Tue, 5 Jul 2022 at 15:30, Huey Yon (LKKAUTO) <hueyyon@lkkauto.com> wrote:

Dear Sir/Madam,

Without Prejudice

We will be advising our Principal a cost of repair of below vehicles, subject to their approval

1. GBE 9024E (CHINA-TP)	DOA:20/01/2022	Lump Sum \$14,000.00 & 24 repair days;
2. SGH 3S (CHINA-TP)	DOA:12/02/2022	Lump Sum \$15,000.00 & 12 repair days;

Pls check with you manager

If lost γ repr can be ~~resolute~~

Resolve at 15/c.