



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2301232

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 01/03/2023
Reference CC6/CTI22001591/Eya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMN 8928T
Insured Veh. PC 3279M
Claim No. SNM22D200980/C02
Policy No. DMB1SNA00006272102
Accident Date 08/02/2022
Inspection Date 18/02/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22001591/Eya3q2 Date: 01/03/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	PC 3279M	Veh. Inspected	SMN 8928T	
Policy No.	DMB1SNA00006272102	Coverage (\$)	0.00	
Claim No.	SNM22D200980/C02	Excess (\$)	0.00	
Assign From		Assign Date	18/02/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA NOAH	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	ZWR800364699	Colour	PURPLE	
Odometer	46759 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/55 R15	MICHELIN	5 mm	
L/H Front Tyre	195/55 R15	MICHELIN	5 mm	
R/H Rear Tyre	195/55 R15	MICHELIN	5 mm	
L/H Rear Tyre	195/55 R15	MICHELIN	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	08/02/2022	Inspection Date	18/02/2022	
Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			20 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 7

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 8928T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	BROKEN	680.00	680.00
10	FRONT BUMPER CLIPS @\$5.50	NECESSARY	55.00	30.00
1	FRONT BUMPER SIDE RETAINER RH	BROKEN	110.00	110.00
1	FRONT BUMPER SIDE RETAINER LH	BROKEN	110.00	110.00
1	FRONT RADIATOR GRILLE AIR GUIDE - 53152B	NOT NECESSARY	230.00	-
1	FRONT BUMPER LOWER FOGLAMP GRILLE COVER RH	CUT	150.00	150.00
1	FRONT BUMPER LOWER FOGLAMP GRILLE COVER LH	CUT	150.00	150.00
1	FRONT EMBLEM	CUT	220.00	105.00
1	FRONT LOWER GRILLE ASSY - 53112E	BROKEN	150.00	150.00
1	FRONT REINFORCEMENT	DENTED	320.00	320.00
1	FRONT SPONGE	BROKEN	95.00	95.00
1	FRONT HEADLAMP RH	BROKEN	3,800.00	3,001.00
1	FRONT HEADLAMP LH	BROKEN	3,800.00	3,001.00
1	FRONT HEADLAMP LOWER MOULDING RH	NOT NECESSARY	220.00	-
1	FRONT HEADLAMP LOWER MOULDING LH	NOT NECESSARY	220.00	-
1	FRONT FOG LAMP COVER LH	CUT	160.00	160.00
1	FRONT FOG LAMP COVER RH	CUT	160.00	160.00
1	FRONT SUPPORT PANEL	DENTED	2,000.00	1,211.00
1	FRONT BRACE PANEL	BENT	170.00	170.00
1	FRONT BONNET	DENTED	900.00	900.00
1	FRONT BONNET CHROME TRIM	BROKEN	520.00	345.00
1	FRONT BONNET LOCK	BENT	160.00	160.00
2	FRONT BONNET RUBBER SEAL @\$50.00	NOT NECESSARY	100.00	-
10	FRONT BONNET INSULATOR CLIP @\$5.50	NECESSARY	55.00	30.00
1	FRONT BONNET HINGE RH	BENT	95.00	95.00
1	FRONT BONNET HINGE LH	BENT	95.00	95.00
1	RADIATOR	DENTED	2,400.00	1,861.00
1	RADIATOR AIR GUIDE LH	CRUSHED	160.00	100.00
1	RADIATOR AIR GUIDE RH	CRUSHED	160.00	100.00
1	A/C CONDENSER	DENTED	1,400.00	1,223.00
1	FRONT FENDER RH	DENTED	650.00	650.00

Report Ref No. CC6/CTI22001591/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT FENDER SHIELD RH	NOT NECESSARY	240.00	-
1	FRONT FENDER LH	DENTED	650.00	650.00
1	FRONT FENDER SHIELD LH	NOT NECESSARY	240.00	-
10	FRONT FENDER CLIPS @\$5.50	NOT NECESSARY	55.00	-
1	HYBRID EMBLEM	NECESSARY	90.00	90.00
1	FRONT FENDER SIDE PANEL PROTECTOR LH	NOT NECESSARY	140.00	-
1	FRONT FENDER SIDE PANEL PROTECTOR RH	NOT NECESSARY	140.00	-
1	FRONT SIREN	BROKEN	120.00	120.00
1	REAR BUMPER	BROKEN	580.00	580.00
10	REAR BUMPER CLIPS @\$5.50	NECESSARY	55.00	30.00
1	REAR BUMPER TOW EYE COVER	MISSING	45.00	45.00
1	REAR BUMPER SIDE RETAINER RH	BROKEN	190.00	80.00
1	REAR BUMPER SIDE RETAINER LH	BROKEN	190.00	80.00
1	REAR BUMPER SHORT RETAINER RH	NOT NECESSARY	90.00	-
1	REAR BUMPER SHORT RETAINER LH	NOT NECESSARY	90.00	-
1	REAR BUMPER EXTENSION GARNISH RH	BROKEN	160.00	160.00
1	REAR BUMPER EXTENSION GARNISH LH	BROKEN	160.00	160.00
1	REAR BUMPER REFLECTOR RH	NOT NECESSARY	80.00	-
1	REAR BUMPER REFLECTOR LH	BROKEN	80.00	80.00
1	REAR BUMPER UPPER COVER RH	NOT NECESSARY	190.00	-
1	REAR BUMPER UPPER COVER LH	NOT NECESSARY	190.00	-
1	REAR TAIL LAMP ASSY RH	BROKEN	680.00	680.00
1	REAR TAIL LAMP ASSY LH	BROKEN	680.00	680.00
1	REAR DUCT VENT RH	NOT NECESSARY	140.00	-
1	REAR DUCT VENT LH	BROKEN	140.00	140.00
1	REAR SLIDING DOOR LH	DENTED	1,900.00	1,900.00
1	REAR SLIDING DOOR WEATHERSTRIP LH	NOT NECESSARY	400.00	-
1	REAR SLIDING DOOR FRONT STICKER LH	NECESSARY	80.00	80.00
1	REAR SLIDING DOOR TOP STICKER LH	NECESSARY	80.00	80.00
1	REAR SLIDING DOOR REAR STICKER LH	NOT NECESSARY	190.00	-
1	REAR SLIDING DOOR OUTER WEATHERSTRIP LH - 68164A	NOT NECESSARY	210.00	-
1	REAR SLIDING DOOR RH	DENTED	1,900.00	1,900.00

Report Ref No. CC6/CTI22001591/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SLIDING DOOR WEATHERSTRIP RH	NOT NECESSARY	400.00	-
1	REAR SLIDING DOOR FRONT STICKER RH	NECESSARY	80.00	80.00
1	REAR SLIDING DOOR TOP STICKER RH	NECESSARY	80.00	80.00
1	REAR SLIDING DOOR REAR STICKER RH	NOT NECESSARY	190.00	-
1	REAR SLIDING DOOR OUTER WEATHERSTRIP RH - 68163H	NOT NECESSARY	210.00	-
1	REAR SLIDING DOOR ROLLER LH	BENT	270.00	270.00
1	REAR SLIDING DOOR ROLLER RH	BENT	270.00	270.00
1	REAR ROOF SIDE INNER GARNISH LH - 62480A	CRUSHED	320.00	320.00
1	REAR ROOF SIDE INNER GARNISH RH - 6270A	CRUSHED	320.00	320.00
1	RAER FENDER RH	DENTED	1,400.00	1,400.00
1	REAR FENDER SHIELD RH	NOT NECESSARY	120.00	-
1	REAR FENDER LH	DENTED	1,400.00	1,400.00
1	REAR FENDER SHIELD LH	NOT NECESSARY	120.00	-
10	RAER FENDER CLIPS @\$5.50	NOT NECESSARY	55.00	-
1	REAR FUEL COVER	TO REPAIR SEE LABOUR	220.00	-
1	ROOF SIDE OUTER UPPER RAIL LH - 61226A	DENTED	500.00	500.00
1	ROOF SIDE OUTER UPPER RAIL RH - 61225A	DENTED	500.00	500.00
1	REAR FENDER INNER TRIM LH	BROKEN	720.00	720.00
1	REAR FENDER INNER TRIM RH	BROKEN	720.00	720.00
1	REAR TAILGATE	DENTED	1,900.00	1,712.00
1	REAR TAILGATE CENTER CHROME MOULDING	BROKEN	880.00	581.00
2	REAR TAILGATE LICENSE PLATE LAMP @\$85.00	NOT NECESSARY	170.00	-
1	REAR TAILGATE LOCK	BENT	480.00	420.00
1	REAR TAILGATE WEATHERSTRIP	TORN	390.00	390.00
1	REAR TAILGATE INNER TRIM	BROKEN / CRUSHED	620.00	620.00
1	REAR TAILGATE INNER POCKET HANDLE	CRUSHED	42.00	42.00
1	REAR TAILGATE END STOPPER LH	CRUSHED	25.00	25.00
1	REAR TAILGATE END STOPPER RH	CRUSHED	25.00	25.00
1	REAR TOYOTA EMBLEM	NECESSARY	90.00	90.00
1	REAR HYBRID SYNERGY EMBLEM	NECESSARY	80.00	80.00
1	TAIL LAMP LH	BROKEN	720.00	720.00

Report Ref No. CC6/CTI22001591/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL LAMP LH	BROKEN	720.00	720.00
1	REAR THIRD BRAKE LAMP	BROKEN	260.00	260.00
1	TAILGATE LATCH	BENT	72.00	72.00
1	TAILGATE STAY LH	BENT	480.00	480.00
1	TAILGATE STAY RH	BENT	480.00	480.00
1	TAILGATE STAY BRACKET RH	BENT	95.00	95.00
1	TAILGATE STAY BRACKET LH	BENT	95.00	95.00
1	TAILGATE INNER TRIM GARNISH	CUT	220.00	220.00
1	REAR TAILGATE WIPER ARM	CUT	200.00	140.00
1	REAR TAILGATE WIPER ARM MOTOR	NOT NECESSARY	650.00	-
1	REAR TAILGATE WIPER BLADE	CUT	140.00	90.00
1	REAR END PANEL	DENTED	800.00	685.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	720.00	-
1	REAR ROOF PANEL - 63111	DENTED	2,500.00	2,500.00
1	REAR TAILGATE ROOF LINING	CRUSHED	4,200.00	1,684.00
1	REAR TAILGATE ROOF INNER GARNISH LH	CUT	350.00	350.00
1	REAR TAILGATE ROOF INNER GARNISH RH	CUT	350.00	350.00
1	REAR / END PANEL GARNISH	BROKEN	165.00	165.00
1	REAR FLOOR STEP UNDER COVER	BROKEN	420.00	420.00
1	REAR FLOOR SIDE PANEL LH	NOT NECESSARY	340.00	-
1	REAR FLOOR SIDE PANEL RH	NOT NECESSARY	340.00	-
1	REAR FLOOR PAN REINFORCEMENT	NOT NECESSARY	400.00	-
1	REAR WINDSCREEN	BROKEN	1,300.00	1,300.00
1	REAR QUARTER GLASS LH	BROKEN	960.00	960.00
1	REAR QUARTER GLASS RH	BROKEN	960.00	960.00
2	RAER WINDSCREEN MOULDING @\$100.00	NECESSARY	200.00	200.00
1	REAR WINDSCREEN CHANNEL RH	NOT NECESSARY	95.00	-
1	REAR WINDSCREEN CHANNEL LH	NOT NECESSARY	95.00	-
1	REAR DESKBOARD ASSY	BROKEN	3,200.00	935.00
1	REAR SEAT HEAD REST LH	NOT NECESSARY	520.00	-
1	REAR SEAT HEAD REST RH	NOT NECESSARY	520.00	-
1	POWER SLIDING DOOR SENSOR RH	NOT NECESSARY	1,280.00	-

Report Ref No. CC6/CTI22001591/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	POWER SLIDING DOOR SENSOR LH	NOT NECESSARY	1,280.00	-
1	BONNET INSULATOR (ADDITIONAL)	CRUSHED	250.00	250.00
1	SMALL RADIATOR G9011028030 (ADDITIONAL)	DENTED	1,400.00	932.00
1	RADIATOR TANK (ADDITIONAL)	CRUSHED	240.00	240.00
1	FRONT DOOR RH (ADDITIONAL)	TO REPAIR SEE LABOUR	1,200.00	-
1	FRONT DOOR LH (ADDITIONAL)	TO REPAIR SEE LABOUR	1,200.00	-
1	FRONT DOOR RH STICKER (ADDITIONAL)	NOT NECESSARY	80.00	-
1	FRONT DOOR LH STICKER (ADDITIONAL)	NOT NECESSARY	80.00	-
1	REAR AIRCON DUCT ASSY (ADDITIONAL)	BROKEN	280.00	280.00
1	REAR AIRCON BLOWER ASSY 8850028080 (ADDITIONAL)	BROKEN	3,500.00	2,761.00
1	REAR FENDER INNER TRIM MAT COVER LH (ADDITIONAL)	NOT NECESSARY	280.00	-
1	REAR FENDER INNER TRIM MAT COVER RH (ADDITIONAL)	NOT NECESSARY	280.00	-
1	REAR FENDER RH PLASTIC COVER (ADDITIONAL)	CRUSHED	50.00	50.00
1	REAR FENDER LH PLASTIC COVER (ADDITIONAL)	CRUSHED	50.00	50.00
1	REAR FLOOR VELVET MAT ASSY (ADDITIONAL)	TORN	580.00	580.00
1	TAILGATE INNER TRIM PLASTIC COVER (ADDITIONAL)	NOT NECESSARY	50.00	-
1	REAR FENDER RH LH INNER PANEL @\$150.00 (ADDITIONAL)	DENTED	300.00	300.00
1	REAR FENDER RH LH INNER PANEL @\$150.00 (ADDITIONAL)	DENTED	300.00	300.00
2	TAIL LAMP RH LH PANEL @\$500.00 (ADDITIONAL)	DENTED	1,000.00	600.00
1	END PANEL BRACKET RH (ADDITIONAL)	DENTED	200.00	120.00
1	END PANEL BRACKET LH (ADDITIONAL)	DENTED	200.00	120.00
1	REAR SEAT RH (ADDITIONAL)	DENTED	2,000.00	1,900.00
1	REAR SEAT BELT RH (ADDITIONAL)	JAMMED	1,000.00	760.10
1	REAR SEAT LH (ADDITIONAL)	DENTED	2,000.00	1,900.00
1	REAR SEAT BELT LH (ADDITIONAL)	BROKEN / JAMMED	1,000.00	760.10
1	REAR SEAT BELT CENTER (ADDITIONAL)	BENT / JAMMED	1,000.00	701.10
1	FRONT GRILLE ASSY (ADDITIONAL)	BROKEN	1,850.00	788.00
1	REAR KEY ANTENNA (ADDITIONAL)	BROKEN	100.00	100.00
1	REAR FENDER OUTER GARNISH RH (ADDITIONAL)	MISSING	600.00	600.00

Report Ref No. CC6/CTI22001591/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR FENDER OUTER GARNISH LH (ADDITIONAL)	MISSING	600.00	600.00
1	TAILGATE WIPER ARM COVER (ADDITIONAL)	MISSING	250.00	45.00
1	A/C PIPE (ADDITIONAL)	BENT	850.00	350.00
	LESS 25% DISCOUNT		-	-15,557.58
			90,164.00	46,672.72
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT LICENSE PLATE WITH FRAME (SN)	CUT	40.00	35.00
1	REAR LICENSE PLATE WITH FRAME (SN)	CUT	40.00	35.00
1	REAR FENDER SEALANT (SN)	NECESSARY	40.00	40.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
1	REAR SOLAR FILM (SN)	NECESSARY	250.00	200.00
1	REVERSE SENSOR (SN)	BROKEN	200.00	200.00
1	REAR VIDEO CAM (BLACKVUE) (SN)	MISSING	400.00	400.00
1	COOLANT (SN) (ADDITIONAL)	NECESSARY	40.00	20.00
2	NEW PARTS SEALANT (TAILGATE, BONNET) @\$50.00 (SN) (ADDITIONAL)	NECESSARY	100.00	30.00
1	TYRE PUMP MACHINE (SN) (ADDITIONAL)	BROKEN	200.00	200.00
1	BABY CARRIER (SN) (ADDITIONAL)	BENT	400.00	400.00
1	BROMPTON BIKE (\$2800.00) (10% DEPRECIATION) (SN) (ADDITIONAL)	BENT	3,350.00	2,520.00
1	FLOOR CARPER (REAR BOOT, REAR SEAT ROW) (SN) (ADDITIONAL)	NOT NECESSARY	150.00	-
2	TAIL LAMP LED BULB @\$120.00 (SN) (ADDITIONAL)	SHORTED	240.00	240.00
3	TAIL LAMP SPECIAL CLIPS @\$5.00 (SN) (ADDITIONAL)	NECESSARY	15.00	15.00
			5,505.00	4,375.00
	<u>LABOUR</u>			
	SPRAY PAINTING WHOLE FRONT AND REAR.		2,400.00	2,200.00
	REPLACE REAR INCLUDING FITTING, CUT, WELD AND RE-ALIGN. INCLUSIVE OF THE REPAIR OF REAR FUEL COVER, REAR FLOOR PANEL, FRONT DOOR RH AND FRONT DOOR LH.		2,400.00	2,200.00
	REMOVE AND REFIT REAR REVERSE SENSOR.		80.00	30.00
	TRANSFER DOOR FITTING AND WINDOW MECHANISM TO NEW DOOR.		300.00	200.00

Report Ref No. CC6/CTI22001591/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:7 of 7

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REFIT REAR EXHAUST PIPE AND SILENCER, RE-ALIGN.	NOT NECESSARY	100.00	-
	REMOVE AND REFIT REAR WINDSCREEN.		120.00	120.00
	REMOVE AND REFIT REAR FENDER SIDE GLASS TO FACILITATE REPAIR.		160.00	160.00
	APPLY RUST PROOFING ON REPLACED / REPAIRED PANEL.		100.00	50.00
	RESET FAULT CODE FOR REMOVE REFIT SENSOR (HYBRID).		150.00	100.00
	COMPUTERIZED WHEEL ALIGNMENT.		75.00	75.00
	CHECK AND RECTIFY ELECTRICAL WIRING.		30.00	30.00
	REMOVE & REFIT UPHOLSTERY, GARNISHES, TRIMMING TO FACILITATE REPAIR. (ADDITIONAL)		300.00	100.00
	MOUNT VEHICLE ON CHASSIS JIG AND REALIGN CHASSIS TO SPEC. (ADDITIONAL)		300.00	200.00
	REMOVE & REFIT CONDENSER, RADIATOR, VACUUM & REFILL GAS.		100.00	100.00
	CUT, WELD, RE-ALIGN REAR FENDER RH. (ADDITIONAL)		600.00	300.00
	CUT, WELD, RE-ALIGN REAR FENDER LH. (ADDITIONAL)		600.00	300.00
	CUT, WELD, RE-ALIGN END PANEL AND SPARE TYRE SINK. (ADDITIONAL)	NOT NECESSARY	1,000.00	-
	REPAIR REAR WHEELHOUSE LH. (ADDITIONAL)	NOT NECESSARY	300.00	-
	REPAIR REAR FENDER INNER PANEL LH (ADDITIONAL)	NOT NECESSARY	100.00	-
			9,215.00	6,165.00
GRAND TOTAL			104,884.00	57,212.72
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				45,750.00

Report Ref No. CC6/CTI22001591/Eya3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 8928T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

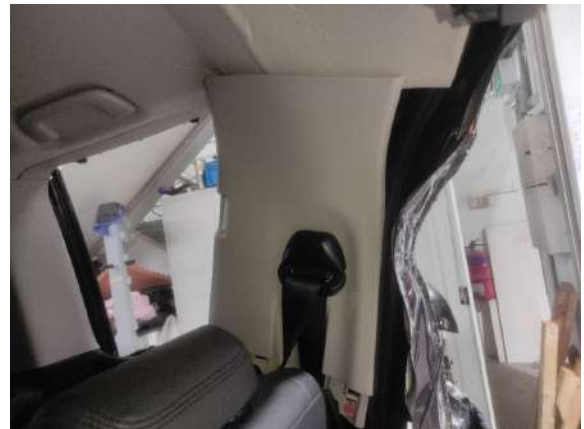



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

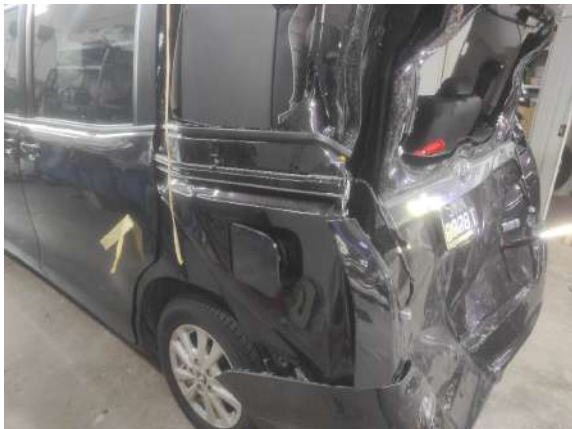



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

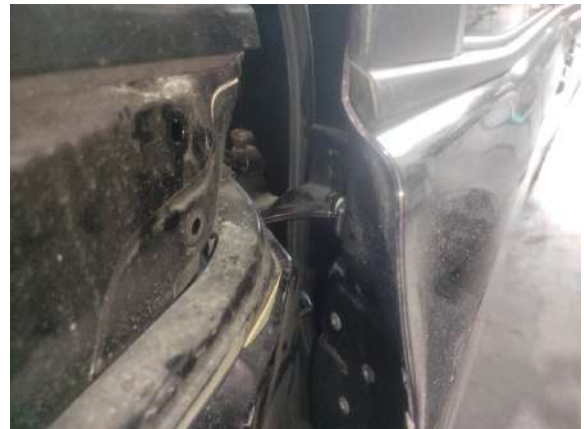



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

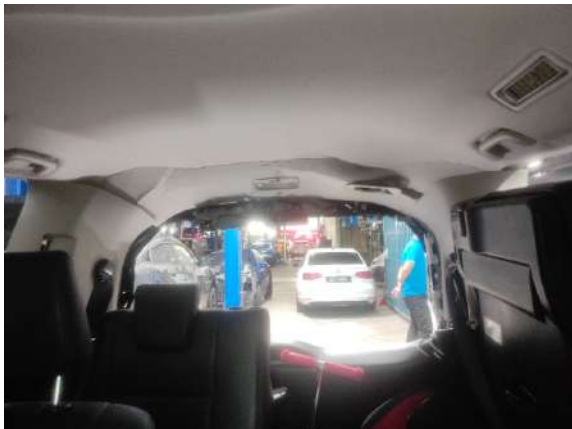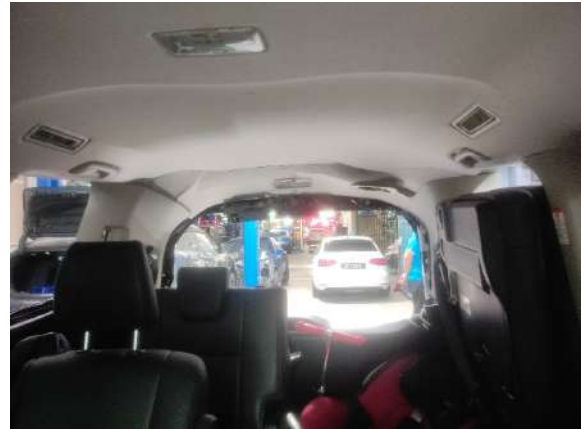



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 8928T

RE-INSPECTION

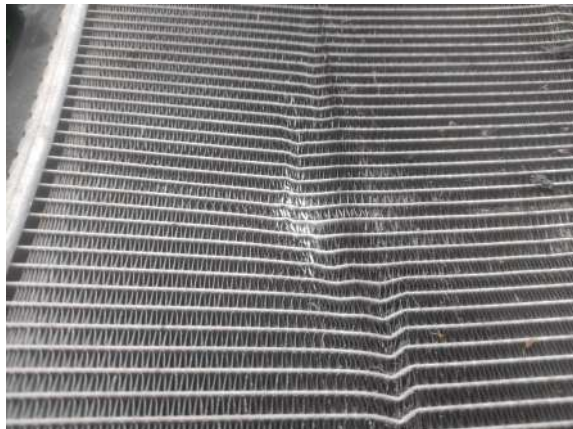



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

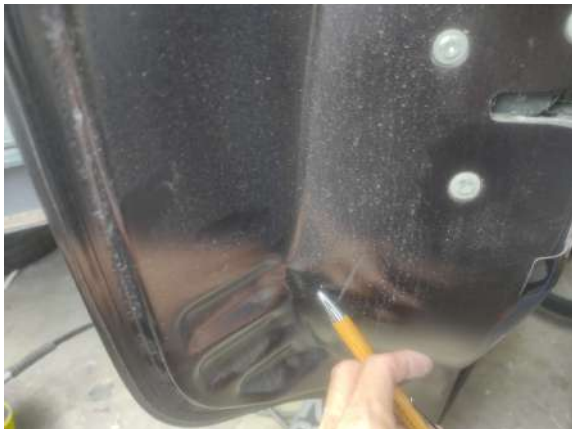



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

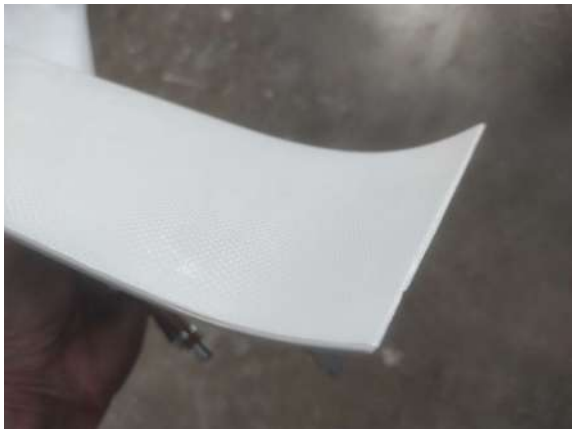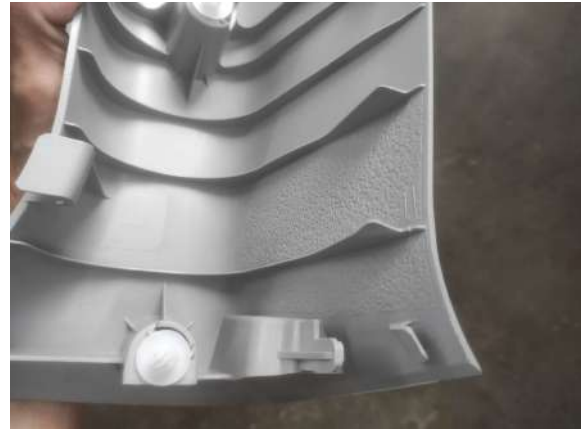



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

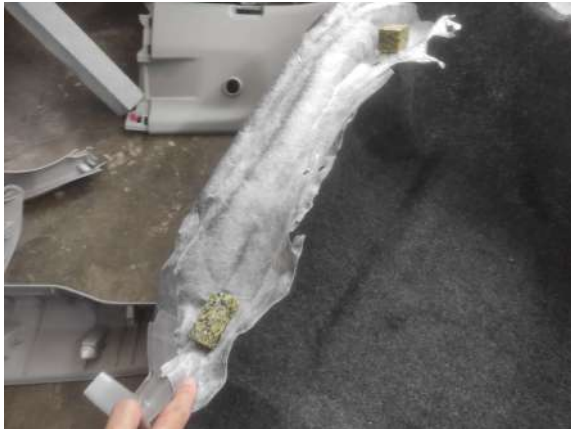



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

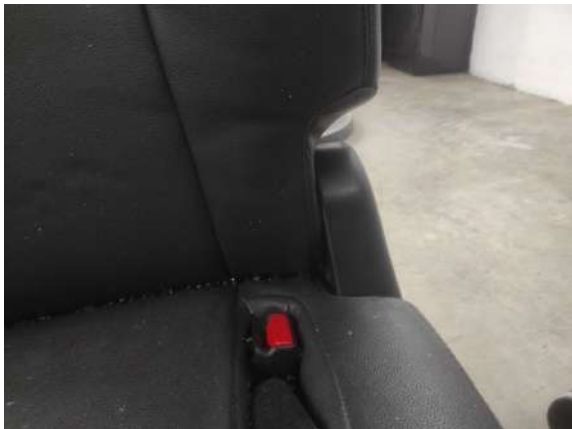




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

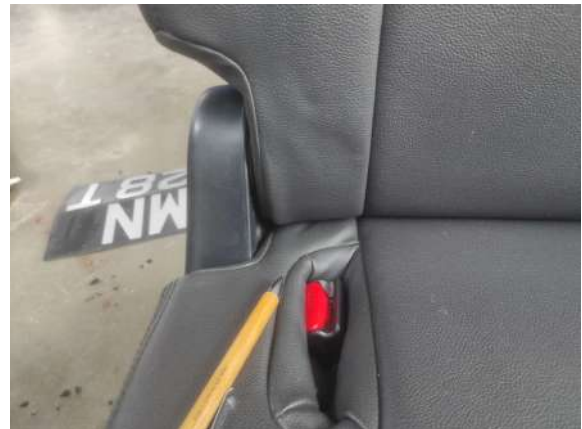



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

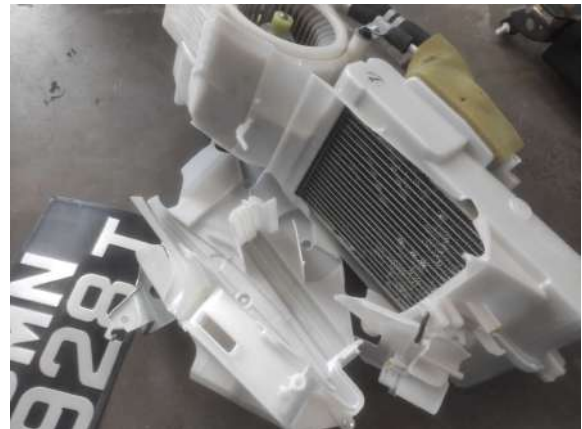



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMN 8928T

RE-INSPECTION

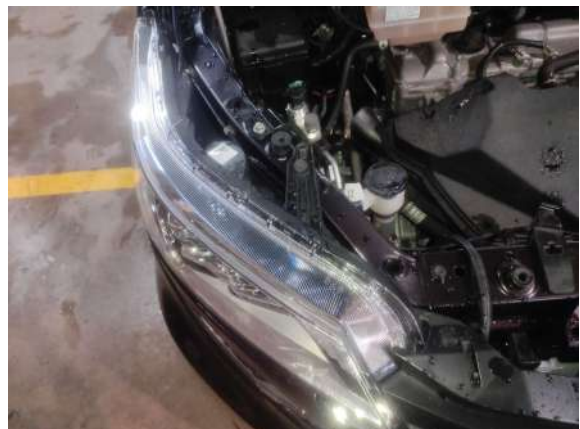





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

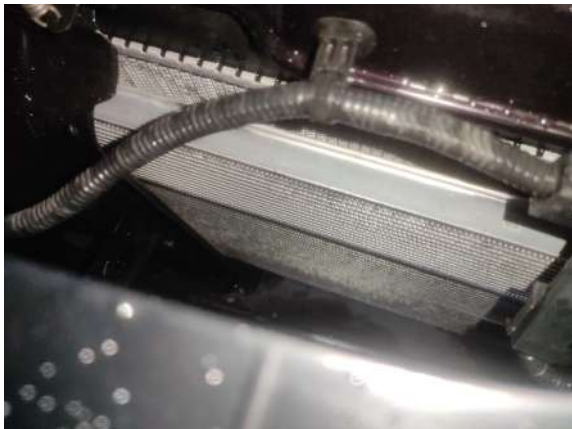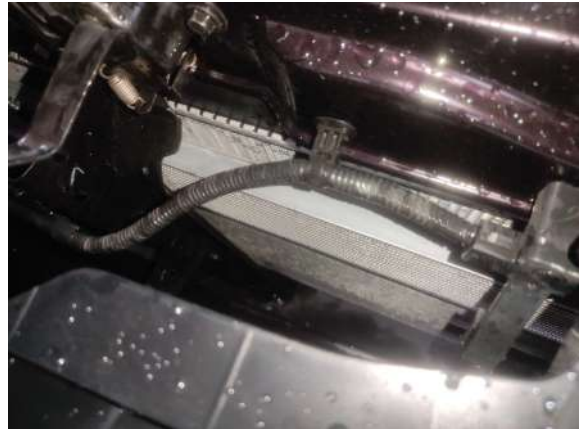






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

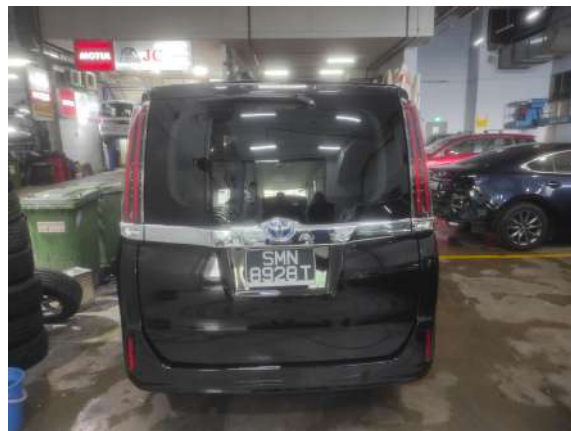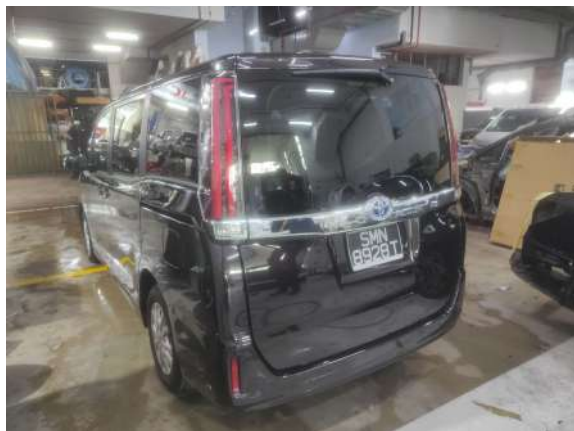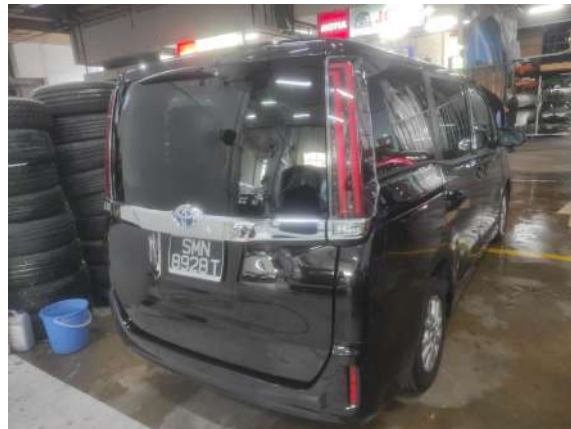



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

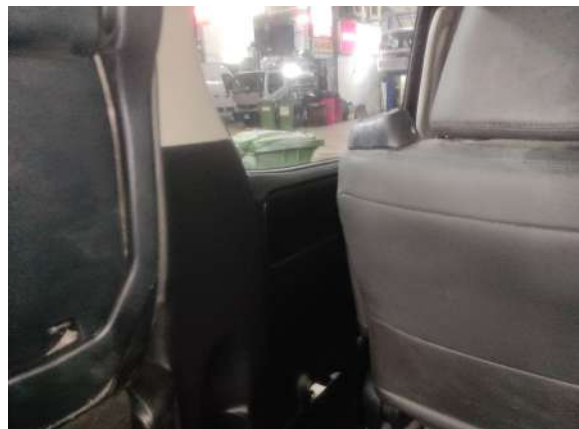




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

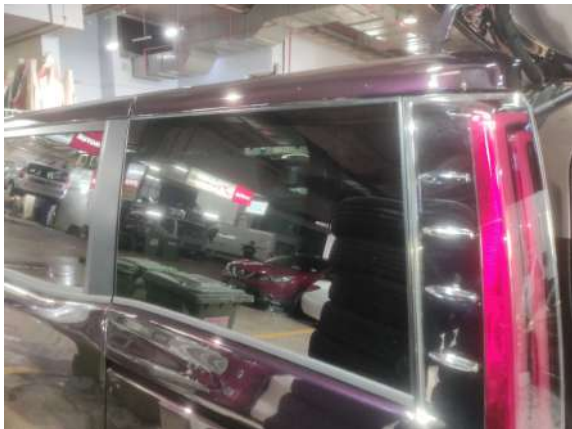



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

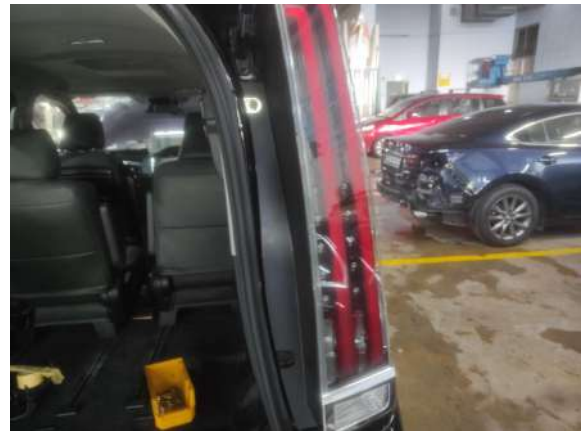





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

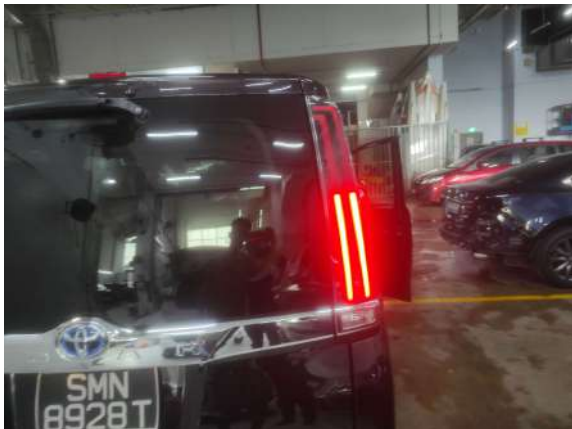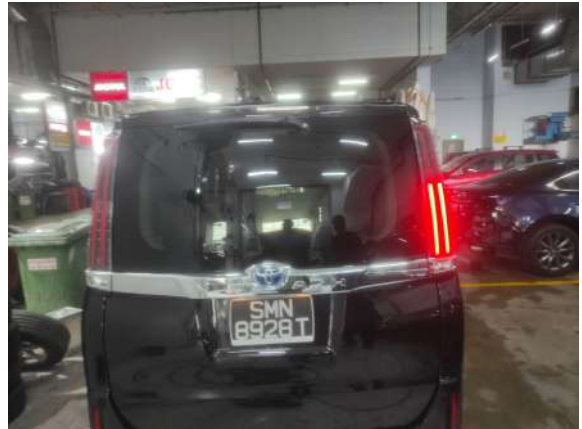




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

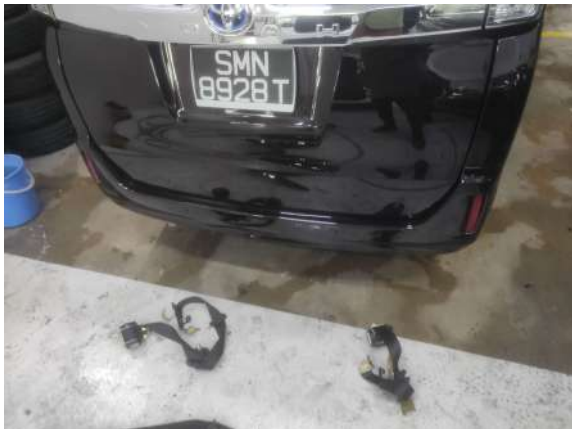



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

