



**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
Mobile: 9688-0413 Fax: 6266-7396  
Email: absolute.app.svcs@gmail.com

---

### Vehicle Inspection Report

To: Pro-Tac Armada Pte Ltd  
C/o: 160 Sin Ming Drive #05-20  
Sin Ming AutoCity (S) 575722

Date of report: 03.01.2022  
Date of request: 08.12.2021  
Date of inspection: 08.12.2021  
Date of accident: 30.11.2021  
Claim type: Third Party Claim

Report No: AAS/2021/292

### Particulars of affected vehicle:

Registration no:	SNA6523Y	Odometer:	9586 km
Make/Model:	Toyota Alphard (A)	Engine Capacity:	2493 cc
Year of registration:	2021	Engine no:	2AR2601527
Colour:	Pearl White	Chassis no:	AGH300363050

### Condition of tires:

Front Left:	7mm	Front Right:	7mm
Make:	Toyo	Make:	Toyo
Rear Left:	7mm	Rear Right:	7mm
Make:	Toyo	Make:	Toyo

Type of road wheel: Alloy (The above represent the remaining life of the tire thread)

### Pre-accident condition (Static tests only)

General Bodywork	: Good
Paintwork	: Good
Handbrake	: In order
Footbrake	: In order
Steering	: In order
Apparent engine modification	: Nil

### The Assignment

The inspection was conducted at M/s. Lim Motor Pte Ltd  
160 Sin Ming Drive #05-20  
Sin Ming AutoCity (S) 575722

(Subsequent inspection was conducted)

### Assessment

Repairer's estimate:	\$ 6,489.23
Revised estimate:	\$ 5,801.50
Recommended reserve:	\$ 4,650.00 (Lump sum)

Estimated normal duration of repairs : 4 Working days



**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396

Email: absolute.app.svcs@gmail.com

Vehicle No: SNA6523Y

Report No: AAS/2021/292

W/O PREJUDICE

Point of impact

At the RHF portion.

General description of damages

The front bumper, front grille, RH headlamp, RHF fender, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Lim Motor Pte Ltd as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$5,801.50

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$4,650.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 4 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a '**Without Prejudice**' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes 50 photographs.

Your Faithfully  
Absolute Appraisal Services Pte Ltd



Nicky Sean  
Automobile Appraiser  
MSAAA / MSMCTA



**ABSOLUTE APPRAISAL SERVICES PTE LTD**  
**LOSS ADJUSTERS & MOTOR APPRAISERS**  
 160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722  
 Mobile: 9688-0413 Fax: 6266-7396  
 Email: absolute.app.svcs@gmail.com

Vehicle No: SNA6523Y

Report No: AAS/2021/292

**Appraisal Schedule**

S/N	Parts Description	Qty	Condition		Repairer's Est	Revised Est
1	Front bumper	1	Dented/Cut		\$ 1,833.40	\$ 1,833.40
2	Front bumper chrome LH/RH	2	Broken/Necessary	\$ 220.60	\$ 441.20	\$ 441.20
3	Front bumper side grille RH	1	Loop Cracked		\$ 156.70	\$ 156.70
4	Front bumper fog lamp RH	1	Refit		\$ 340.00	-
5	Front bumper bracket RH	1	Cracked		\$ 115.00	\$ 115.00
6	Front bumper absorber	1	Refit		\$ 90.30	-
7	Radiator grille	1	Grazed/Cut		\$ 865.40	\$ 865.40
8	Radiator grille emblem	1	Necessary		\$ 105.90	\$ 105.90
9	Headlamp RH	1	Grazed/Cut		\$ 2,970.50	\$ 2,970.50
10	Headlamp chrome RH	1	Grazed		\$ 133.90	\$ 133.90
11	RHF fender		Distorted/Repair		-	-

Total: \$ 7,052.30 \$ 6,622.00

-25% \$ 1,763.08 \$ 1,655.50

List total: \$ 5,289.23 \$ 4,966.50

1 Front bumper clips 1set Necessary \$ 50.00 \$ 30.00

Special nett total: \$ 50.00 \$ 30.00

Parts Total: \$ 5,339.23 \$ 4,996.50

S/N	Labour Description	Repairer's Est	Revised Est
1	Check lightings & wirings.	\$ 50.00	\$ 30.00

2	Renew damaged parts. Panel beat, reform RHF fender. Re-align all affected area.	\$ 500.00	\$ 375.00
---	---	-----------	-----------

3	Spray painting on rear affected & replacement panels.	\$ 600.00	\$ 400.00
---	---	-----------	-----------

Labour Total: \$ 1,150.00 \$ 805.00


Grand Total: \$ 6,489.23 \$ 5,801.50

The final adjusted lump sum amount is \$4,650.00

Under normal circumstances, the repair should be completed within a reasonable period of 4 working days.

50 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.

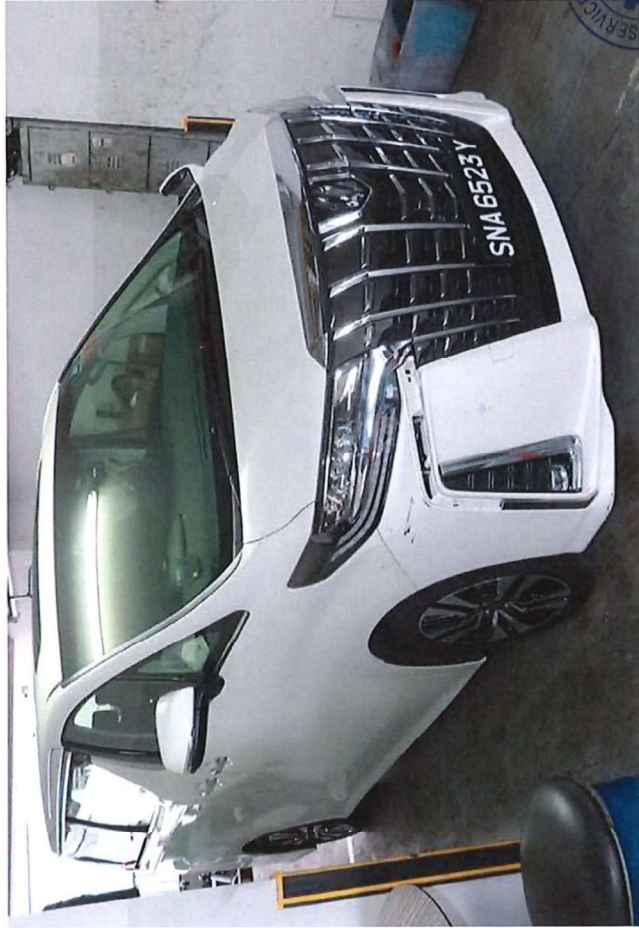

TOYOTA MOTOR CORPORATION JAPAN  
MODEL 3BA-AGH30W-PFXSK-C  
ENGINE 2AR-FE 2493 ml  
FRAME No. AGH30-0363050  
COLOR TRIM PLANT OPTION  
070 FC21 C31  
MILEAGE K115 416





