



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2203971

INV Date 27/06/2022

Reference CC4/LPC22001663/Uga3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMH 2264X
Insured Veh. SMJ 6957T
Claim No. 21/22/22/VP05/025484
Policy No. Z21VP05029182
Accident Date 19/02/2022
Inspection Date 22/02/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC22001663/Uga3q2 Date: 27/06/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMJ 6957T	Veh. Inspected	SMH 2264X	
Policy No.	Z21VP05029182	Coverage (\$)	0.00	
Claim No.	21/22/22/VP05/025484	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	21/02/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA C-HR HYBRID (A)	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	ZYX102142880	Colour	WHITE	
Odometer	244597 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R17	MICHELIN	6 mm	
L/H Front Tyre	215/60 R17	MICHELIN	6 mm	
R/H Rear Tyre	215/60 R17	MICHELIN	6 mm	
L/H Rear Tyre	215/60 R17	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	19/02/2022	Inspection Date	22/02/2022	
Survey held at	TAN LIM MOTOR PTE LTD NO.1 DEFU LANE 6 SINGAPORE 539365			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMH 2264X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	DISTORTED	597.60	597.60
8	FRONT BUMPER CLIPS @\$5.00	NECESSARY	40.00	40.00
1	FRONT BUMPER LOWER	DISTORTED	222.80	222.80
1	FRONT BUMPER CENTRE GRILLE	TWISTED	100.50	100.50
1	FRONT BUMPER SIDE RETAINER O/S	CRACKED	115.10	115.10
1	O/S HEADLAMP	CRACKED	4,396.80	3,847.10
1	O/S FRONT FENDER	BUCKLED	826.00	801.10
1	O/S FRONT FENDER INNER COWLING	TORN	236.70	236.70
8	O/S FRONT FENDER INNER COWLING CLIPS @\$5.00	NECESSARY	40.00	40.00
1	O/S FRONT FENDER OUTER GARNISH	TORN	143.60	143.60
1	FRONT BUMPER BEAM	BENT	276.80	276.80
1	FRONT BUMPER FOAM	TORN	70.30	70.30
1	WIPER TANK	DEFORMED	258.60	258.60
1	WIPER TANK MOTOR	NOT NECESSARY	339.70	-
2	FRONT BUMPER SENSOR @\$223.70	NOT NECESSARY	447.40	-
1	FRONT BUMPER UNDER COVER (ADDITIONAL)	TORN	130.00	130.00
1	FRONT BUMPER LOWER SPONGE (ADDITIONAL)	TORN	178.00	178.00
1	O/S FOG LAMP ASSEMBLY (ADDITIONAL)	CRACKED	410.00	350.00
	LESS 25% DISCOUNT		-2,207.48	-1,852.05
			6,622.42	5,556.15
<u>SPECIAL NETT ITEMS</u>				
1	FRONT LICENCE PLATE (SN)	SCRATCHED	50.00	20.00
			50.00	20.00
<u>LABOUR</u>				
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		60.00	20.00
	TO REINSTALL OF FRONT BUMPER PARKING SENSOR.		80.00	40.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		80.00	30.00
	PANEL BEATING, KNOCKING AND STRAIGHTEN THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME.		650.00	400.00

Report Ref No. CC4/LPC22001663/Uga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		750.00	600.00
			1,620.00	1,090.00
GRAND TOTAL			8,292.42	6,666.15
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,300.00

Report Ref No. CC4/LPC22001663/Uga3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMH 2264X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

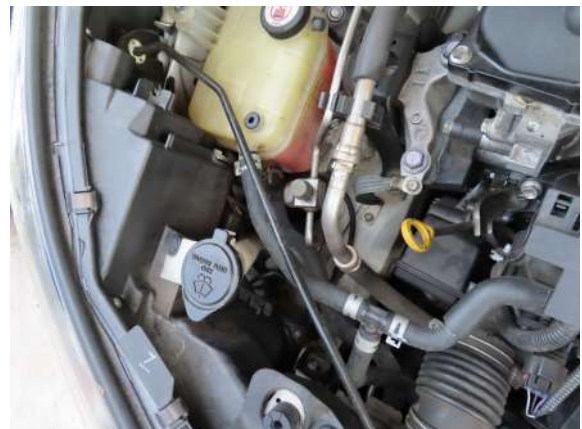



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

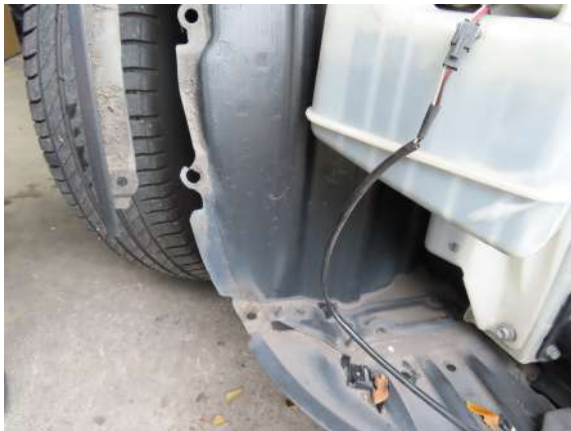



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMH 2264X

RE-INSPECTION

