



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2301638
3 ANSON ROAD #16-00	INV Date	17/03/2023
SPRINGLEAF TOWER	Reference	CC6/CTI22001940/Rya3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SMJ 1193M
Insured Veh.	GBL 1340A
Claim No.	SNM22D201429/C02
Policy No.	DMCVSNW00029132100
Accident Date	28/02/2022
Inspection Date	02/03/2022

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (8%)</b>	<b>32.00</b>
<b>Grand Total</b>	<b>432.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD  
3 ANSON ROAD #16-00  
SPRINGLEAF TOWERSINGAPORE 079909

Ref: CC6/CTI22001940/Rya3q2

Date: 17/03/2023

Code: CTI

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	GBL 1340A	<b>Veh. Inspected</b>	SMJ 1193M
<b>Policy No.</b>	DMCVSNW00029132100	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	SNM22D201429/C02	<b>Excess (\$)</b>	0.00
<b>Assign From</b>		<b>Assign Date</b>	02/03/2022

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	SUZUKI SWIFT SPORTS 1.4L M	<b>c.c</b>	1371
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2019
<b>Chassis No.</b>	ZC33S115802	<b>Colour</b>	YELLOW
<b>Odometer</b>	35892 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	FAIR		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	215/45 R17	GOODYEAR	6 mm
<b>L/H Front Tyre</b>	215/45 R17	GOODYEAR	6 mm
<b>R/H Rear Tyre</b>	215/45 R17	GOODYEAR	6 mm
<b>L/H Rear Tyre</b>	215/45 R17	GOODYEAR	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	28/02/2022	<b>Inspection Date</b>	02/03/2022
<b>Survey held at</b>	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

<b>ESTIMATED NORMAL PERIOD FOR REPAIR:</b>	<b>8 Working Days</b>
--	-----------------------



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMJ 1193M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	REAR BUMPER SPORT VERSION	DEFORMED	750.00	750.00
10	REAR BUMPER CLIPS @\$5.00	NECESSARY	50.00	50.00
1	REAR BUMPER RETAINER RH	NOT NECESSARY	30.00	-
1	REAR BUMPER RETAINER LH	CUT	30.00	30.00
1	REAR BUMPER EXTENSION LH (7)	DEFORMED	45.00	45.00
1	REAR BUMPER GARNISH LH (3)	NOT NECESSARY	45.00	-
1	REAR FOG LAMP	NOT NECESSARY	65.00	-
1	REAR LICENSE LAMP	NOT NECESSARY	45.00	-
1	REAR FENDER LH	BENT	550.00	550.00
1	REAR FENDER SHIELD LH	NOT NECESSARY	180.00	-
1	REAR FENDER RH	TO REPAIR SEE LABOUR	550.00	-
1	REAR FENDER SHIELD RH	NOT NECESSARY	180.00	-
10	REAR FENDER CLIPS @\$5.00	NECESSARY	50.00	50.00
1	REAR FENDER GUARD GARNISH RH	NOT NECESSARY	40.00	-
1	REAR FENDER GUARD GARNISH LH	NOT NECESSARY	40.00	-
1	REAR TAILGATE DOOR	BENT	880.00	880.00
1	REAR TAILGATE DOOR WEATHERSTRIP	NECESSARY	90.00	90.00
1	REAR TAILGATE DOOR INNER TRIM	NOT NECESSARY	220.00	-
1	REAR TAILGATE BALANCE RH	NOT NECESSARY	150.00	-
1	REAR TAILGATE BALANCE LH	NOT NECESSARY	150.00	-
1	REAR TAILGATE DOOR LOCK HANDLE (RED)	NOT NECESSARY	50.00	-
1	REAR TAILGATE DOOR LOCK	NOT NECESSARY	200.00	-
1	REAR TAILGATE DOOR LOCK LATCH	NOT NECESSARY	40.00	-
1	REAR TAILGATE SPOILER ASSY	NOT NECESSARY	600.00	-
1	REAR EMBLEM -S (CHROME)	NECESSARY	40.00	40.00
1	REAR EMBLEM -SWIFT (CHROME)	NECESSARY	45.00	45.00
1	REAR EMBLEM -SPORTS (CHROME RED)	NECESSARY	45.00	45.00
1	REAR /END PANEL GARNISH	NOT NECESSARY	80.00	-
1	END PANEL	BENT	350.00	350.00
1	SPARE TYRE BOARD COVER	NOT NECESSARY	120.00	-

Report Ref No. CC6/CTI22001940/Rya3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TOOLS SPONGE BOX /TRAY	NOT NECESSARY	90.00	-
1	REAR TAIL LAMP ASSY RH	CRACKED	720.00	720.00
1	REAR TAIL LAMP ASSY LH	NOT NECESSARY	720.00	-
1	REAR TAIL LAMP HIGH MOUNT STOP	NOT NECESSARY	140.00	-
1	REAR TAIL LAMP INNER HOUSING LH	BENT	90.00	90.00
1	REAR EXHAUST TAIL CHROME PIPE LH	BENT	200.00	200.00
2	REAR EXHAUST MUFFLER @\$720.00	NOT NECESSARY	1,440.00	-
2	REAR EXHAUST RUBBER MOUNT @\$30.00	NOT NECESSARY	60.00	-
1	FRONT AIR VENT LH (ADDITIONAL)	CRACKED	40.00	40.00
1	FRONT AIR VENT RH (ADDITIONAL)	CRACKED	40.00	40.00
1	FRONT FENDER INNER GARNISH LH (ADDITIONAL)	CRACKED	300.00	300.00
1	REAR TAILGATE RUBBER STOPPER (ADDITIONAL)	NECESSARY	10.00	10.00
1	REAR SPOILER SEAL (ADDITIONAL)	CUT	80.00	80.00
	LESS 15% DISCOUNT		-	-660.75
			9,640.00	3,744.25
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	40.00	40.00
1	REAR LICENCE PLATE (SN)	BENT	35.00	35.00
1	REVERSE SENSOR (SN)	NOT WORKING	200.00	200.00
			275.00	275.00
	<b><u>LABOUR</u></b>			
	SPRAY PAINTING REAR BUMPER ,TAILGATE ,ROTH REAR FENDER INCLUDING BLENDING .		1,000.00	1,000.00
	REMOVE ,REPLACE AND REPAIR ACCIDENT AFFECTED AREA.INCLUSIVE OF THE REPAIR OF REAR FENDER RH .		1,000.00	900.00
	APPLY RUST PROOFING ON REPLACED /REPAIRED PANEL.		100.00	60.00
	TRANSFER DOOR FITTING AND WINDOW /MECHANISM TO NEW DOOR .		100.00	60.00
	REMOVE AND REFIT REAR EXHAUST PIPE AND SILENCER ,RE-ALIGN.		100.00	60.00
	REMOVE AND REFIT REAR WINDSCREEN.		100.00	100.00
	REMOVE AND REFIT REAR REVERSE SENSOR .		100.00	60.00
	ANTI-RUST TUFF COAT.	NOT NECESSARY	40.00	-

Report Ref No. CC6/CTI22001940/Rya3q2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	CHECK AND RECTIFY ELECTRICAL WIRING.		30.00	30.00
			2,570.00	2,270.00
	<b>GRAND TOTAL</b>		<b>12,485.00</b>	<b>6,289.25</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>5,050.00</b>

Report Ref No. CC6/CTI22001940/Rya3q2

**MOHAMMED RASUL BIN MOHD YUNUS**

Automotive Assessor

**HO LEONG CHUAN**

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SMJ 1193M

## INSPECTION

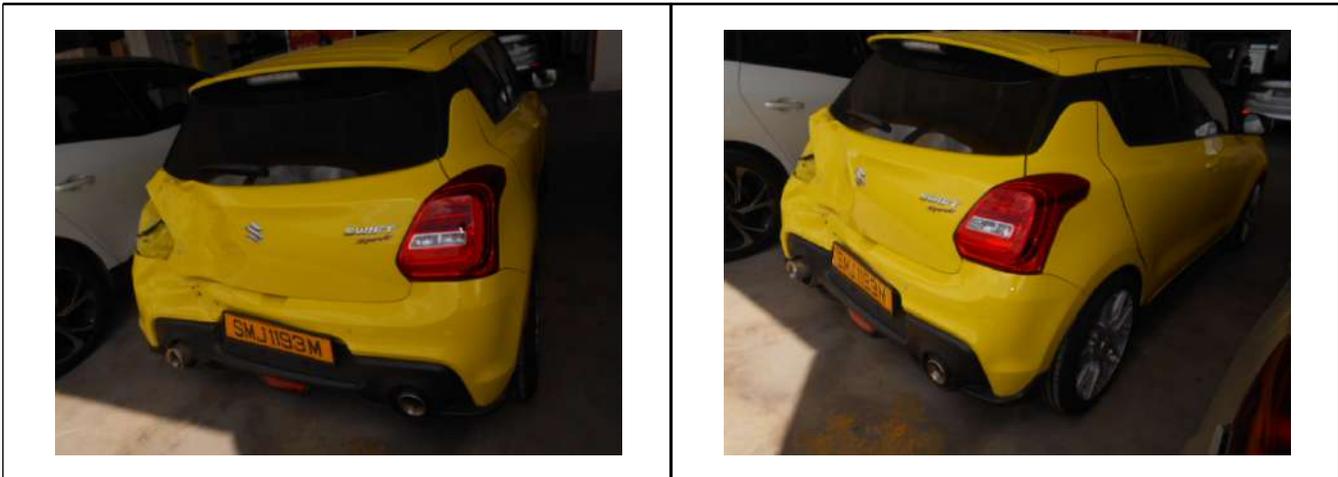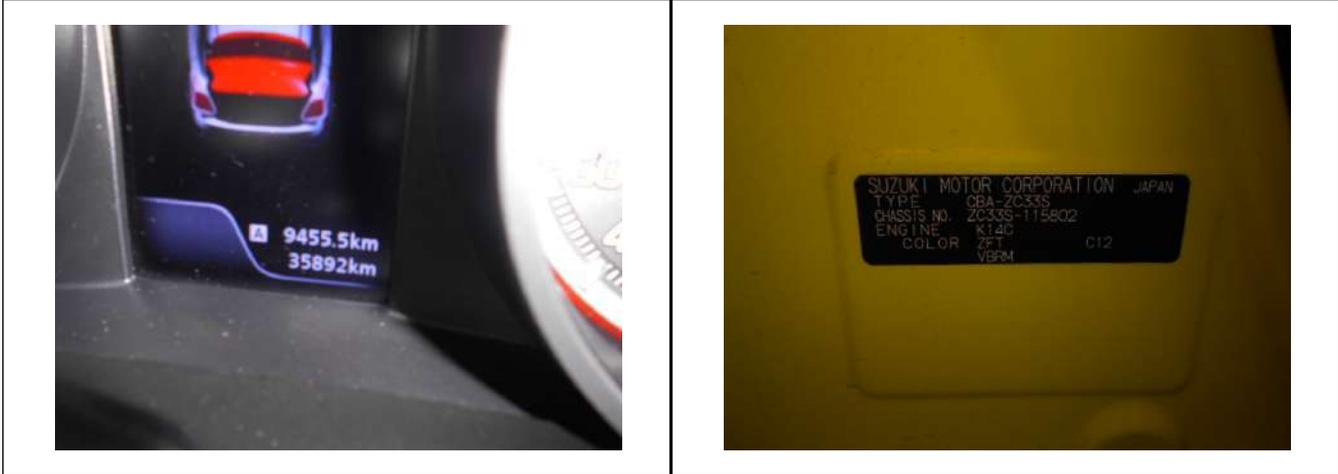




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

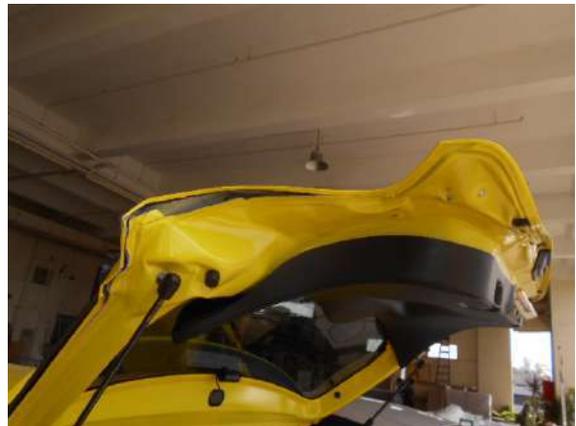



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

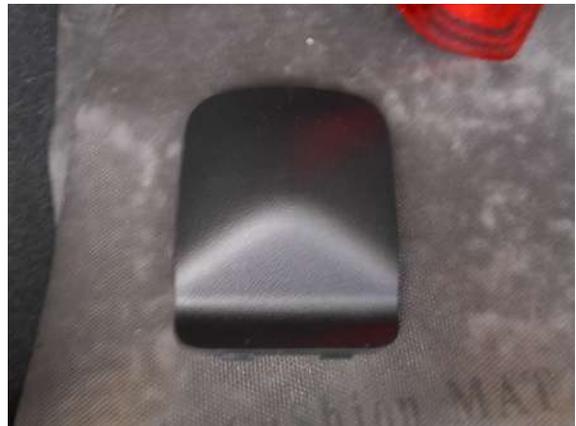







# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

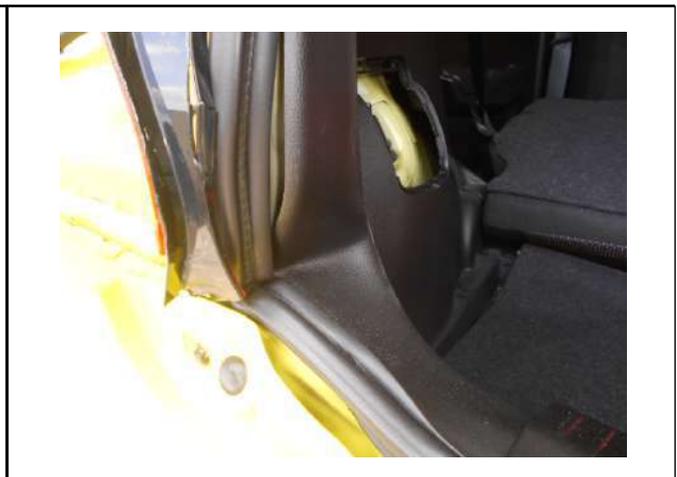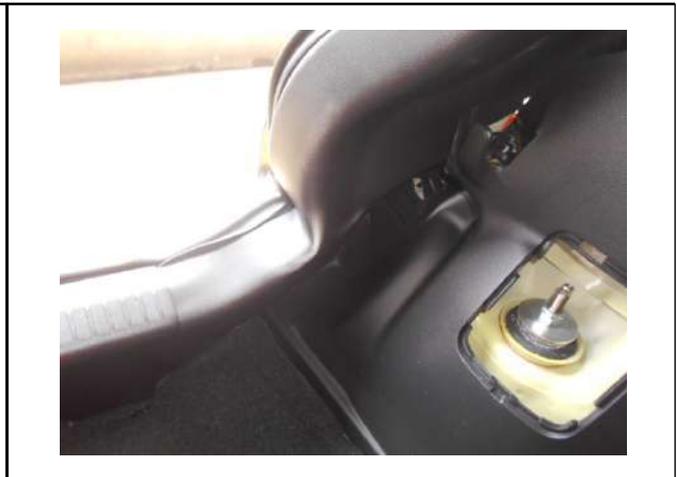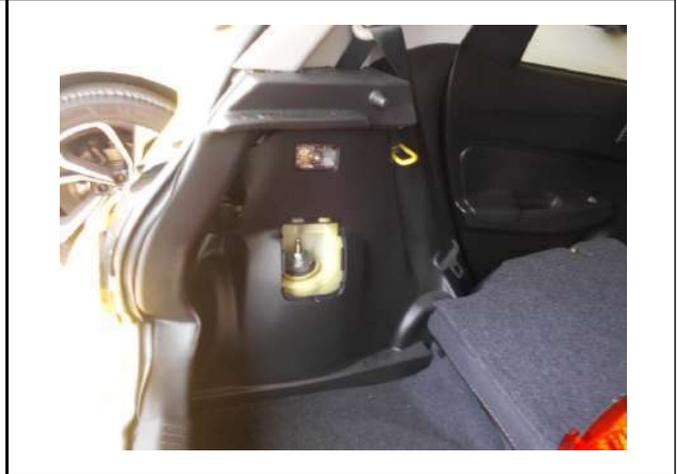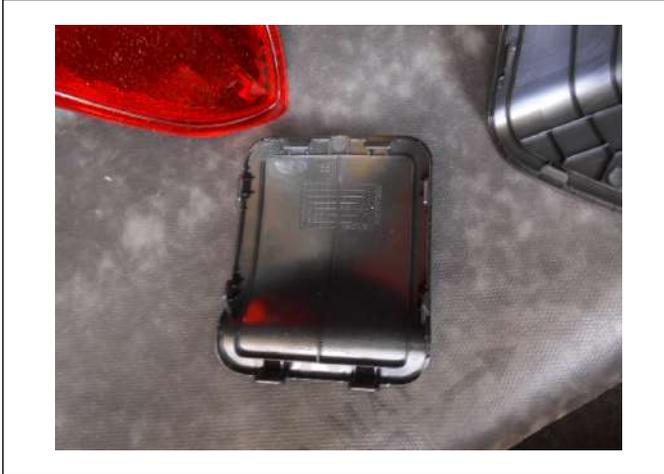




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

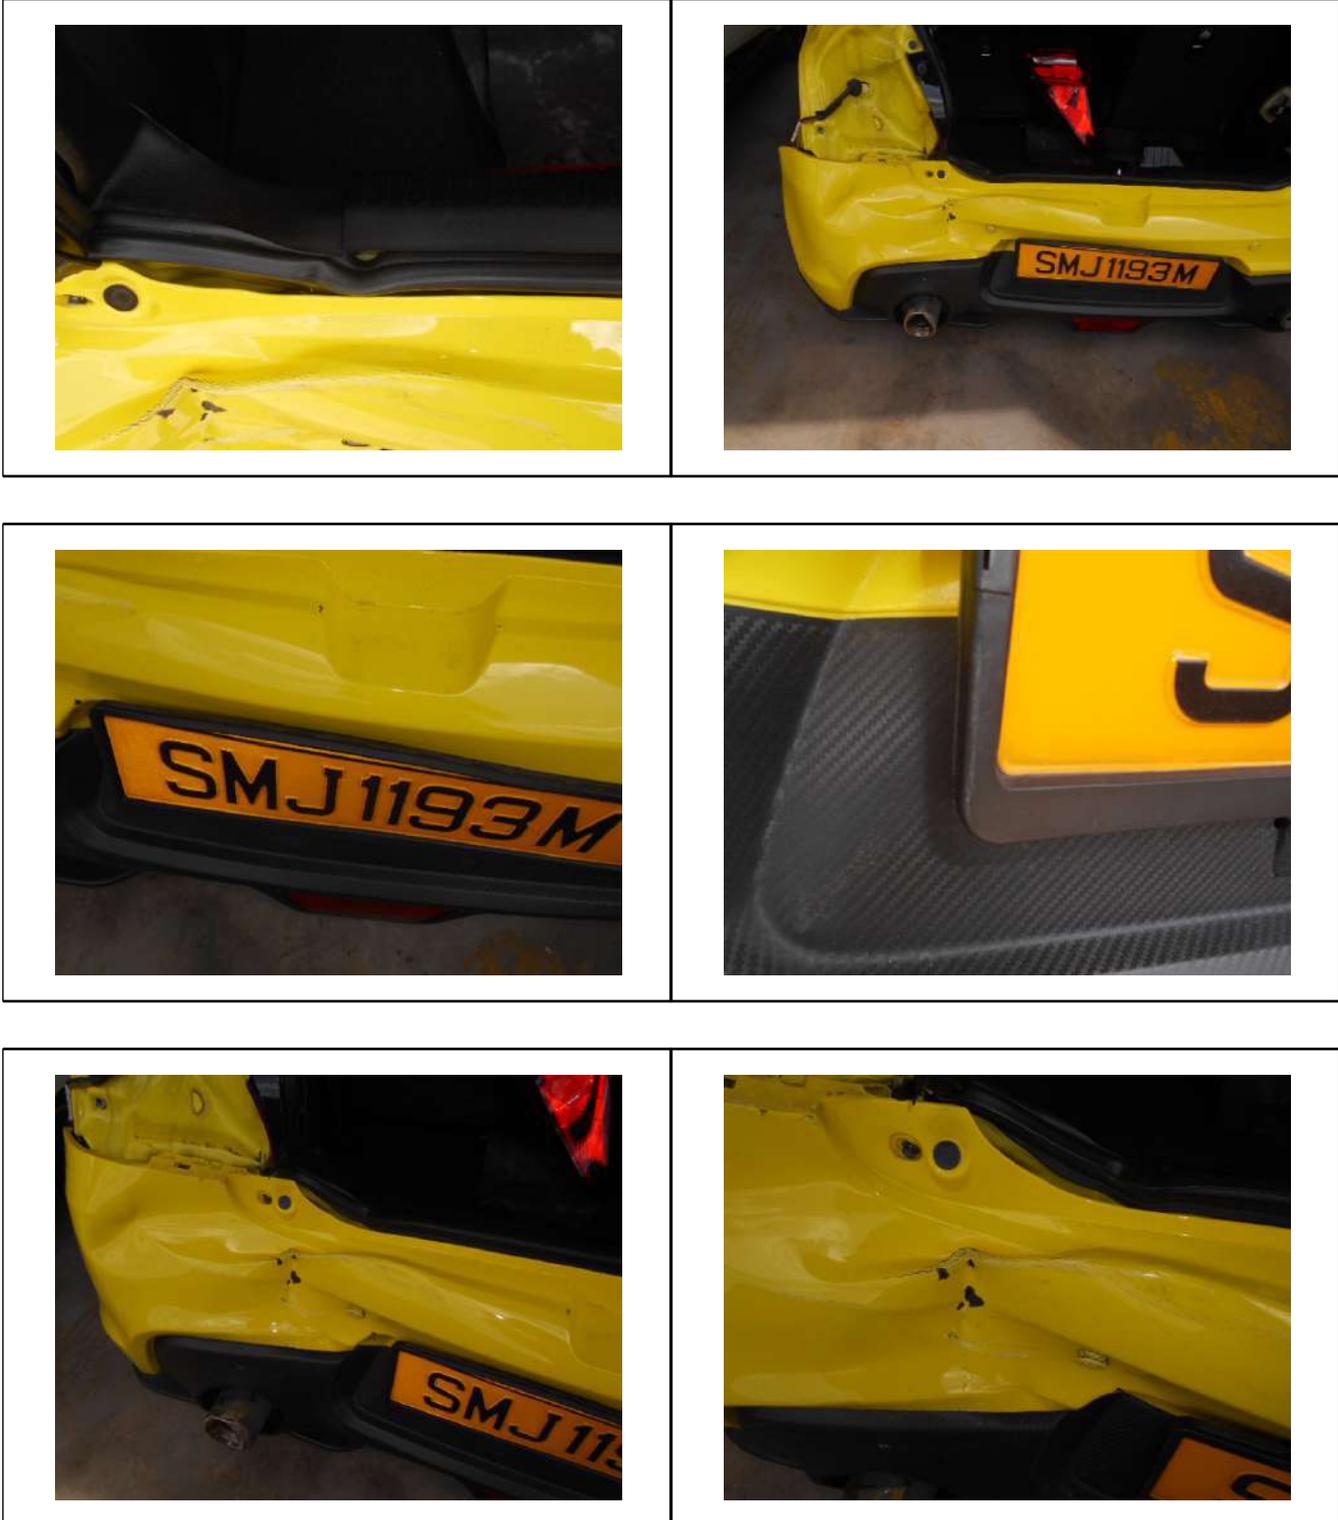




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

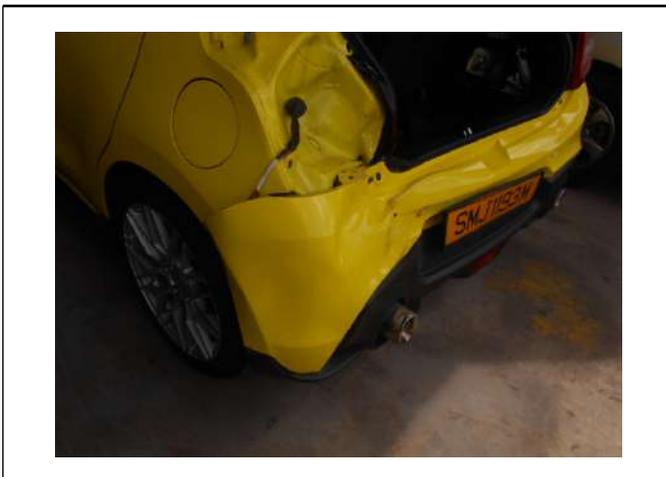




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

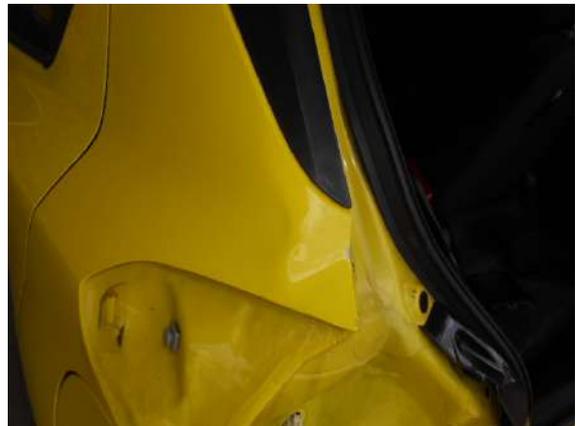




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

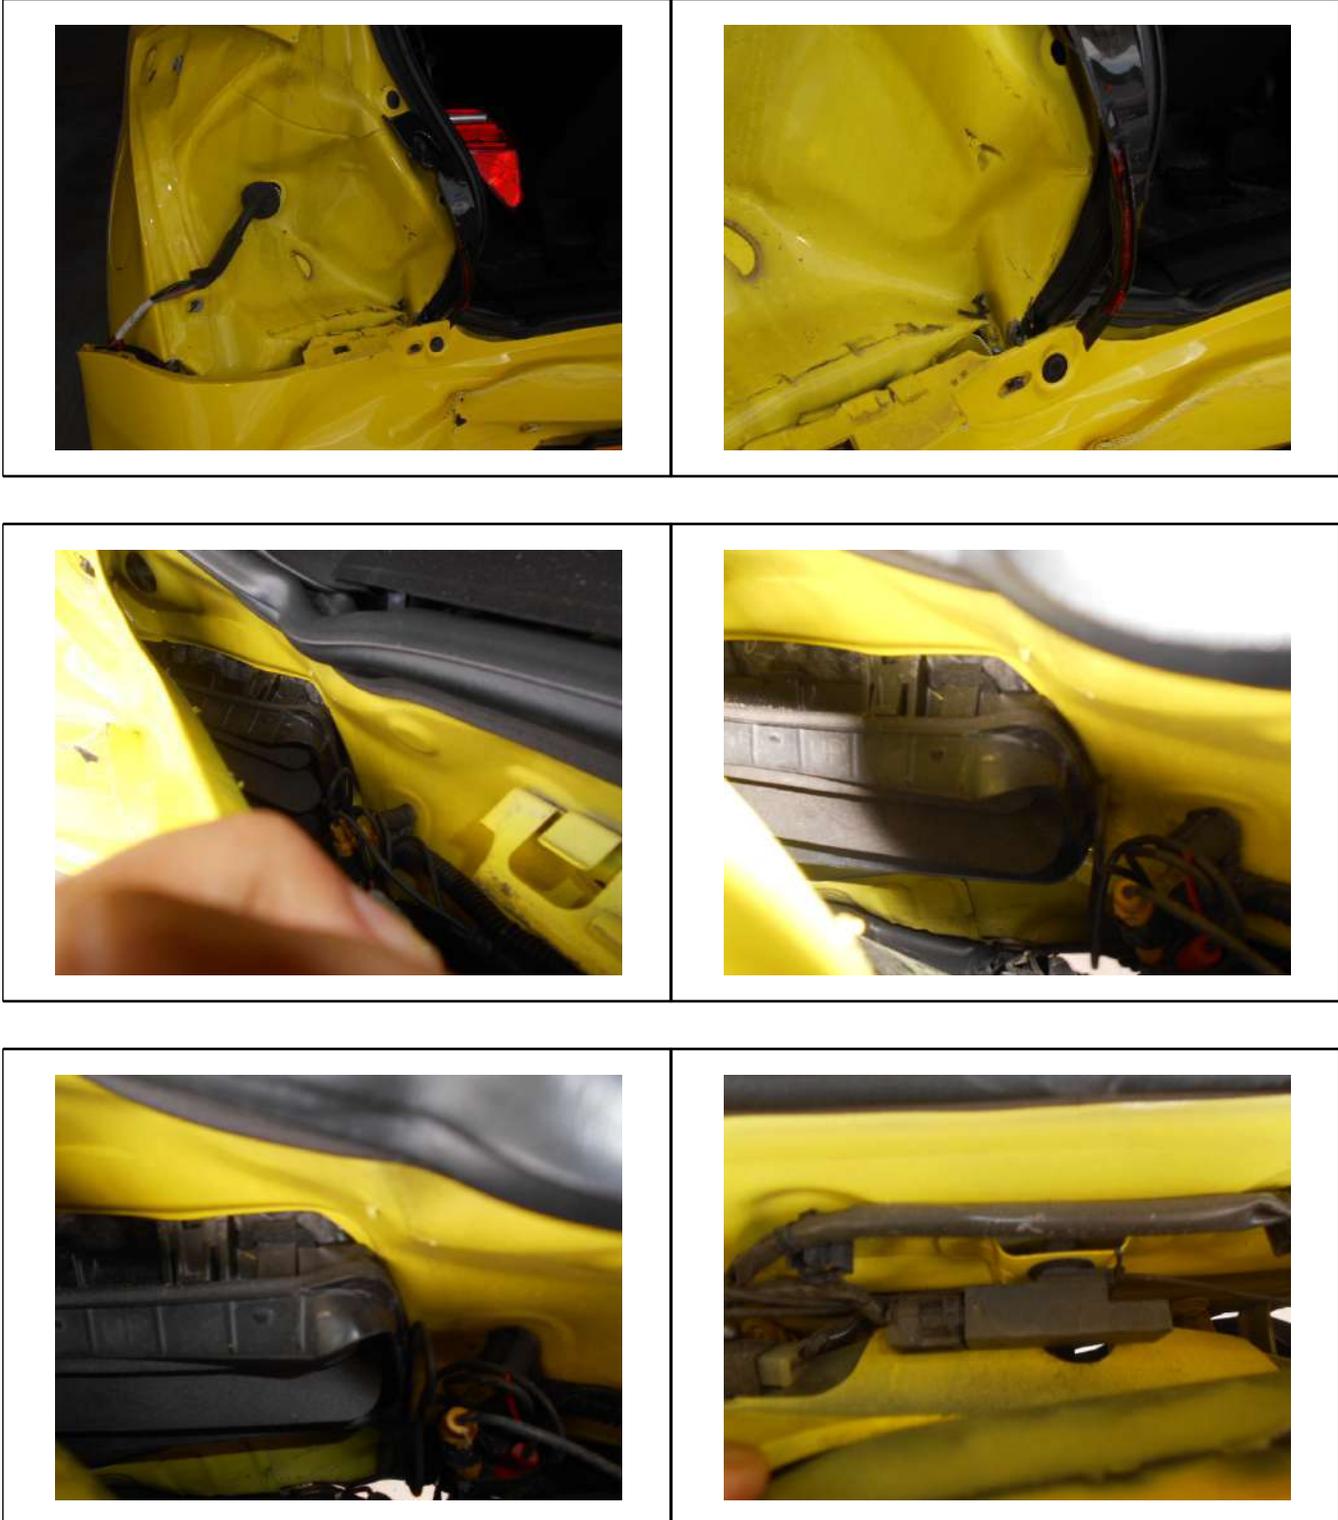




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

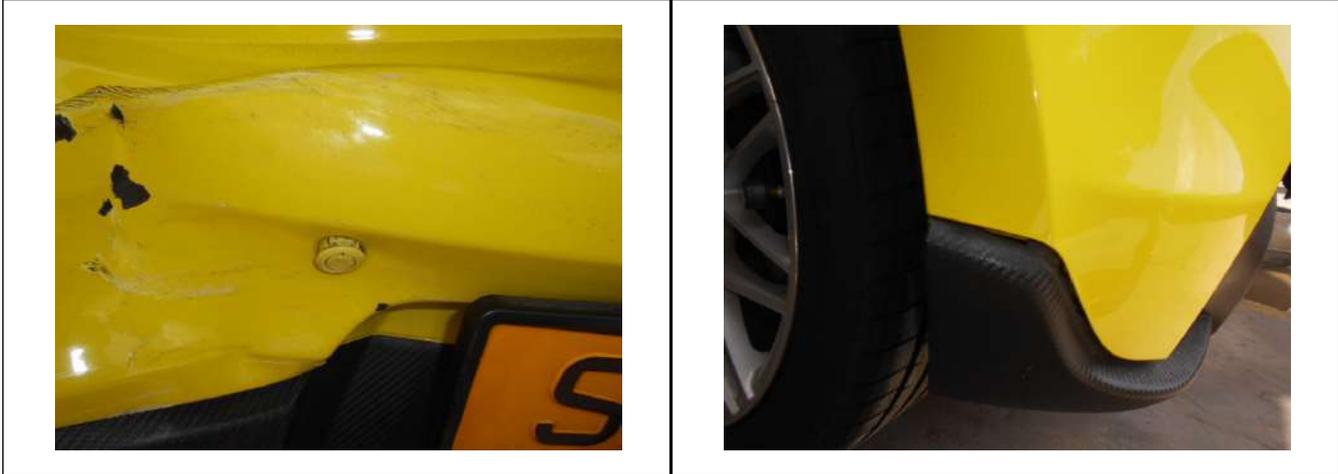








# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

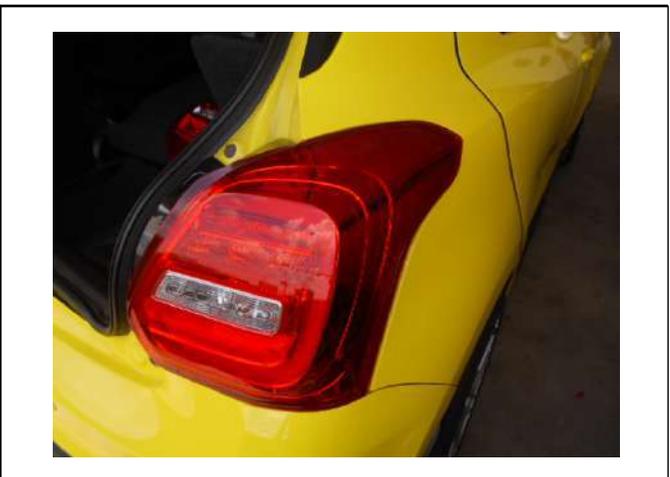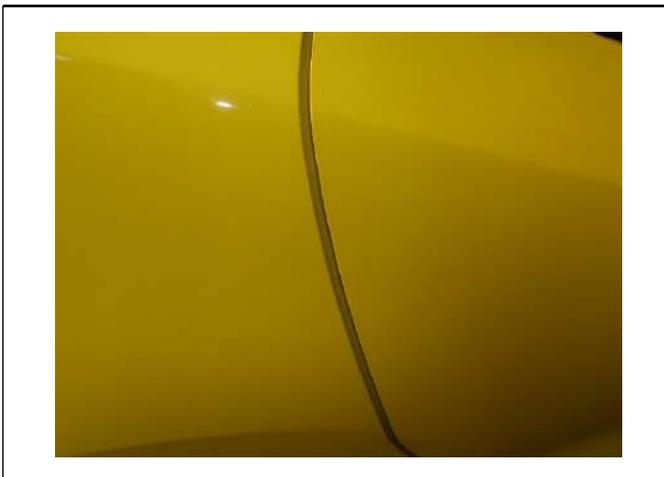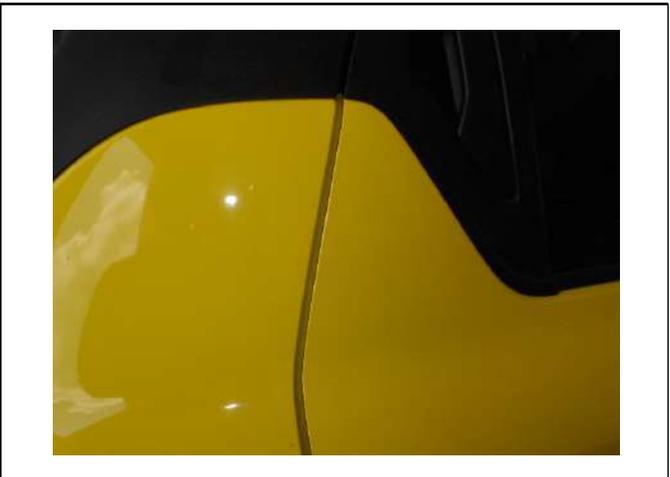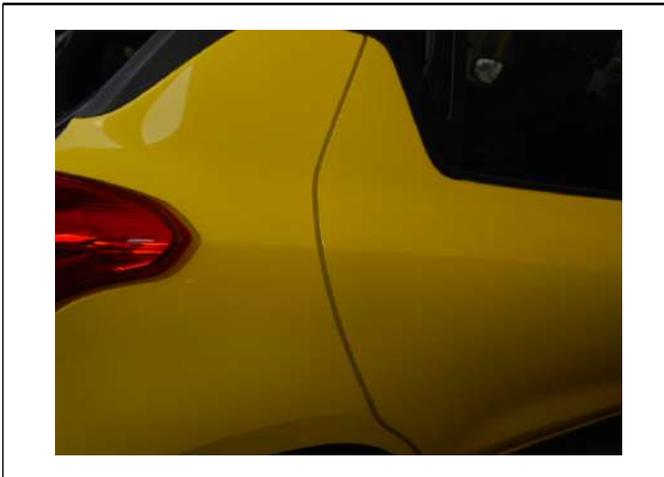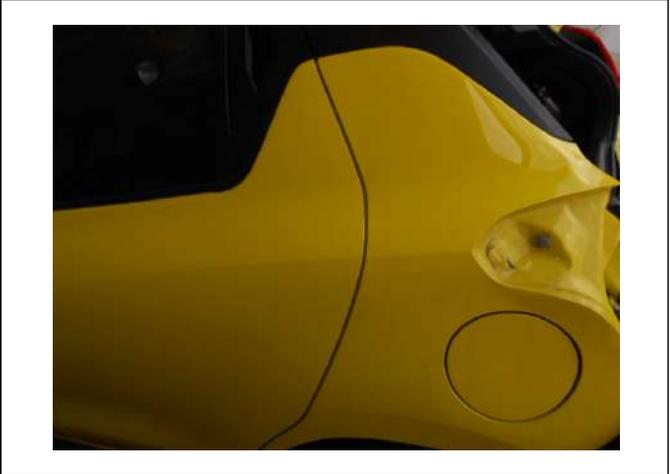




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

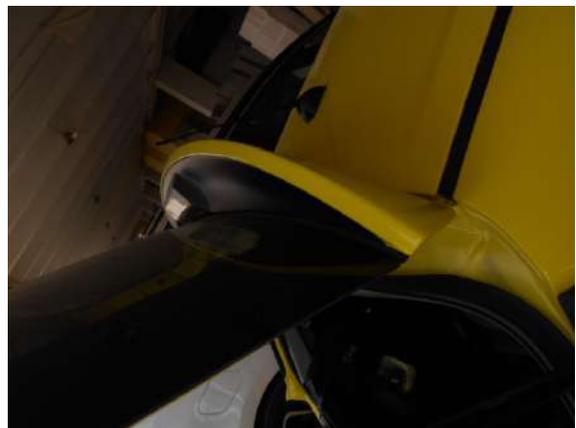




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

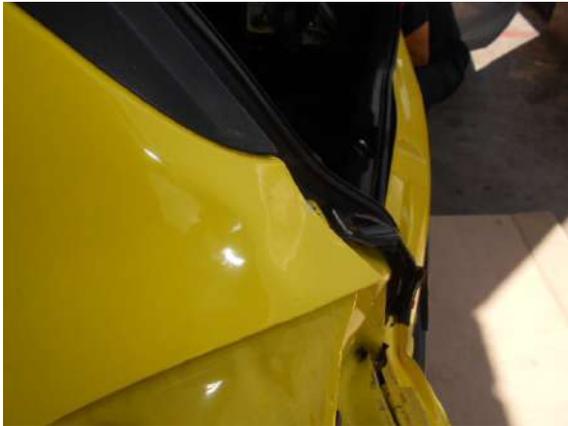



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R










# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

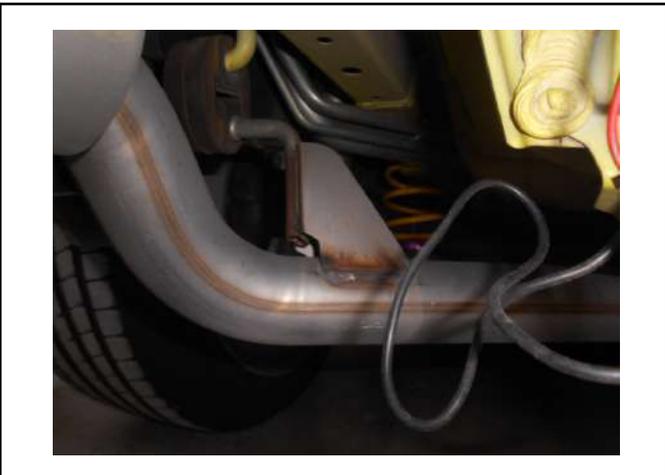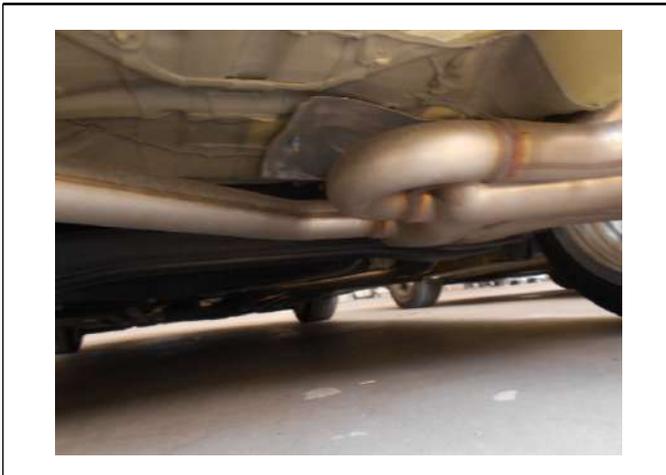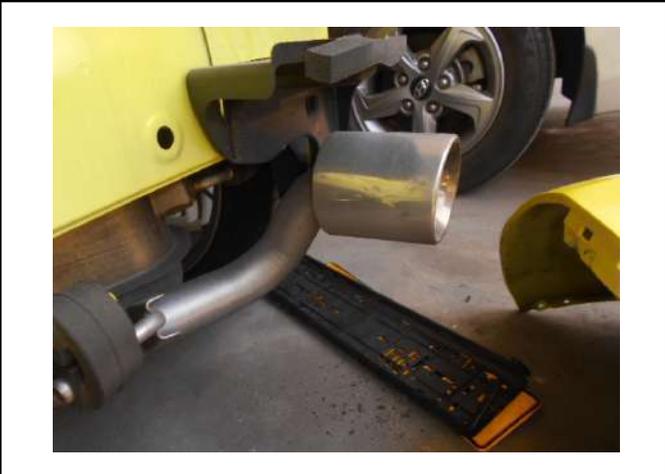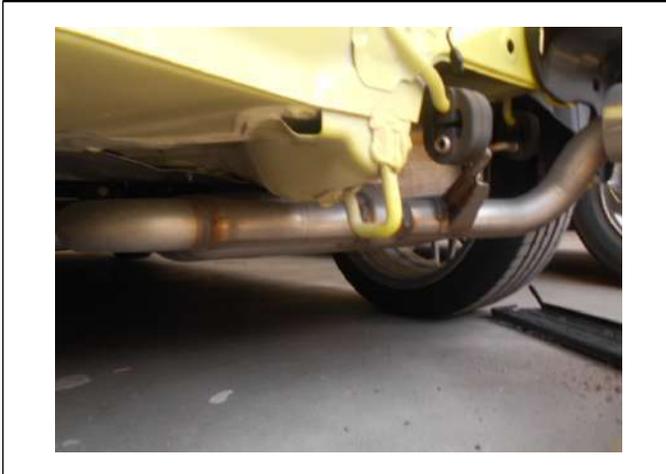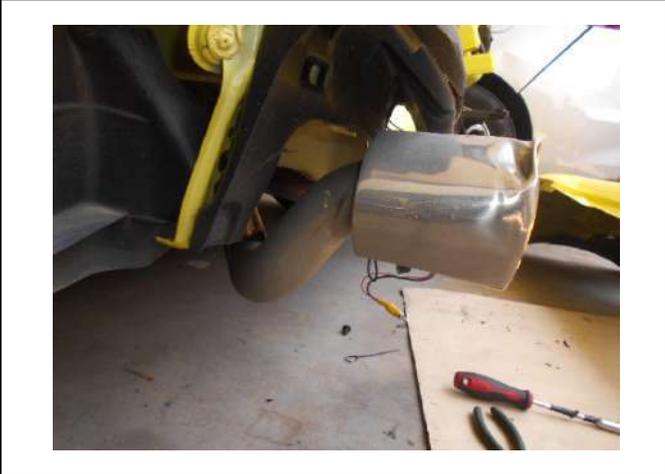




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

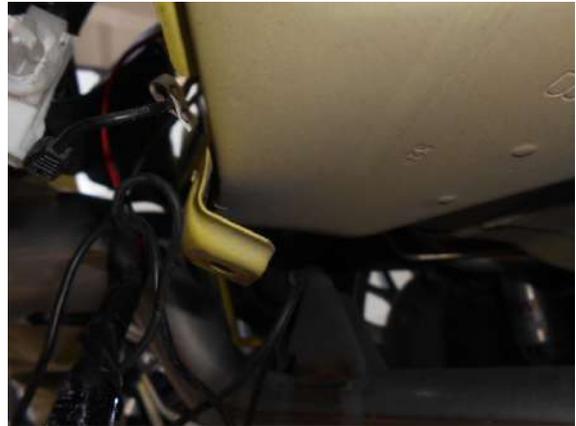




## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

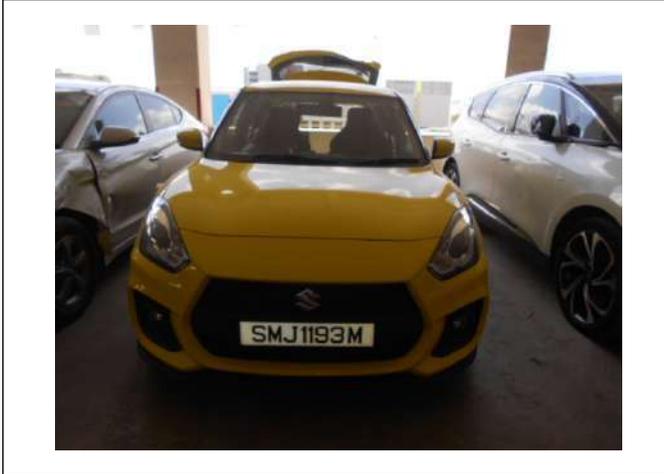



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 1193M

RE-INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMJ 1193M

RE-INSPECTION

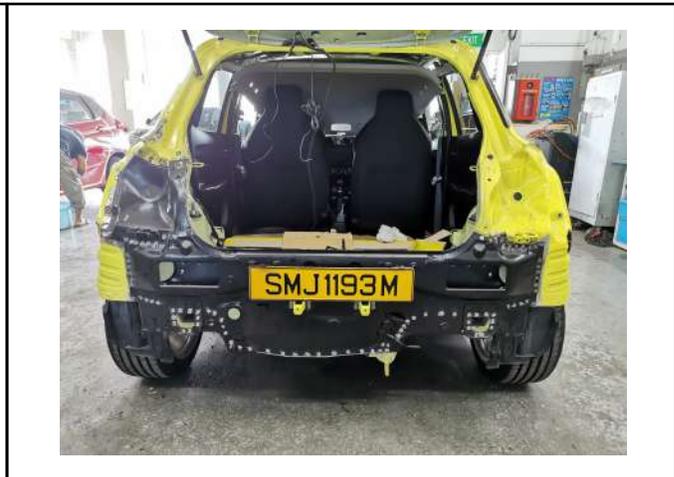



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

