



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302157

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 09/04/2023
Reference CC6/CTI22002029/Eya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLE 110Y
Insured Veh. XD 9829L
Claim No. SNM22D201507/C02
Policy No. DMCVSNW00138142102
Accident Date 02/03/2022
Inspection Date 04/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22002029/Eya3q2 Date: 09/04/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 9829L	Veh. Inspected	SLE 110Y	
Policy No.	DMCVSNW00138142102	Coverage (\$)	0.00	
Claim No.	SNM22D201507/C02	Excess (\$)	0.00	
Assign From		Assign Date	04/03/2022	
2. Vehicle Particulars & Condition				
Make & Model	KIA STONIC	c.c	998	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KNAD6811VK6297475	Colour	RED	
Odometer	27870 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/65 R15	DUNLOP	5 mm	
L/H Front Tyre	185/65 R15	DUNLOP	5 mm	
R/H Rear Tyre	185/65 R15	DUNLOP	5 mm	
L/H Rear Tyre	185/65 R15	DUNLOP	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION AND O/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	02/03/2022	Inspection Date	04/03/2022	
Survey held at	AUTOMOTIVE REPAIR CENTRE PTE LTD 38 WOODLANDS INDUSTRIAL PARK E1 # 05-18 SINGAPORE 757700			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		15 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLE 110Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	BROKEN	550.00	493.00
10	FRONT BUMPER CLIPS @\$5.00	NECESSARY	50.00	30.00
1	FRONT BUMPER RETAINER RH	NOT NECESSARY	25.00	-
1	FRONT BUMPER RETAINER LH	NOT NECESSARY	25.00	-
1	FRONT LOWER BUMPER	CUT	450.00	367.00
10	FRONT LOWER BUMPER CLIPS @\$5.00	NECESSARY	50.00	20.00
1	FRONT BUMPER LOWER SKID PLATE	CUT	80.00	55.00
1	FRONT BUMPER UPPER RUBBER STRIP	NOT NECESSARY	35.00	-
1	FRONT REINFORCEMENT	NOT NECESSARY	590.00	-
1	FRONT REINFORCEMENT STIFFENER	NOT NECESSARY	135.00	-
1	FRONT SPONGE	NOT NECESSARY	98.00	-
1	FRONT TOW EYE COVER	NOT NECESSARY	18.00	-
1	FRONT GRILLE ASSY	CUT	395.00	324.00
1	FRONT LOWER GRILLE ASSY	BROKEN	136.00	136.00
10	FRONT GRILLE CLIPS @\$5.00	NECESSARY	50.00	10.00
1	FRONT BUMPER AIR INTAKE MOULDING	NOT NECESSARY	95.00	-
1	HEAD LAMP RH	NOT NECESSARY	2,000.00	-
1	HEAD LAMP LH	BROKEN	2,000.00	1,845.00
1	FOG LAMP LH	NOT NECESSARY	215.00	-
1	FOG LAMP COVER LH	NOT NECESSARY	78.00	-
1	RADIATOR TOP GARNISH	NOT NECESSARY	50.00	-
1	FRONT FENDER RH	DENTED	380.00	380.00
1	FRONT FENDER ENCLOSURE RH	NOT NECESSARY	50.00	-
1	FRONT FENDER SHIELD RH	CRUSHED	75.00	75.00
1	FRONT FENDER ARC GARNISH RH	CUT	60.00	60.00
1	FRONT FENDER ARC GARNISH LH	NOT NECESSARY	60.00	-
10	FRONT FENDER SHIELD CLIPS @\$5.00	NECESSARY	50.00	15.00
1	REAR FENDER ARC GARNISH RH	CUT	60.00	60.00
1	REAR FENDER SHIELD RH	CRUSHED	75.00	75.00
10	REAR FENDER SHIELD CLIPS @\$5.00	NECESSARY	50.00	15.00
1	SIDE SILL RH	CUT	390.00	390.00

Report Ref No. CC6/CTI22002029/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
5	SIDE SILL SPECIAL CIPS @\$6.00	NECESSARY	30.00	15.00
1	SIDE MIRROR MOTOR ASSY RH	NOT NECESSARY	628.00	-
1	A-PILLAR TRIANGLE GARNISH RH	NOT NECESSARY	30.00	-
1	FRONT DOOR RH	DENTED	959.00	858.00
1	FRONT DOOR UPPER HINGE RH	NOT NECESSARY	45.00	-
1	FRONT DOOR LOWER HINGE RH	NOT NECESSARY	45.00	-
1	FRONT DOOR CHECKER RH	NOT NECESSARY	40.00	-
1	FRONT DOOR STRIKER RH	NOT NECESSARY	32.00	-
1	FRONT DOOR HANDLE ASSY RH	NOT NECESSARY	150.00	-
1	FRONT DOOR HANDLE COVER RH	NOT NECESSARY	30.00	-
1	FRONT DOOR HANDLE BASE RH	NOT NECESSARY	40.00	-
1	FRONT DOOR LOCK ASSY RH	NOT NECESSARY	180.00	-
1	FRONT DOOR WINDOW REGULATOR RH	NOT NECESSARY	200.00	-
1	FRONT DOOR SPEAKER RH	NOT NECESSARY	350.00	-
1	FRONT DOOR TRIM RH	NOT NECESSARY	600.00	-
1	FRONT DOOR OUTSIDE WEATHERSTRIP RH	NOT NECESSARY	40.00	-
1	FRONT DOOR UPPER BLACK TAPE RH	NECESSARY	22.00	22.00
1	FRONT DOOR SIDE BLACK TAPE RH	NECESSARY	22.00	22.00
1	FRONT DOOR SIDE RUBBER WEATHERSTRIP	TORN	90.00	90.00
1	FRONT DOOR BODY SIDE RUBBER WEATHERSTRIP RH	NOT NECESSARY	90.00	-
1	FRONT DOOR WINDOW RUN CHANNEL RUBBER SEAL RH	NOT NECESSARY	95.00	-
1	FRONT DOOR LOWER GARNISH RH	CUT	130.00	130.00
1	FRONT DOOR ELECTRICAL WIRING HARNESS ASSY RH	NOT NECESSARY	700.00	-
1	REAR DOOR RH	DENTED	959.00	768.00
1	REAR DOOR UPPER HINGE RH	NOT NECESSARY	45.00	-
1	REAR DOOR LOWER HINGE RH	BENT	45.00	45.00
1	REAR DOOR CHECKER RH	NOT NECESSARY	40.00	-
1	REAR DOOR STRIKER RH	NOT NECESSARY	35.00	-
1	REAR DOOR HANDLE ASSY RH	BROKEN	150.00	150.00
1	REAR DOOR HANDLE COVER RH	BROKEN	45.00	45.00
1	REAR DOOR HANDLE BASE RH	NOT NECESSARY	40.00	-
1	REAR DOOR LOCK ASSY RH	BENT	180.00	180.00

Report Ref No. CC6/CTI22002029/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR WINDOW REGULATOR RH	NOT NECESSARY	200.00	-
1	REAR DOOR SPEAKER RH	NOT NECESSARY	350.00	-
1	REAR DOOR TRIM RH	NOT NECESSARY	600.00	-
1	REAR DOOR OUTSIDE WEATHERSTRIP RH	NOT NECESSARY	55.00	-
1	REAR DOOR UPPER BLACK TAPE RH	NECESSARY	22.00	22.00
1	REAR DOOR SIDE BLACK TAPE RH	NECESSARY	22.00	22.00
1	REAR DOOR SIDE RUBBER WEATHERSTRIP	NOT NECESSARY	120.00	-
1	REAR DOOR BODY SIDE RUBBER WEATHERSTRIP RH	NOT NECESSARY	90.00	-
10	REAR DOOR WINDOW RUN CHANNEL RUBBER SEAL RH @\$200.00	NOT NECESSARY	2,000.00	-
1	REAR DOOR WINDOW CHANNEL DIVISION RH	NOT NECESSARY	50.00	-
1	REAR DOOR LOWER GARNISH RH	CUT	130.00	130.00
1	REAR DOOR ELECTRICAL WIRING HARNESS ASSY RH	NOT NECESSARY	750.00	-
1	REAR AXLE ASSY	BENT	1,450.00	1,001.00
2	REAR AXLE MOUNTING BOLT RH @\$12.00	NOT NECESSARY	24.00	-
1	REAR ABSORBER ASSY RH	BENT	250.00	250.00
2	REAR ABSORBER BOLT RH @\$12.00	NOT NECESSARY	24.00	-
1	REAR COIL SPRING ASSY RH	BENT	450.00	103.00
1	REAR WHEELHUB WITH BEARING ASSY RH	NECESSARY	340.00	340.00
5	REAR WHEELHUB BOLT RH @\$12.00	NOT NECESSARY	60.00	-
1	REAR WHEELHUB BOLT WASHER RH	NOT NECESSARY	12.00	-
1	REAR ABS EXTENSION CABLE RH	NOT NECESSARY	120.00	-
1	ORIGINAL KIA STONIC R15 RIM	CUT	759.00	500.00
1	REAR BUMPER	TO REPAIR SEE LABOUR	500.00	-
10	REAR BUMPER CLIPS @\$5.00	NOT NECESSARY	50.00	-
1	REAR BUMPER RETAINER RH	NOT NECESSARY	35.00	-
1	FRONT DRIVE SEAT AIR BAG RH	BROKEN	1,400.00	696.00
1	FRONT DRIVE SEATBELT ASSY RH	JAMMED	700.00	380.00
1	FRONT PASSENGER SEATBELT ASSY LH	JAMMED	700.00	380.00
1	REAR PASSENGER SEATBELT ASSY RH	JAMMED	1,100.00	266.00
1	REAR PASSENGER SEATBELT ASSY LH	JAMMED	1,100.00	266.00
1	REAR PASSENGER SEATBELT ASSY (CENTER)	NOT NECESSARY	900.00	-
1	ROOF HEADLINER	CRUSHED	3,600.00	1,193.00

Report Ref No. CC6/CTI22002029/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ROOF AIR BAG RH	BROKEN	1,600.00	1,576.00
1	SRS CONTROL UNIT	NECESSARY	680.00	680.00
1	FRONT DOOR AIR BAG SENSOR RH	NECESSARY	180.00	180.00
1	SIDE WALL AIR BAG SENSOR RH	NOT NECESSARY	180.00	-
	LESS 10% DISCOUNT		-	-1,466.00
			35,065.00	13,194.00
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT LICENSE PLATE WITH FRAME (SN)	CUT	40.00	40.00
5	REAR FENDERSHIELD SPECIAL CLIPS @\$5.00 (SN) (ADDITIONAL)	NECESSARY	25.00	20.00
1	REAR INNER TRIM RH (SN)(ADDITIONAL)	BROKEN	1,980.00	606.00
			2,045.00	666.00
	<u>LABOUR</u>			
	SPRAY PAINT (FRONT BUMPER ,FRONT FENDER RH ,FRONT FENDER LH,FRONT DOOR RH ,REAR DOOR RH,REAR FENDER RH ,REAR BUMPER,A-PILLAR RH ,SIDE MIRROR RH & TAIL GATE RH).		2,000.00	1,000.00
	REMOVE ,REFIT REPAI AND REPLACE ACCIDENT AFFECTED PARTS.INCLUSIVE OF THE REPAIR OF REAR BUMPER .		2,400.00	1,200.00
	REPAIR & RESPRAY SIDE WALL RH .	NOT NECESSARY	600.00	-
	REMOVE,REFIT & REPLACE REAR AXLE .	NOT NECESSARY	350.00	-
	REMOVE,REFIT & REPLACE REAR UNDERCARRIAGE RH .		300.00	150.00
	TRANSFER DOOR FITTING AND WINDOW MECHANISM TO NEW DOOR .		200.00	100.00
	REMOVE,REFIT SEATS ,ROOF HEADLINER & RELATED PARTS (AIRBAGS).		350.00	150.00
	REMOVE & REFIT UPHOLSTERY GARNISHES ,TRIMMING TO FACILITATE REPAIR.		250.00	50.00
	REPAIR FORNT SEAT LEATHER & CUSHION (DAMAGED AREA).		350.00	200.00
	COMPUTERIZED WHEEL ALIGNMENT.		80.00	60.00
	TRANFER TYRE TO NEW RIM & REAR WHEEL BALANCING RH .		100.00	30.00
	RESET FAULT CODE ECU ,ABS ,SRS ETC.		150.00	100.00

Report Ref No. CC6/CTI22002029/Eya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	APPLY RUST PROOFING ON REPLACED /REPAIRED PANEL.		100.00	30.00
	CHECK AND RECTIFY ELECTRICAL WIRING.		30.00	30.00
			7,260.00	3,100.00
GRAND TOTAL			44,370.00	16,960.00
RECOMMENDED COST OF REPAIRS				16,960.00

Report Ref No. CC6/CTI22002029/Eya3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLE 110Y

INSPECTION

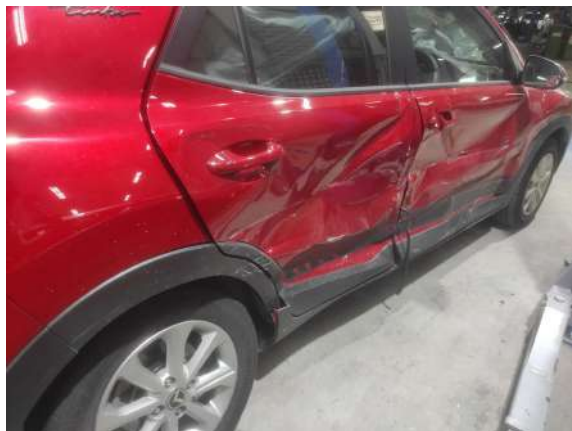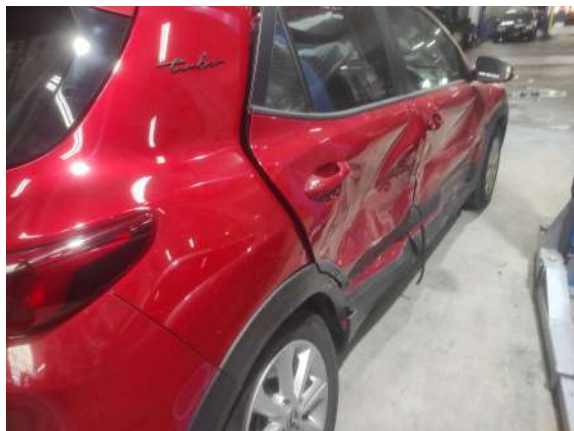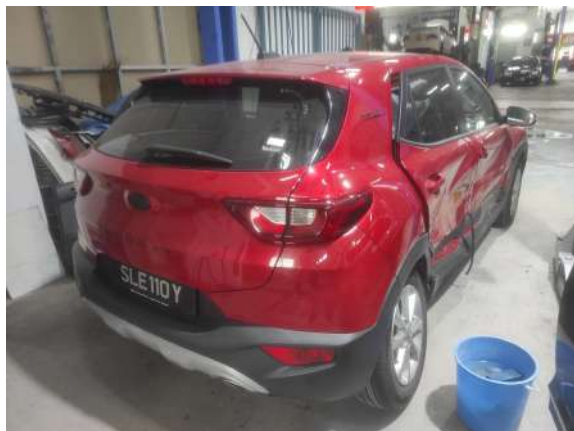



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

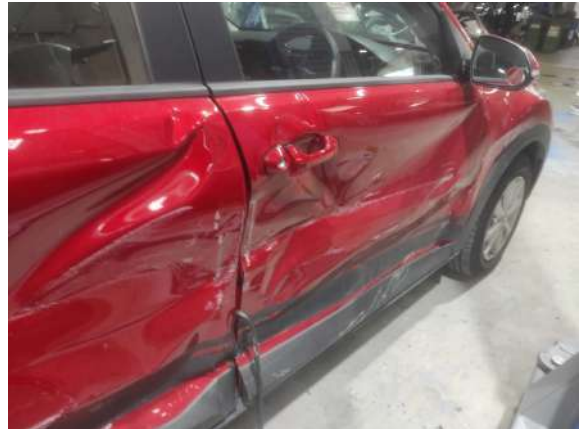



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

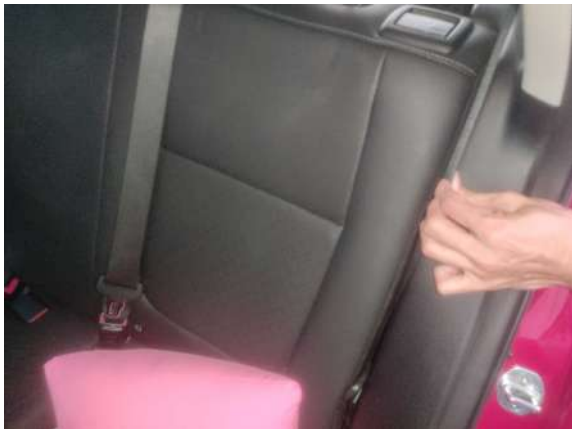



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

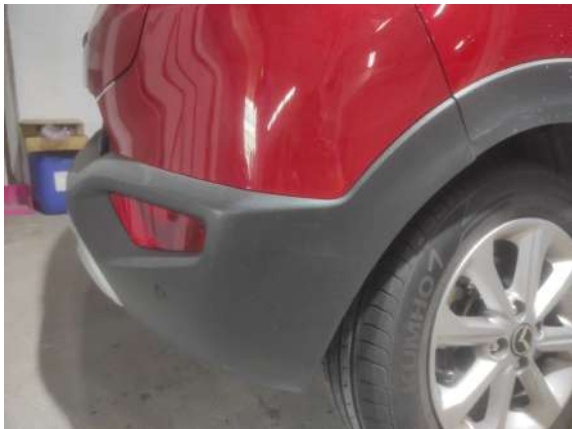



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

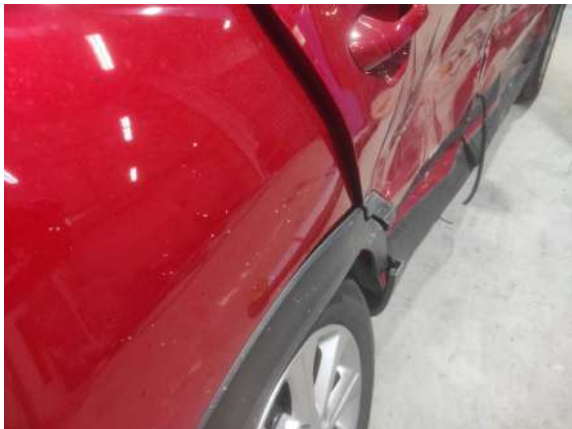



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLE 110Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

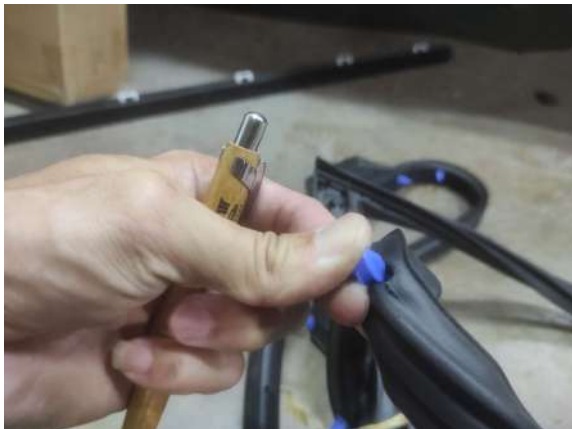



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

