

SM AUTOMOTIVE

Blk 1 Kaki Bukit Ave 6

01-43

Singapore 417883

Accident date : 05/03/2022

05/03/2022

1/5 #440075 5DAJ

TP China
Ceilia.

Estimated repair cost for vehicle no : SLE6408A MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT
CHASSIS: JM6BM42A8G0342633 (2016)

S/N	Qty	Items	U/price	Amount
1	1	FRONT BUMPER Deformed.	\$798.90	\$798.90 ✓
2	1	RH FRONT SIDE RETAINER Dented	\$85.60	\$85.60 #2
3	1	RH FRONT BUMPER FOG LAMP OUTER GARNISH	\$277.80	\$277.80 87
4	1	RH FRONT BUMPER FOG LAMP OUTER CHROME	\$211.20	\$211.20 X.
5	1	RH FRONT BUMPER FOG LAMP	\$398.80	\$398.80 351
6	1	RH FRONT BUMPER DAY LAMP	\$364.60	\$364.60 X.
7	1	RH FRONT HEADLAMP	\$2357.30	\$2357.30 ✓
8	1	RH FRONT HEADLAMP LOWER BRACKET	\$198.20	\$198.20 55
9	1	RH FRONT FENDER	\$698.20	\$698.20 393
10	1	RH FRONT FENDER INNER COWLING	\$198.40	\$198.40 ✓
11	1	RH FRONT LOWER ARM	\$398.70	\$398.70 ✓
12	1	RH FRONT SHOCK ABSORBER	\$487.20	\$487.20 X.
13	1	RH FRONT KNUCKLER ARM	\$845.10	\$845.10 X.
14	1	RH FRONT KNUCKLER ARM BEARING	\$226.40	\$226.40 ✓

15 Wiper Washes Tank: Deformed 112 ✓

TOTAL : \$6,034.70
LESS 20 % \$1,206.94
SUB-TOTAL : \$4,827.76

5019.70

4015.76

3196.76

S/N	Qty	ITEMS / SPECIAL NETT	U/price	Amount
1	1	FRONT BUMPER CLIPS <i>new</i>	\$80.00	\$80.00 <i>30</i>
2	1	FRONT FENDER INNER COWLING CLIPS <i>new</i>	\$60.00	\$60.00 <i>30</i>
3	1	RH FRONT SPORT RIM <i>lit.</i>	\$850.00	\$850.00 <i>40</i>
4	1	RH FRONT TYRE <i>new</i>	\$250.00	\$250.00 <i>4</i>

460

TOTAL: \$1,240.00

TOTAL PARTS: \$6,067.76

Labour charges

- 1 LABOUR FOR PANEL BEATING
- 2 LABOUR FOR SPRAYPAINTING
- 3 WIRING CHECK
- 4 TO APPLY RUST PROOF / TUFF COAT ON ACCIDENT AREAS
- 5 LABOUR FOR REMOVE & RENEW LH REAR UNDERCARRIAGE
- 6 TO CONDUCT WHEEL ALIGNMENT

\$1,400.00 *500*

\$1,000.00 *400*

\$80.00 *30*

\$200.00 *160*

\$300.00 *120*

\$150.00 *80*

1130

Subtotal :- \$3,130.00

Total:- \$9,197.76

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:


Date:

Adnan L
1/s 07/03/22
OS Dungs

total: *5605.76*

1/s: 4.4K

4.4K

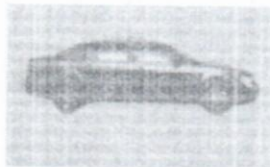

PEOPLES AUTO TRADING
BLK 3007 UBI ROAD 1 #01-400
TEL 6741 4646



COMPUTERIZED ALIGNMENT SPECIALISTS

CUSTOMER	SM	DATE	Mar 5, 2022 2:46:06 PM
FIRST NAME			
LICENSE NO.	SLE 6408 A		
MILEAGE	63310		
MAKE	CUSTOM	MODEL	MAZDA 3 (BM)
NOTES			

Front Wheel	SPECS				DIAGNOSIS				ADJUSTMEN			
	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.00	0.00	1.00			1.50				1.50		
PARTIAL TOE	-0.50	0.00	0.50		-0.80		2.40		-0.30		1.90	
SET BACK	---	---	---			-5°06"				-0°06"		
CAMBER	-0°44"	0°00"	0°44"		0°24"		-1°54" 1°30"		-0°26"		-1°52" 1°26"	
CASTER	5°00"	6°00"	7°00"		6°02"		5°48" 0°14"		6°02"		5°48" 0°14"	
KING-PIN	---	---	---		13°30"		13°04" 0°04"		13°00"		13°04" 0°04"	
INCL ANGLE	---	---	---		12°36"		11°10"		12°34"		11°10"	
Toe-out on turns	---	---	---		---		---		---		---	
STEERING IN	---	---	---		---		---		---		---	
STEERING OUT	---	---	---		---		---		---		---	

Rear Wheel	SPECS				DIAGNOSIS				ADJUSTMEN			
	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.10	1.10	3.40			1.70				1.70		
PARTIAL TOE	-0.50	0.50	1.70		1.90		-0.20		1.90		-0.20	
SET BACK	---	---	---			0°06"				0°06"		
CAMBER	-0°18"	0°00"	0°18"		-0°46"		-1°12" 0°26"		-0°46"		-1°12" 0°26"	
THRUST ANGLE	-0°08"	0.00	0°08"			0°16"				0°10"		