LKK Auto Consultants #01-25 Paya Ubi Industrial Park, 51 **Ubi Avenue 1** 408933

Insurer Reference: GBK5959U

Full Report Repairer Reference: M4457/GBK5959U Registration: GBK5959U Date calculated: 30/05/2022 2:02 PM Printed: 30/05/2022 2:02 PM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Printed by: KK LAU Claim Reference: GBK5959U

Date of Incident: Hire Car Start: Hire Car End:

Currency:

SGD 07/03/22

7 Estimated Repair Time: 6 Actual Repair Days:

Vehicle Details

Vehicle

ISUZU Manufacturer: Model: N-SERIES Sub Model: NHR Model Sheet Number: 37 03 01 Registration: GBK5959U

VIN number: JAANHR87EK7100279

Odometer: **Model Specs**

2.8 LTR 70KW SINGLE CAB TWO COAT METALLIC


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All
Underbody

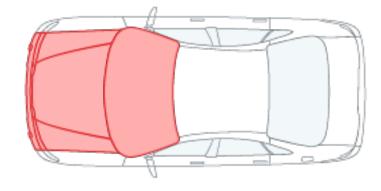

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

 $mm \hspace{1cm} mm \hspace{1cm} mm \hspace{1cm} mm \hspace{1cm} mm \hspace{1cm} Middle), \hspace{1cm} mm$

Spare Tyre Brand

Tread (Spare), mm

Labour

	Time Base 10 WU/h	Price = 42.0	00 SGD/h
Code	Description	WU	Price SGD
NO NUMBER	RENEW FRONT PANEL (FRONT SCREEN AND INSTRUMENT PANEL REMOVED) INCLUDES: R + R FRONT GRILLE, HEADLAMPS AND CORNER PANEL	62.0	260.40
NO NUMBER	R + R ATT PARTS FRONT PANEL	6.0	25.20
NO NUMBER	R + R WINDSCREEN	15.0	63.00
NO NUMBER	R + R L/MIRROR BRACKET	3.0	12.60
NO NUMBER	R + R INSTRUMENT PANEL CPL INCLUDES: R + R COMBINATION INSTRUMENT	35.0	147.00
NO NUMBER	R + R COMPLETE HEATER (INSTRUMENT PANEL AND FRONT GRILLE REMOVED)	13.0	54.60

Labour Cost	Hrs	WU	562.80
Panel / Mechanical Labour	13.40	134.0	
Total of Labour			562.80

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	L/F CORNER PANEL NEW PART PAINTING	7.0
	FRONT PANEL CPL NEW PART PAINTING	33.0

Paint Material Per Part

Code	Description	Price SGD
0887	L/F CORNER PANEL NEW PART PAINTING	5.16
0900	FRONT PANEL CPL NEW PART PAINTING	47.85

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			40.0	
Preparation Main Work Metal		2.10	21.0	88.20
Total	10 WU/h	6.10	61.0	256.20

Material Cost - Paint	Price SGD
New Part Painting	53.01
Material-constant Metal	18.10
Total	71.11

Spare Parts

prices as at 2001-01-0				
Price SG	Part Source	Part Number	Description	Code
340.0	Supplementary	8971063153	BLOWER CPL	4446
25.0	Original	FRONT	EMBLEM (NH)	1000
130.0	Original	8978595561	FRONT MANUFACT BADGE	0431
450.0	Original	8978594240	FRONT PANEL CPL	0900
1,500.0	Supplementary	8970716973	HEATER BLOWER	4445
12.0	Original	8978537874	L/D-MIRROR BRACKET	1733
70.0	Supplementary	8942625423	L/DOOR MIRROR	1737
300.0	Original	8978562698	L/DOOR MIRROR ARM	1739
190.0	Original	8978966540	L/F CORNER PANEL	0887
60.0	Original	8971845551	L/F WIPER ARM	1453
310.0	Original	8971823980	LEFT HEADLAMP ASSY	0563
12.0	Supplementary	HFRONT	SIDE MIRROR ROUND L	1002
78.0	Original	8978902143	UPPER MOULDING	1423
102.0	Supplementary	FRONT	W/SCREEN LWR MLDG	1001
12.0	Supplementary	FRONT	W/SCREEN MLDG LWR LH	1003
155.0	Supplementary	8978550168	WASHER CONTAINER CPL	1436

Code 1401 1410	Description WINDSCREEN WINDSCREEN SEAL	Part Number 8978691231 8978598567	Part Source Original Original		Price SGD 900.00 96.00
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings Subtotal				0.00 4,742.00
ar osca parts	Total				4,742.00
Final Calculat	ion				
				SGD	SGD
Parts Total Parts				4,742.00	4,742.00
Labour Time Ba Total 134.0 W Total of Labour	u se 10 WU/h U X 42.00 SGD/h			562.80	562.80
Material Cost	.0 WU X 42.00 SGD/h			256.20 71.11	227.24
Total Paint Inclu	ding Material				327.31
Repair Cost Excl	udes GST				5,632.11
GST (+7.00%) Repair Cost Incl	uded GST				394.25 6,026.36
Deductions (Exc Deduction For E Total Of Deduction				-500.00	-500.00
Grand Total Excl	udes GST				5,132.11
GST (+7.00%) Grand Total Incl	uded GST				359.25 5,491.36

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.