

ASS. REC. BY: Tauyph

REF:

CS/CT/22002369/TVC

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: 43750

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 980K

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / ☒ REV REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SGV686 Yr Regn: 2015, Jan

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Mercedes Benz E250 c.c. 1991Colour: White A/C: Insured / Std / NI / NASp. Reading: 108189 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: WDD 21203623099792Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 265/35R18R: N NBS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 6 mmL/Bal. 6 mm

D.O.A.

Rear

R/Bal. 6 mmL/Bal. 6 mm

D.O.I.

Survey held at

Des. of Damages: Frt / Rear / ☒ O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee:

Transportation:

S + RS. \$

Photos

Others

TOTAL

Report Format: \_\_\_\_\_

Lump Sum / L.B.I. (\$) \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)☐ : Interview (\$ \_\_\_\_\_)☐ : Tech. Invs (\$ \_\_\_\_\_)☐ : Weekend (\$ \_\_\_\_\_)

**Jin Auto Services Pte Ltd**  
**#01-410/412, 14 Defu Lane 10**  
**539195**

**Insurer Reference: SGV68G**  
**Repairer Reference: SGV68G**  
**Date calculated: 14/03/2022 12:41 PM**

**Full Report**  
**Registration: SGV68G**  
**Printed: 14/03/2022 12:41 PM**

### Summary Information

<b>Claim</b>			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SGV68G	Date of Incident:	11/03/22
Estimated Repair Time:	14	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

### Vehicle Details

#### Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	E-CLASS (W212)
Sub Model:	E 250
Model Sheet Number:	03 EE 47
Registration:	SGV68G
VIN number:	WDD2120362B099792
Odometer:	108189

#### Model Specs

FR PRODUCTION START	MODEL 2015	FRT COLLISION ALARM	RADIATOR SHROUD
EL DRIVE POS SELECT	PARKTRONIC	LOAD COMPARTMENT BOX	AUDIO 20 CD CHANGER
MULTIMEDIA INTERFACE	GRILLE WITH STAR	SMART LIGHT SYSTEM	LAMINATED GLASS
ELECTRIC BOOTLID REL	HEATED WASHER UNIT	LEATHER TRIM	SUNBLIND TWO-PIECE
EQUIPMENT AVANTGARDE	SPORTS PACKAGE AMG	MEMORY PACKAGE	DIPPING MIRROR
S-WDW ROLLER BLIND	WOOD TRIM ASH TREE	REM RELEASE FUEL CAP	KEYLESS GO
PELVIS BAG	RR SCREEN SUN BLIND	ECO START/STOP	STRG COLUMN SHIFT
EMISSION STD EURO 6	7 SPEED AUTOMATIC	TYRE PRESSURE SENSOR	245/40-/265/35 YR 18
SPARE WHEEL	8.5-/9 J X 18 ALLOY	FUEL TANK 80 LTR	HD COOLING
PANORAMIC ROOF	AMG STYLING	TWO COAT METALLIC	COMPRESSOR VARIABLE
PREPARE OFF VEHICLE	CLEAR COAT HARD	SPORTS SUSPENSION	SPORT STEERING WHEEL

## Vehicle Condition


### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

### Damage Areas

All ☐  
Underbody ☐

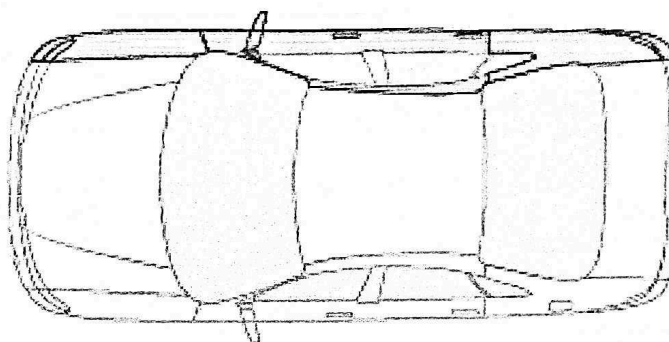

## Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

## Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-7989 03	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		2.0	8.40
72-1515 02	RENEW R/F DOOR AND CONVERT PARTS INCLUDES: DOOR TRIM REMOVE AND REFIT AND ALL ATTACHED PARTS ASSEMBLE		36.0	151.20
72-1682 02	ADDITIONAL RENEW RIGHT FRONT DOOR VEHICLE WITH LOWER MOULDING		1.0	4.20
72-1640 02	RENEW R/R DOOR AND CONVERT PARTS INCLUDES: DOOR TRIM REMOVE AND REFIT AND ALL ATTACHED PARTS ASSEMBLE		37.0	155.40
72-1760 02	ADDITIONAL RENEW RIGHT REAR DOOR VEHICLE WITH LOWER MOULDING		1.0	4.20
60-2180 01	R + R ATTACHED PARTS OF THE REAR PANELLING FOR RENEWAL OF THE R/R WING INCLUDES: R + R ATTACHED PARTS IN THE REPAIR SECTION		62.0	260.40
63-1890 01	RENEW RIGHT REAR WING CPL		111.0	466.20

Code	Description	WU	Price SGD
88-8842 ZAX	DIS + ASS REAR BUMPER (REMOVED)	2.0	8.40
88-8883 02	ADDITIONAL FOR DISS/ASS REAR BUMPER (VEHICLE WITH PARK ASSISTENT)	2.0	8.40
88-8882 ZAX	ADD TO DIS/ASS REAR BUMPER CPL (LUXURY VERSION VEHICLE)	2.0	8.40
88-8923 ZAX	ADDITIONAL TO REAR BUMPER REPLACE (VEHICLE WITH TAILGATE OPENER)	1.0	4.20
40-2410 01	R + R RIGHT REAR TYRE	3.0	12.60
40-2702 ZAX	ADDITION TO R + R R/R TYRE (TYRE CROSS-SECTION SMALLER THAN 55)	1.0	4.20
40-2055 01	BALANCE R/R WHEEL	2.0	8.40
40-2713 01	ADD TO WHEEL RENEW (VEHICLE WITH TYRE PRESSURE CHECK)	3.0	12.60
40-1470 01	ADD TO R/R WHEEL REMOVE AND REFIT (ASSEMBLY ON WHEELS FROM 17 INCH	1.0	4.20
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		<b>26.70</b>	<b>267.0</b>
<b>Total of Labour</b>			<b>1,121.40</b>

## Paint

Code	Description - TWO COAT METALLIC	WU	Price SGD
	RIGHT FRONT DOOR NEW PART PAINTING	16.0	
	R/R DOOR NEW PART PAINTING	15.0	
	R/R WING NEW PART PAINTING	27.0	
	R/RR WHEEL NEW PART PAINTING	6.0	
	R/R DOOR OUT HANDLE NEW PART PAINT K1R	3.0	
	R/SILL PANELLING NEW PART PAINT K1R	8.0	
	REAR BUMPER COVER NEW PART PAINT K1R	14.0	

## Paint Material Per Part

Code	Description	Price SGD
1482	RIGHT FRONT DOOR NEW PART PAINTING	
1782	R/R DOOR NEW PART PAINTING	43.34
3482	R/R WING NEW PART PAINTING	41.80
9552	R/RR WHEEL NEW PART PAINTING	36.30
1864	R/R DOOR OUT HANDLE NEW PART PAINT K1R	4.13
2208	R/SILL PANELLING NEW PART PAINT K1R	0.98
2583	REAR BUMPER COVER NEW PART PAINT K1R	31.98
		<b>70.36</b>

## Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint				
Preparation Main Work Metal		2.50	89.0	
Preparation Comp. Work Plastic		0.50	25.0	105.00
<b>Total</b>	<b>10 WU/h</b>	<b>11.90</b>	<b>5.0</b>	<b>21.00</b>
			<b>119.0</b>	<b>499.80</b>

**Material Cost - Paint**

New Part Painting

New Part Painting - Plastic K1R

Material-constant Metal Preparation

Material-constant Plastic

**Total****Price SGD****125.57****103.32****28.60****9.00****266.49****Spare Parts**

Code	Description	Part Number	Part Source	prices as at 2015-06-01	Price SGD
1482	RIGHT FRONT DOOR	212 720 5400	Original	bb	1,195.00
1510	R/F DOOR SEAL	099 727 0300		ue	0.00
1782	R/R DOOR	212 730 3405	Original	bb	1,500.00
1810	R/R DOOR SEAL	099 727 0300	Original	ue	200.00
1832	R/R QUARTER GLASS	212 730 4000			0.00
1846	RR D/WDW BONDING KIT	000 989 4905			0.00
1852	R/R WINDOW MOTOR	204 820 0642	Original	?	450.00
1864	R/R DOOR OUT HANDLE	204 760 1470 9999	Original	dis	255.00
2208	R/SILL PANELLING	212 698 2054 9999	Original	Ry	700.00
2583	REAR BUMPER COVER	212 885 3538 9999	Original	Ry	1,190.00
2590	BLIND RIVET	003 990 9497		ue	0.00
2944	BOOTLID SEAL	212 750 0198	Original	?	115.00
3160	REAR SCREEN BOND KIT	000 989 4905		ue	0.00
3161	REAR SCREEN SUPPORTS	164 742 0097		ue	0.00
3482	R/R WING	212 630 0421	Original	buc	1,480.00
9552	R/RR WHEEL	212 401 0400 7X21	Original	dd	1,250.00
9566	R/RR TYRE	265/35 R 18 ... Y	Original	80% out	450.00
1000	RR WS SEALANT	SEALANT	Original	ue	40.00
1001	WHEEL ALIGNMENT	ALIGNMENT	Original	80	100.00
1002	RR RH DR PWR WINDOW REGULATOR		Original	?	430.00
<b>Savings</b>					
<b>Subtotal</b>					<b>0.00</b>
<b>Fixed Sundry Parts Price</b>					<b>9,355.00</b>
<b>Total</b>					<b>100.00</b>
					<b>9,455.00</b>

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

## Final Calculation

	SGD	SGD
<b>Parts</b>		
Fixed Sundry Parts Price	9,355.00	
<b>Total Parts</b>	100.00	<b>9,455.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 267.0 WU X 42.00 SGD/h	1,121.40	
<b>Total of Labour</b>		<b>1,121.40</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 119.0 WU X 42.00 SGD/h	499.80	
Material Cost	266.49	
<b>Total Paint Including Material</b>		<b>766.29</b>
<b>Repair Cost Excludes GST</b>		<b>11,342.69</b>
GST (+7.00%)		<b>793.99</b>
<b>Repair Cost Included GST</b>		<b>12,136.68</b>

### Comments

- \* - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
- ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Taufik 97495749

15/3/22 @ 440pm

EX: 93750

taufik@lkhauto.com

Not Authorise, Revert.

08 days

L/S Resurvey after repair