



Auto Insure Pte. Ltd.
6 Marsiling Lane
Singapore (739145)
E: claims01@autoinsure.com.sg
W: www.autoinsure.com.sg
T: 3157 2626 F: 6368 0081
GST No.: 201437380M

Page No.1

AUTOMOBILE ASSESSMENT REPORT

Our Ref: **SMR8316M (MARVYN)**

Your Ref: **PC7076E**

Date: **12-Mar-22**

BY EMAIL ONLY
(claims01@autoinsure.com.sg)

ATTENTION: MOTOR CLAIMS DEPT

Email : MTCL@income.com.sg

NTUC Income Insurance company

1 Maritime Square
Harbourfront Centre
#10-01 Singapore 099253

Assessed Vehicle No : SMR8316M
Car Make and Model : VOLKSWAGEN TOURAN 1.4 TSI CL 5T13NZ
Date of Accident : 07-Mar-22
Date of Assessment : 12-Mar-22

We have carried out a physical assessment of SMR8316M at our workshop Auto Insure Pte Ltd sustained damages to the REAR portion of the vehicle.


4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had sustained damages to the REAR portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

| | | | |
|------------------|---|-----|-----------|
| Estimated Amount | : | L/S | |
| Adjusted Amount | : | \$ | 11,033.10 |
| Est. Repair Days | : | 4 | |

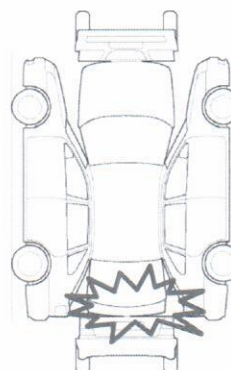

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

AUTO INSURE PTE. LTD. For any reliance on this report by any third party.

Our Ref: **SMR8316M**

Your Ref: **PC7076E**

| S/NO | QTY | DESCRIPTIONS | ASSESSED CONDITION | EST. BY WORKSHOP |
|---------------------------------------|-----|---|-----------------------|--------------------|
| PARTS REPLACEMENT - LIST ITEMS | | | | |
| 1 | 1 | REAR TAILGATE <i>repair</i> | | \$ 3,131.18 XR |
| 2 | 1 | REAR TAILGATE LOGO (TOURAN) <i>acc ✓</i> | | \$ 126.15 159.23 |
| 3 | 1 | REAR TAILGATE CHROME GARNISH <i>acc ✓</i> | | \$ 235 850.88 |
| 4 | 1 | REAR BUMPER <i>repair</i> | | \$ 108 1,864.88 XR |
| 5 | 1 | REAR BUMPER SIDE RETAINER RH <i>X n</i> | | \$ 82.10 Y |
| 6 | 1 | REAR BUMPER SIDE RETAINER LH <i>X n</i> | | \$ 325.03 82.10 Y |
| 7 | 1 | REAR BUMPER GUIDE RH <i>X n</i> | | \$ 101.30 X |
| 8 | 1 | REAR BUMPER GUIDE LH <i>X n</i> | | \$ 101.30 X |
| 9 | 1 | REAR BUMPER REINFORCEMENT <i>X n</i> | | \$ 1,032.98 X |
| 10 | 1 | REAR BUMPER LOWER COVER <i>X n</i> | | \$ 1,032.23 X |
| 11 | 1 | REAR END PANEL <i>X n</i> | | \$ 1,218.83 X |
| | | | SUB TOTAL | \$ 9,657.01 |
| | | | LESS 10% | \$ 965.70 |
| | | | TOTAL AMOUNT | \$ 8,691.31 |

Our Ref: **SMR8316M**

Your Ref: **PC7076E**

| S/NO | QTY | SPECIAL NETT ITEMS | ASSESSED CONDITION | EST. BY WORKSHOP |
|------|-----|------------------------|-----------------------|------------------|
| 1 | 1 | REAR BUMPER CLIPS | | \$ 50.00 |
| 2 | 1 | REAR END PANEL SEALANT | | \$ 60.00 |
| | | | SUB TOTAL | \$ 110.00 |
| | | | TOTAL PARTS COST | \$ 8,801.31 |

Our Ref: **SMR8316M**

Your Ref: **PC7076E**

| S/NO | DESCRIPTION | EST. BY WORKSHOP |
|------|--|------------------|
| | LABOUR & PAINTWORK | |
| 1 | TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS | \$ 200 600.00 |
| 2 | TO REMOVE & REFIT WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS | \$ 100.00 |
| 3 | TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED | \$ 400 600.00 |
| 5 | TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS | \$ 50.00 |
| 6 | SUNDRIES (SAND PAPER, WELDING WIRE ETC.) | \$ 50.00 |
| 7 | TO VACUUM, WAXING & CLEAN | \$ 60.00 |
| 8 | TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS | \$ 50.00 |
| | TOTAL BEFORE GST | \$ 10,311.31 |
| | GST 7% | \$ 721.79 |
| | TOTAL (PARTS & LABOUR): | \$ 11,033.10 |

Adjustments / Recommendations

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a **sum of \$11,033.10** for lump sum with the third party insurance.

Yours Faithfully,

Jason Heng
Claims Director

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

325.03

600.00

925.03

Rahul
Hp 9001 0068

3 days

P/P

15/03/22 @ 1645

Resy after repair