



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2300695
3 ANSON ROAD #16-00	INV Date	06/02/2023
SPRINGLEAF TOWER	Reference	CC3/CTI22002402/Tpa3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SHD 8629T
Insured Veh.	PC 8852A
Claim No.	SNM22D201808/C02
Policy No.	DMB1SNW00013232102
Accident Date	11/03/2022
Inspection Date	11/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC3/CTI22002402/Tpa3q2 Date: 06/02/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	PC 8852A	Veh. Inspected	SHD 8629T
Policy No.	DMB1SNW00013232102	Coverage (\$)	0.00
Claim No.	SNM22D201808/C02	Excess (\$)	0.00
Assign From		Assign Date	11/03/2022
2. Vehicle Particulars & Condition			
Make & Model	HYUNDAI IONIQ	c.c	1580
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KMHC851CVKU121752	Colour	YELLOW
Odometer	457971 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	WEST LAKE	6 mm
L/H Front Tyre	195/65 R15	WEST LAKE	6 mm
R/H Rear Tyre	195/65 R15	WEST LAKE	6 mm
L/H Rear Tyre	195/65 R15	WEST LAKE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	11/03/2022	Inspection Date	11/03/2022
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 8629T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	PANEL ASSY -TAIL GATE	BENT	2,480.40	2,480.40
1	EMBLEM -HYBRID	NECESSARY	24.30	24.30
1	EMBLEM -IONIQ	NECESSARY	31.30	31.30
1	COVER -RR BUMPER	CRACKED	459.40	459.40
1	MOULDING ASSY -RR BUMPER C	CRACKED	451.25	451.25
1	BEAM -RR BUMPER	CRACKED	394.80	394.80
1	LAMP ASSY -REAR FOG	NOT NECESSARY	201.50	-
1	ANTENNA ASSY -SMARTKEY	NOT NECESSARY	40.50	-
1	GLASS ASSY -TAIL GATE LOWE	NOT NECESSARY	384.90	-
1	PANEL ASSY -BACK	TO REPAIR SEE LABOUR	532.00	-
10	BUMPER COVER CLIP REAR	NECESSARY	22.00	22.00
1	REAR BUMPER STAY LH	BENT	138.10	138.10
1	REAR BUMPER STAY RH	BENT	138.10	138.10
	LESS 20% DISCOUNT		-1,059.71	-827.93
			4,238.84	3,311.72
<u>SPECIAL NETT ITEMS</u>				
1	REAR BOOT LOGO CCTPL (SN)	NECESSARY	30.00	30.00
1	REAR BOOT TEL NUMBER CCTP (SN)	NECESSARY	30.00	30.00
1	APP LOGO REAR DOOR L/R CC(SN)	NECESSARY	40.00	40.00
1	VEHICLE NUMBER PLATE REAR (SN)	CRACKED	50.00	50.00
1	PROTECTOR MAT (SN)	NECESSARY	50.00	50.00
2	WINDSCREEN AHESIVE -310MLC (SN)	NECESSARY	46.00	46.00
			246.00	246.00
<u>LABOUR</u>				
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF PANEL ASSY -BACK .		1,200.00	700.00
	SPRAYPAINT CHARGE.		800.00	750.00
	CHECK ALL LIGHTING.		50.00	30.00
	TUFF COAT ON AFFECTED PARTS.		50.00	30.00
	RENEW ADVERTISEMENT STICKER -BOOT .		100.00	100.00

Report Ref No. CC3/CTI22002402/Tpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE /REFIX REVERSE SENSOR .		50.00	30.00
	REMOVE/REFIX RR WINDSCREEN GLASS .		120.00	120.00
			2,370.00	1,760.00
GRAND TOTAL			6,854.84	5,317.72
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,250.00

Report Ref No. CC3/CTI22002402/Tpa3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 8629T

INSPECTION

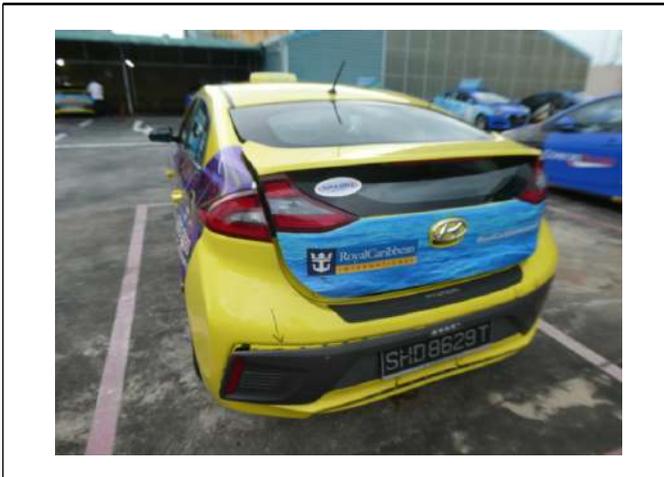




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

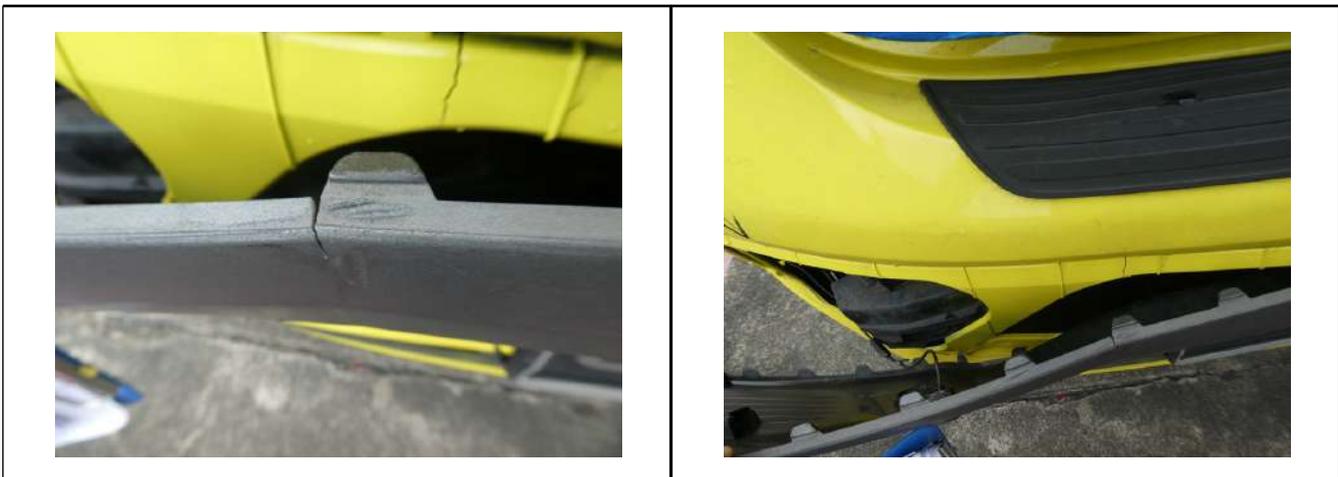




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

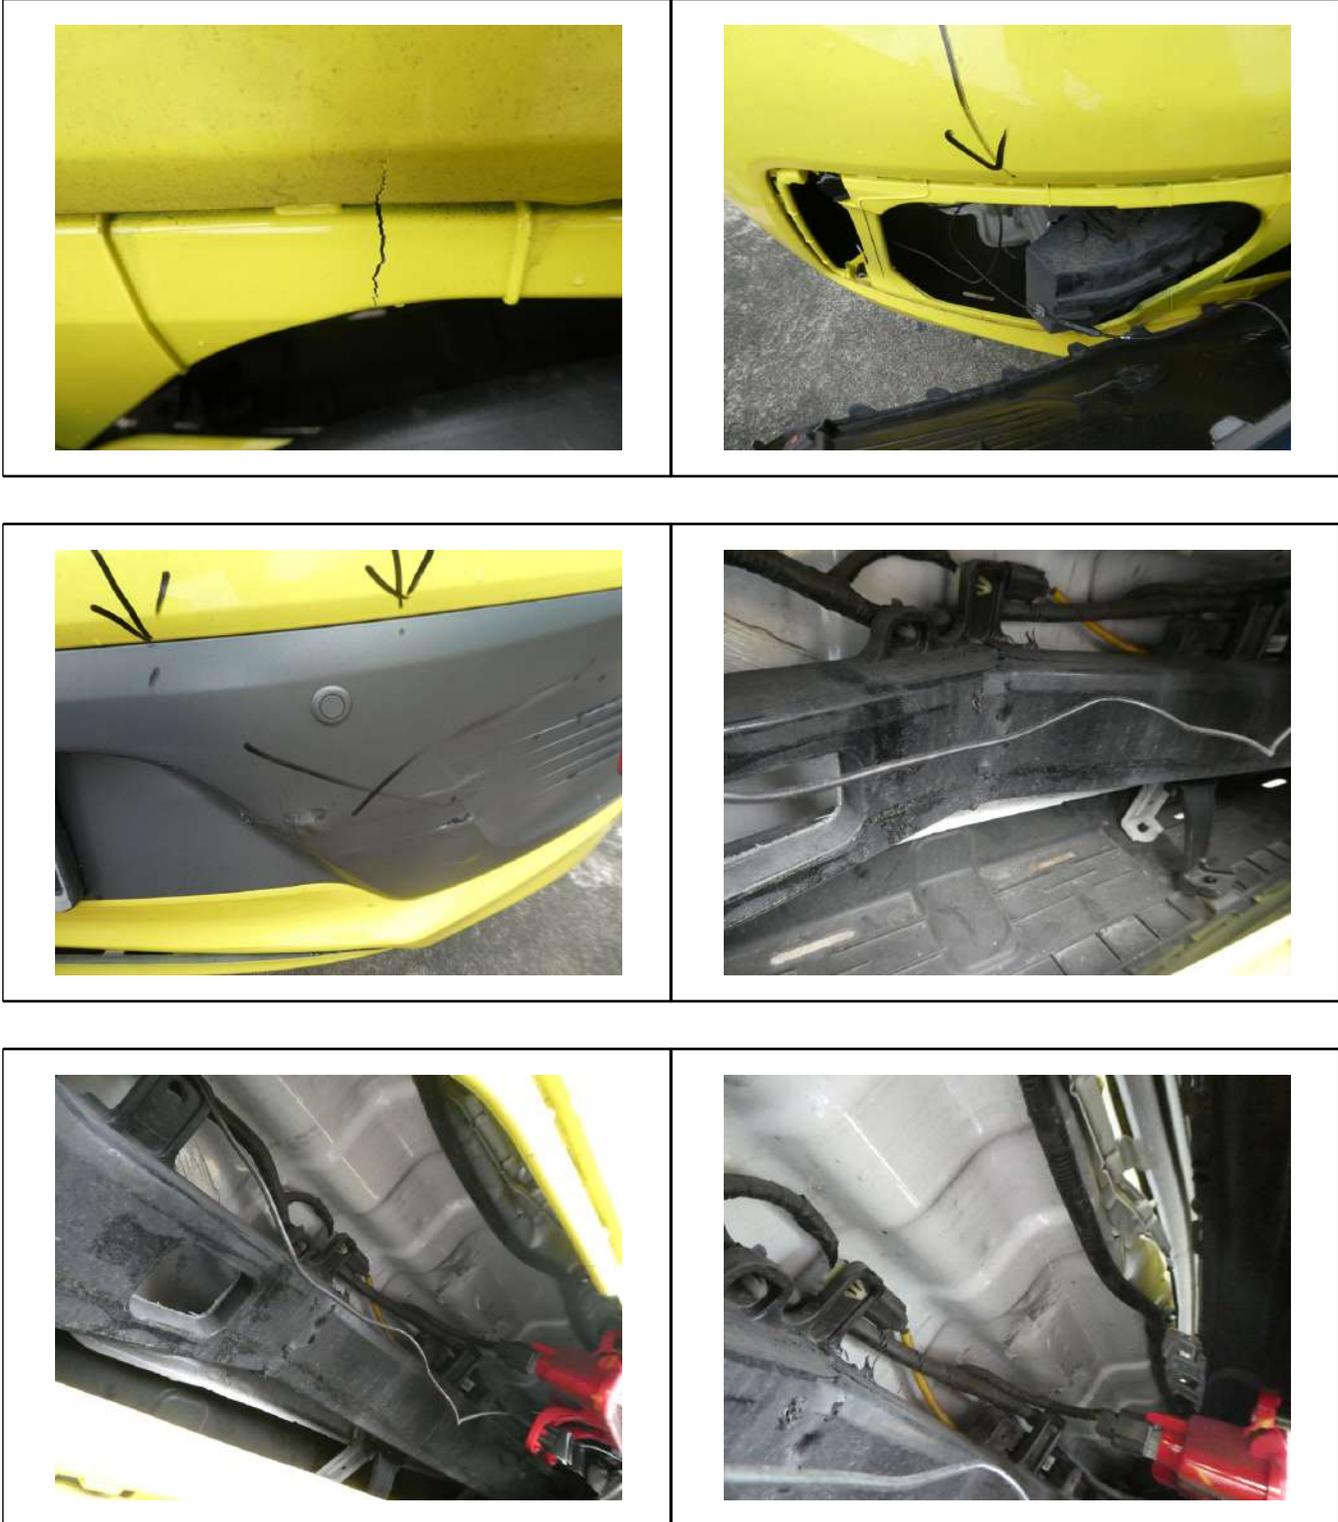






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

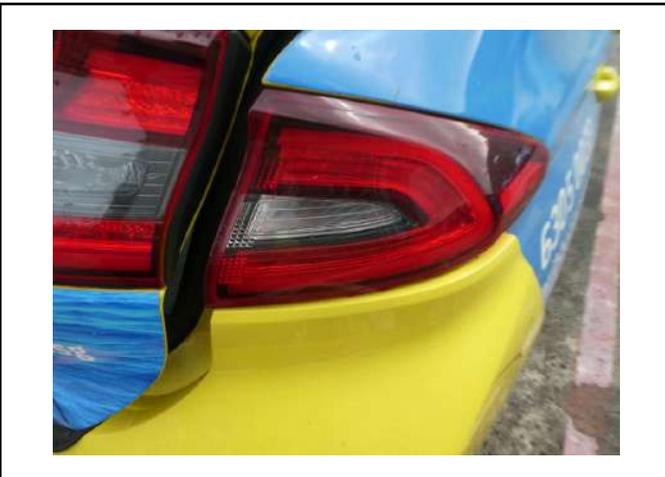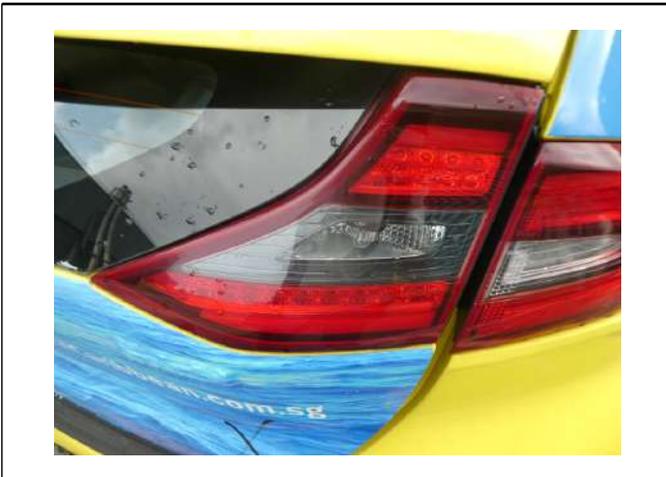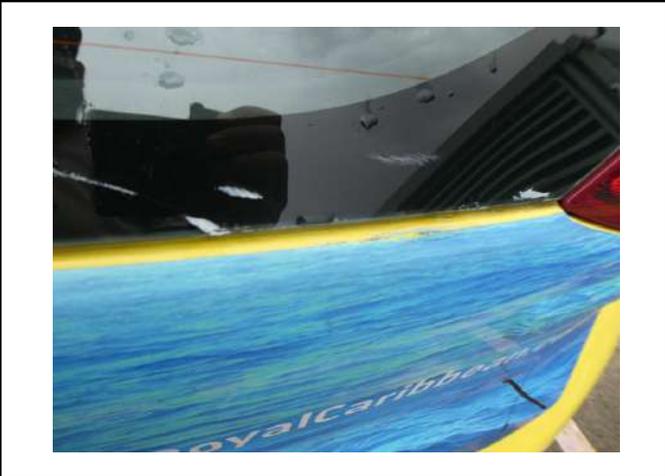




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

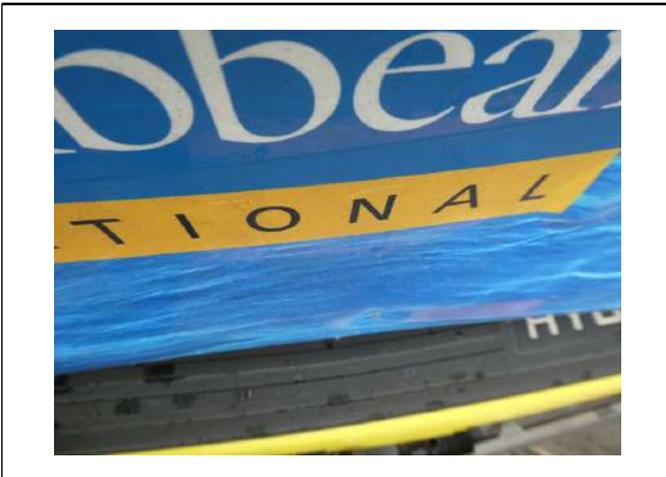





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

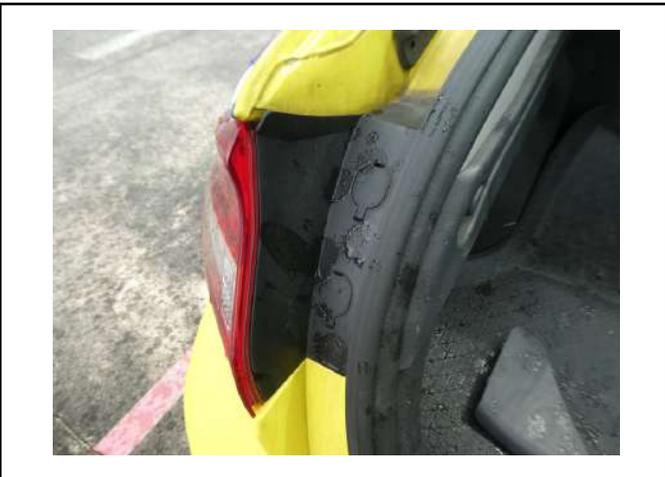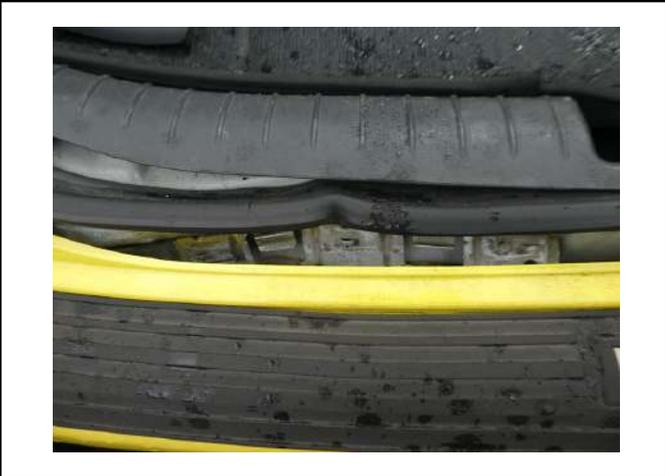





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

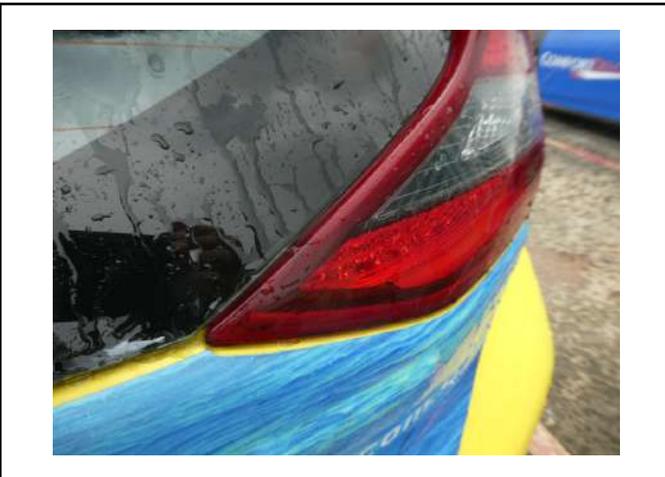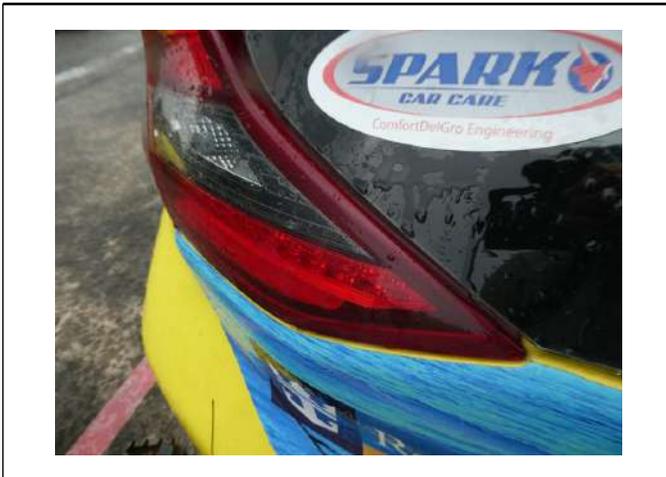



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 8629T

RE-INSPECTION

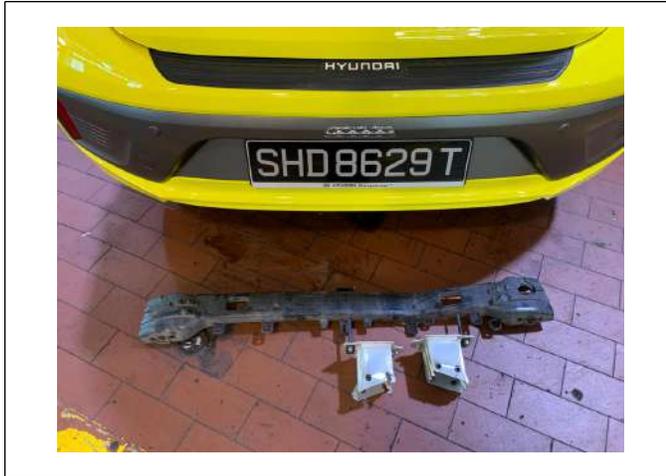



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 8629T

RE-INSPECTION

