

Jin Auto Services Pte Ltd
#01-410/412, 14 Defu Lane 10
539195

Insurer Reference: YQ1434P
Repairer Reference: YQ1434P
Date calculated: 14/03/2022 4:37 PM

Full Report
Registration: YQ1434P
Printed: 14/03/2022 4:37 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	YQ1434P	Date of Incident:	01/03/22
Estimated Repair Time:	7 5	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	FUSO
Model:	CANTER (FB/FE/FG)
Sub Model:	BASE MODEL
Model Sheet Number:	32 87 01
Registration:	YQ1434P
VIN number:	FEB21EA30199
Odometer:	69789

Model Specs

SINGLE CAB	TWO COAT METALLIC	PREPARE OFF VEHICLE
------------	-------------------	---------------------

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

not Authorized
all
2/5
1 day.
the ph. after rep -
19/4/22
Excess \$500

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

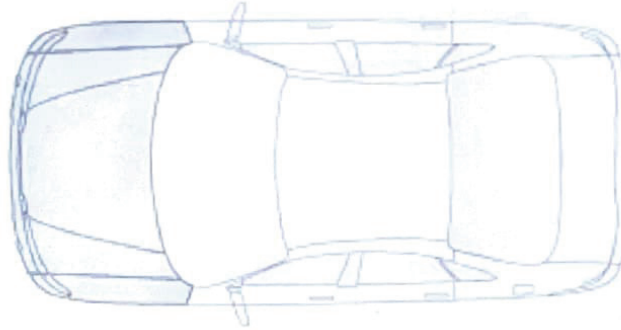

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	RENEW FRONT BUMPER INCLUDES: R + R NECESSARY ATTACHED PARTS		11.0	46.20
NO NUMBER	RENEW FRONT PANEL CPL		75.0	315.00
NO NUMBER	R + R LEFT HEADLAMP		2.0	8.40
NO NUMBER	R + R L/F REPEATER LAMP		4.0	16.80
NO NUMBER	R + R R/F REPEATER LAMP		4.0	16.80
NO NUMBER	AIR GUIDE PANEL COVER REMOVE AND REFIT		5.0	21.00
NO NUMBER	ADJUST HEADLAMPS		2.0	8.40
2810	CAB SUPPORT REPAIR		30 50.0*	210.00
Labour Cost			Hrs	WU
Panel / Mechanical Labour			15.30	153.0
Total of Labour				642.60

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	FRONT BUMPER NEW PART PAINTING	11.0	
	FRONT PANEL CPL NEW PART PAINTING	30.0	
	L/F BUMPER CORNER NEW PART PAINT K1R	4.0	
	R/F BUMPER CORNER NEW PART PAINT K1R	4.0	
	FRONT GRILLE NEW PART PAINT K1R	8.0	
	CAB SUPPORT SURFACE PAINT	5.0	

Paint Material Per Part

Code	Description	Price SGD
0281	FRONT BUMPER NEW PART PAINTING	24.77
0900	FRONT PANEL CPL NEW PART PAINTING	41.80
0289	L/F BUMPER CORNER NEW PART PAINT K1R	5.90
0290	R/F BUMPER CORNER NEW PART PAINT K1R	5.90
0410	FRONT GRILLE NEW PART PAINT K1R	33.46
2810	CAB SUPPORT SURFACE PAINT	9.46

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		62.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	92.0	386.40

Material Cost - Paint

	Price SGD
New Part Painting	66.57
New Part Painting - Plastic K1R	45.26
Surface-/Blend Paint	9.46
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	158.89

Spare Parts

					prices as at 2015-06-01
Code	Description	Part Number	Part Source		Price SGD
0257	FRONT NUMBER PLATE	NO NUMBER	Original	Best ✓	35.00 ✓
0281	FRONT BUMPER	MC978515	Original	Best ✓	560.00 ✓
0283	L/F BUMPER BRACKET	MK617973	Original	R. X	85.00 X
0284	R/F BUMPER BRACKET	MK617974	Original	Best ✓	85.00 ✓
0289	L/F BUMPER CORNER	MK617983	Original	1.1 X	90.00 X
0290	R/F BUMPER CORNER	MK617989	Original	D.S ✓	90.00 ✓
0410	FRONT GRILLE	MC975208	Original	CN ✓	550.00 ✓
0431	FRONT MANUFACT	MK546616	Original	1.1 ✓	60.00 ✓
	BADGE				
0432	BADGE	MK546617	Original	1.1 ✓	70.00 ✓
0433	BADGE	MK675497	Original	1.1 ✓	70.00 ✓

Code	Description	Part Number	Part Source	Price SGD
0561	LEFT HEADLAMP ASSY	MK580525	Original <i>ere 1/c X</i>	330.00
0562	RIGHT HEADLAMP ASSY	MK580526	Original <i>one</i>	330.00
0678	R/F INDICATOR	MK581220	Original <i>can one</i>	160.00
0718	R/POSITION LAMP	MK580530	Original <i>one</i>	110.00
0900	FRONT PANEL CPL	ML230262	Original <i>3050</i>	550.00
1000	GRILLE CHROME MLD	MOULDING	Original <i>one</i>	70.00

f: OEM Parts

n: Non-OEM Parts

u: Used parts

Savings

Subtotal

Total

0.00

3,245.00

3,245.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	3,245.00	3,245.00
Labour Time Base 10 WU/h		
Total 153.0 WU X 42.00 SGD/h	642.60	
Total of Labour		642.60
Paint Work Time Base 10 WU/h		
Labour Cost 92.0 WU X 42.00 SGD/h	386.40	
Material Cost	158.89	
Total Paint Including Material		545.29
Repair Cost Excludes GST		4,432.89
GST (+7.00%)		310.30
Repair Cost Included GST		4,743.19

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.