



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2207159

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 21/11/2022
Reference CC4/LPC22002443/Gpa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SHA 9983D
Insured Veh. XD 9478R
Claim No. 21/22/22/VC00/025541
Policy No. Z/21/VC00/111037
Accident Date 12/03/2022
Inspection Date 15/03/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC22002443/Gpa3q2 Date: 21/11/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 9478R	Veh. Inspected	SHA 9983D	
Policy No.	Z/21/VC00/111037	Coverage (\$)	0.00	
Claim No.	21/22/22/VC00/025541	Excess (\$)	0.00	
Assign From	GERALD POH	Assign Date	14/03/2022	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI AE IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHC851CVLU182799	Colour	YELLOW	
Odometer	112909 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	6 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	6 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	6 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	12/03/2022	Inspection Date	15/03/2022	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHA 9983D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER ASSY	DEFORMED	459.40	459.40
1	REAR BUMPER CENTRE MLDG	DEFORMED	451.25	451.25
1	REAR BUMPER BEAM	NOT NECESSARY	394.80	-
1	REAR BUMPER BEAM BRACKET LH	NOT NECESSARY	138.10	-
1	REAR BUMPER BEAM BRACKET RH	NOT NECESSARY	138.10	-
1	REAR BUMPER SIDE BRACKET LH	NOT NECESSARY	55.80	-
1	BOOTLID ASSY	BUCKLED	2,480.00	2,480.00
1	BOOTLID EMBLEM - IONIQ	NECESSARY	31.30	31.30
1	BOOTLID EMBLEM - HYBRID	NECESSARY	24.30	24.30
1	BOOTLID EMBLEM - H	NECESSARY	28.00	28.00
1	REAR FOG LAMP	NOT NECESSARY	201.50	-
1	ANTENNA ASSY SMARTKEY	NOT NECESSARY	40.50	-
1	BOOTLID LAMP LH	CUT	794.40	794.40
1	BOOTLID LAMP RH	CUT	794.40	794.40
1	TAILLAMP ASSY LH	NOT NECESSARY	870.40	-
10	REAR BUMPER CLIPS	NECESSARY	22.00	22.00
1	BOOTLID WINDSCREEN GLASS - SMALL	SMASHED	607.20	607.20
1	BOOTLID WINDSCREEN GLASS - MOULDING	NECESSARY	48.50	48.50
1	BOOTLID LOWER GARNISH	NOT NECESSARY	36.10	-
1	REAR END PANEL	NOT NECESSARY	532.00	-
1	REAR END PANEL GARNISH	NOT NECESSARY	346.80	-
	LESS 20% DISCOUNT		-1,698.97	-1,148.15
			6,795.88	4,592.60
	<u>SPECIAL NETT ITEMS</u>			
1	BOOTLID COMFORT LOGO (SN)	NECESSARY	30.00	30.00
1	BOOTLID COMFORT TEL. NOS LOGO (SN)	NECESSARY	30.00	30.00
1	BOOTLID APPS LOGO (SN)	NECESSARY	40.00	40.00
1	REVERSE SENSOR (SN)	CUT	180.00	180.00
1	REAR BUMPER MAT (SN)	NECESSARY	50.00	50.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	WINDSCREEN SEALANT (SN)	NECESSARY	46.00	46.00
			376.00	376.00
	LABOUR			
	PANEL BEATING - REAR.	NOT NECESSARY	1,400.00	700.00
	SPRAY PAINT - REAR.		800.00	750.00
	REMOVE / REFIX REVERSE SENSOR.		50.00	40.00
	CHECK WIRING.		50.00	30.00
	TUFF KOTE.		50.00	-
	REMOVE / REFIX REAR WINDSCREEN GLASS.		120.00	120.00
	TOWING.	NOT NECESSARY	60.00	-
GRAND TOTAL			9,701.88	6,608.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,300.00

Report Ref No. CC4/LPC22002443/Gpa3q2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 9983D

INSPECTION

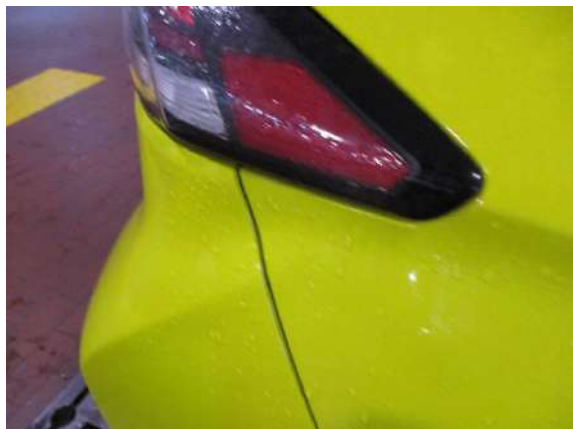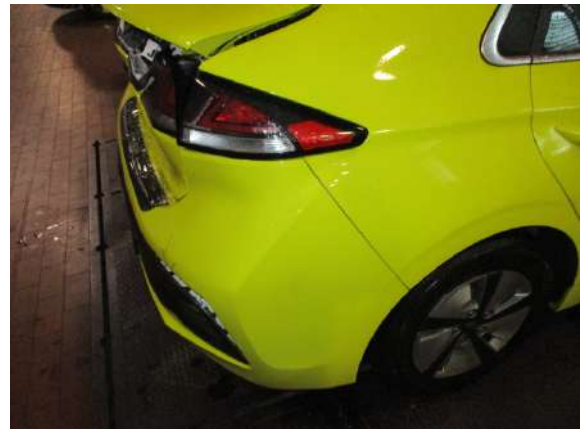




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

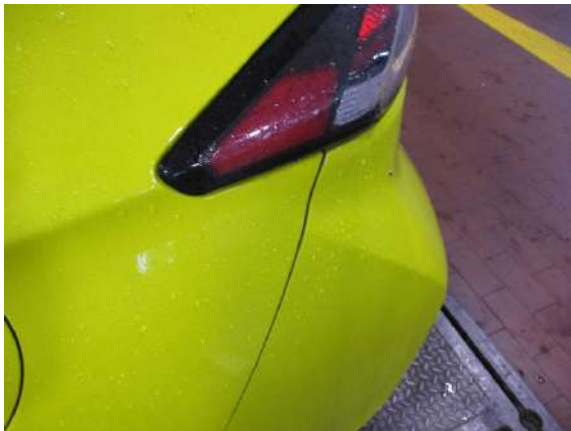



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHA 9983D

RE-INSPECTION

